



LEOPARD FAMILY

FL-B101D40

Leopard Bargraph Meter
101 Segment, 4 Digit 0.32" LEDs
in a 9/64 DIN CASE

This smart Tricolor or Mono-color digital bargraph has four fully programmable set points for monitoring, measurement, and control applications.

General Features

- External transmitters or signal conditioners can be eliminated by direct connection of the sensor output to more than 40 Plug-in Input Signal Conditioners that include:
 - AC/DC Current
 - AC/DC Voltage
 - Load Cell
 - Pressure
 - Process
 - Prototype
 - Resistance
 - Temperature
 - 4 to 20 mA
- Optional isolated 16 bit analog output. User or factory scalable to 4 to 20 mA, 0 to 20 mA or 0 to 10 V across any desired digital span from \pm one count to the full scale range of -1999 to 9999 (12000 counts).
- A Programmable Tricolor (Red-Green-Orange) or mono color (red or green), 101 segment high brightness bargraph. Vertical or optional horizontal format.
- Red 4-digit LED display with a range of -1999 to 9999 (12000 counts). Optional green digital display.
- Front panel LED annunciators provide indication of setpoint status.
- Two 9 Amp Form C, and two 4 Amp Form A relays available
- Auto-sensing AC/DC power supply. For voltages between 85-265 V AC / 95-300 V DC (PS1) or 18-48 V AC / 10-72 V DC (PS2).
- 24 V DC excitation is available to power external 4/20mA transmitters and 5 or 10 V DC excitation is available for resistance bridge type sensors.
- Provision to connect an external programming lockout switch.
- Provision for external DIM switch to reduce the brightest display setting by 50%.
- Optional NEMA-4 front cover.
- Automatic intelligent averaging, smooths noisy signals while providing a fast display response to real level changes.
- UL Listed

Software Features

- The bargraph can display, full scale, any desired portion of the digital reading.
- Bargraph center zero function.
- Four programmable setpoints with adjustable Hysteresis.
- Setpoint 1 has delay-on-make and delay-on-break plus a special "pump on pump off" mode that creates a Hysteresis Band between SP1 and SP2.
- Relay activation can be selected to occur above (hi) or below (Lo) each setpoint.
- Digital display blanking.
- Decimal point setting.
- Four-level brightness control accessed by the button and adjusted by the button.

Input Module Compatibility

☒ **LEOPARD FAMILY:** More than 38 different Plug-in I-Series Input Signal Conditioners are approved for Texmate's Leopard Family of meters.




Some examples are shown on pages 12 - 15.
 See www.texmate.com for an up to date listing.

Specifications

Input Specs: Depends on Input signal conditioner
A/D Converter: 14 bit single slope
Accuracy: $\pm(0.05\%$ of reading + 2 counts)
Temp. Coeff.: 100 ppm/°C (Typical)
Warm up time: 2 minutes
Conversion Rate: 10 conversions per second (Typical)
Digital Display: **4 digit 0.31" LED red (std)**, green (optn)
 Range -1999 to 9999 counts.
Bargraph Display: **101 segment 4" red vertical (std)**,
 green or tricolor (optn), horizontal (optn)
Polarity: Assumed positive. Displays - negative
Decimal Selection: Front panel button selectable, X•X•X•X•
Positive Overrange: Bargraph and top segments of digital display flash.
Negative Overrange: First segment of bargraph and bottom segments of digital display flash.
Relay Output: Two 4 Amp Form A relays and Two 9 Amp Form C relays.
Analog Output: Isolated 16 bit user scalable mA or V
 OIC (mA out) 4-20 mA @ 0 to 500 Ω max loop resistance
 OIV (volts out) 0-10 V DC @ 500 Ω or higher resistance
Power Supply: AC/DC Auto sensing wide range supply
 PS1 (std) 85-265 VAC / 95-300 VDC, 50-400Hz 4.2W
 PS2 18-48 VAC / 10-72 VDC, 50-400Hz 4.2W
Operating Temp.: 0 to 50°C
Storage Temp.: -20°C to 70°C
Relative Humidity: 95% (non condensing)
Case Dimensions: 9/64 DIN (Bezel 36Wx144Hmm)
 Depth behind bezel (5.83") 148mm
 Plus (0.7") 18mm for connectors
Weight: 9.5 oz., 12 oz when packed




Index

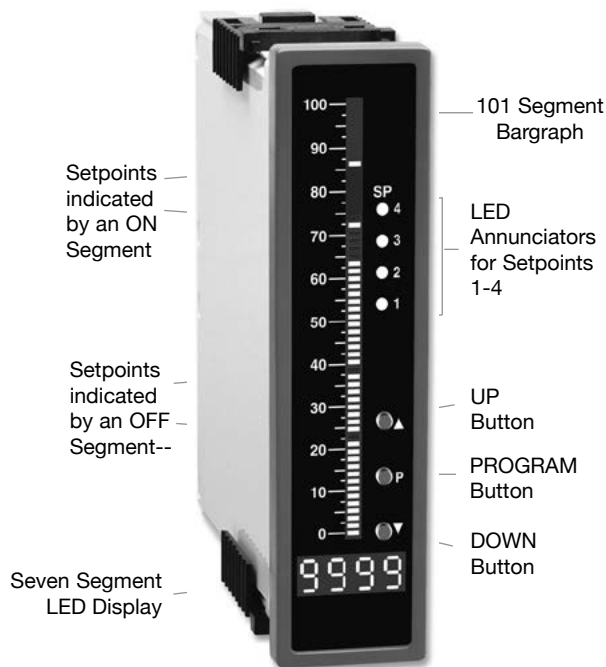Bargraph Center Point Display Mode Selection . . .	6	Digital Span Selection for Display	5	Programming Conventions.	2
Bargraph Color Programming Mode	9	Digital Span Selection for Analog Range Output . . .	6	Setpoint Setting & Relay Configuration Mode. . .	8-9
Case Dimensions	7	Functional Diagram	10	Software Features	1
Component Layout.	11	General Features	1	Software Logic Tree	3
Connector Pinouts	10	I-Series Input Signal Conditioning Modules . . .	12-15	Specifications.	1
Connectors.	11	Input Module Calibration Procedures	17	Standard Faceplates and Scales.	18
Controls and Indicators	2	Input Module Component Glossary.	16	Two Point Analog Range Setting & Calibration . . .	7
Custom Faceplates and Scales.	19	Ordering Information	20	Two Point Digital Calibration Mode	4
Decimal Point and Brightness Selection	5	Pin Descriptions.	10		





Front Panel Buttons

Program Button


The  button is used to move from one program step to the next. When pressed at the same time as the  button, it initiates the **calibration mode**. When pressed at the same time as the  button, it initiates the **setpoint setting mode**.


Up Button

When in the operational display, pressing the  button allows you to view the setting of the saved **Peak and Valley Values**.

When setting a displayed parameter during programming, the  button is used to increase the value of the displayed parameter.

Down Button

When in the operational display, pressing the  button allows you to change the **Brightness Level** as well as to view the setting of the setpoints **SP1, SP2, SP3 & SP4**.

When setting a displayed parameter during programming, the  button is used to decrease the value of the displayed parameter.

Front Panel LED Display

Annunciator LEDs

The annunciator LEDs indicate the alarm status. They are labeled from bottom to top: SP1, SP2, SP3, SP4.

Digital LED Displays

 
The digital LED displays are used to display the meter input signal readings. They also display the programming settings during programming.

Setpoint Indication

The position of setpoints on the bargraph display are indicated by an ON or OFF segment dependent on the bargraph display being above or below the setpoint.

Programming Conventions

To explain software programming procedures, logic diagrams are used to visually assist in following the programming steps. The following symbols are used throughout the logic diagrams to represent the buttons and indicators on the meter:



This symbol represents the OPERATIONAL DISPLAY.



 
This is the PROGRAM button.




This is the UP button.




This is the DOWN button.



  When a button is shown, press and release it to go onto the next step in the direction indicated by the arrow. When an alternative dotted line is shown, this indicates that an alternative logic branch will be followed when a particular option is present.







When two buttons are shown side by side and enclosed by a dotted line, they must be pressed at the same time then released to go onto the next programming step.








If an X appears through a digit, it means that any number displayed in that digit is not relevant to the function being explained.



When the  and  buttons are shown together, the display value can be increased by pressing and releasing the  button or decreased by pressing and releasing the  button.




When the  and  buttons are shown with two displays, either display can be selected by pressing and releasing the  or  buttons.

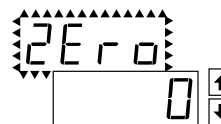




When two displays are shown together with bursts, this indicates that the display is toggling (flashing) between the name of the function and the value.

[Span]
[10000]

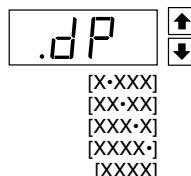Text or numbers shown between square brackets in a procedure indicate the programming code name of the function or the value displayed on the meter display.



When there are more than two display selections they are shown in brackets below the first display and are also selectable by pressing and releasing the  or  buttons.

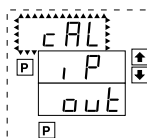


A dotted line enclosing an entire logic diagram indicates that programming branch will appear only when a particular option is present.

Software Logic Tree

The FL-B101D40 is an intelligent bargraph meter with a hierarchical software structure designed for easy programming and operation, as shown below in the software logic tree.

Software Version is Displayed on Power-up

When power is applied, all segments of the bargraph and digital display light up for 3 seconds. The version number of the installed software is then displayed for 2 seconds, after which, the operational display indicates the input signal.

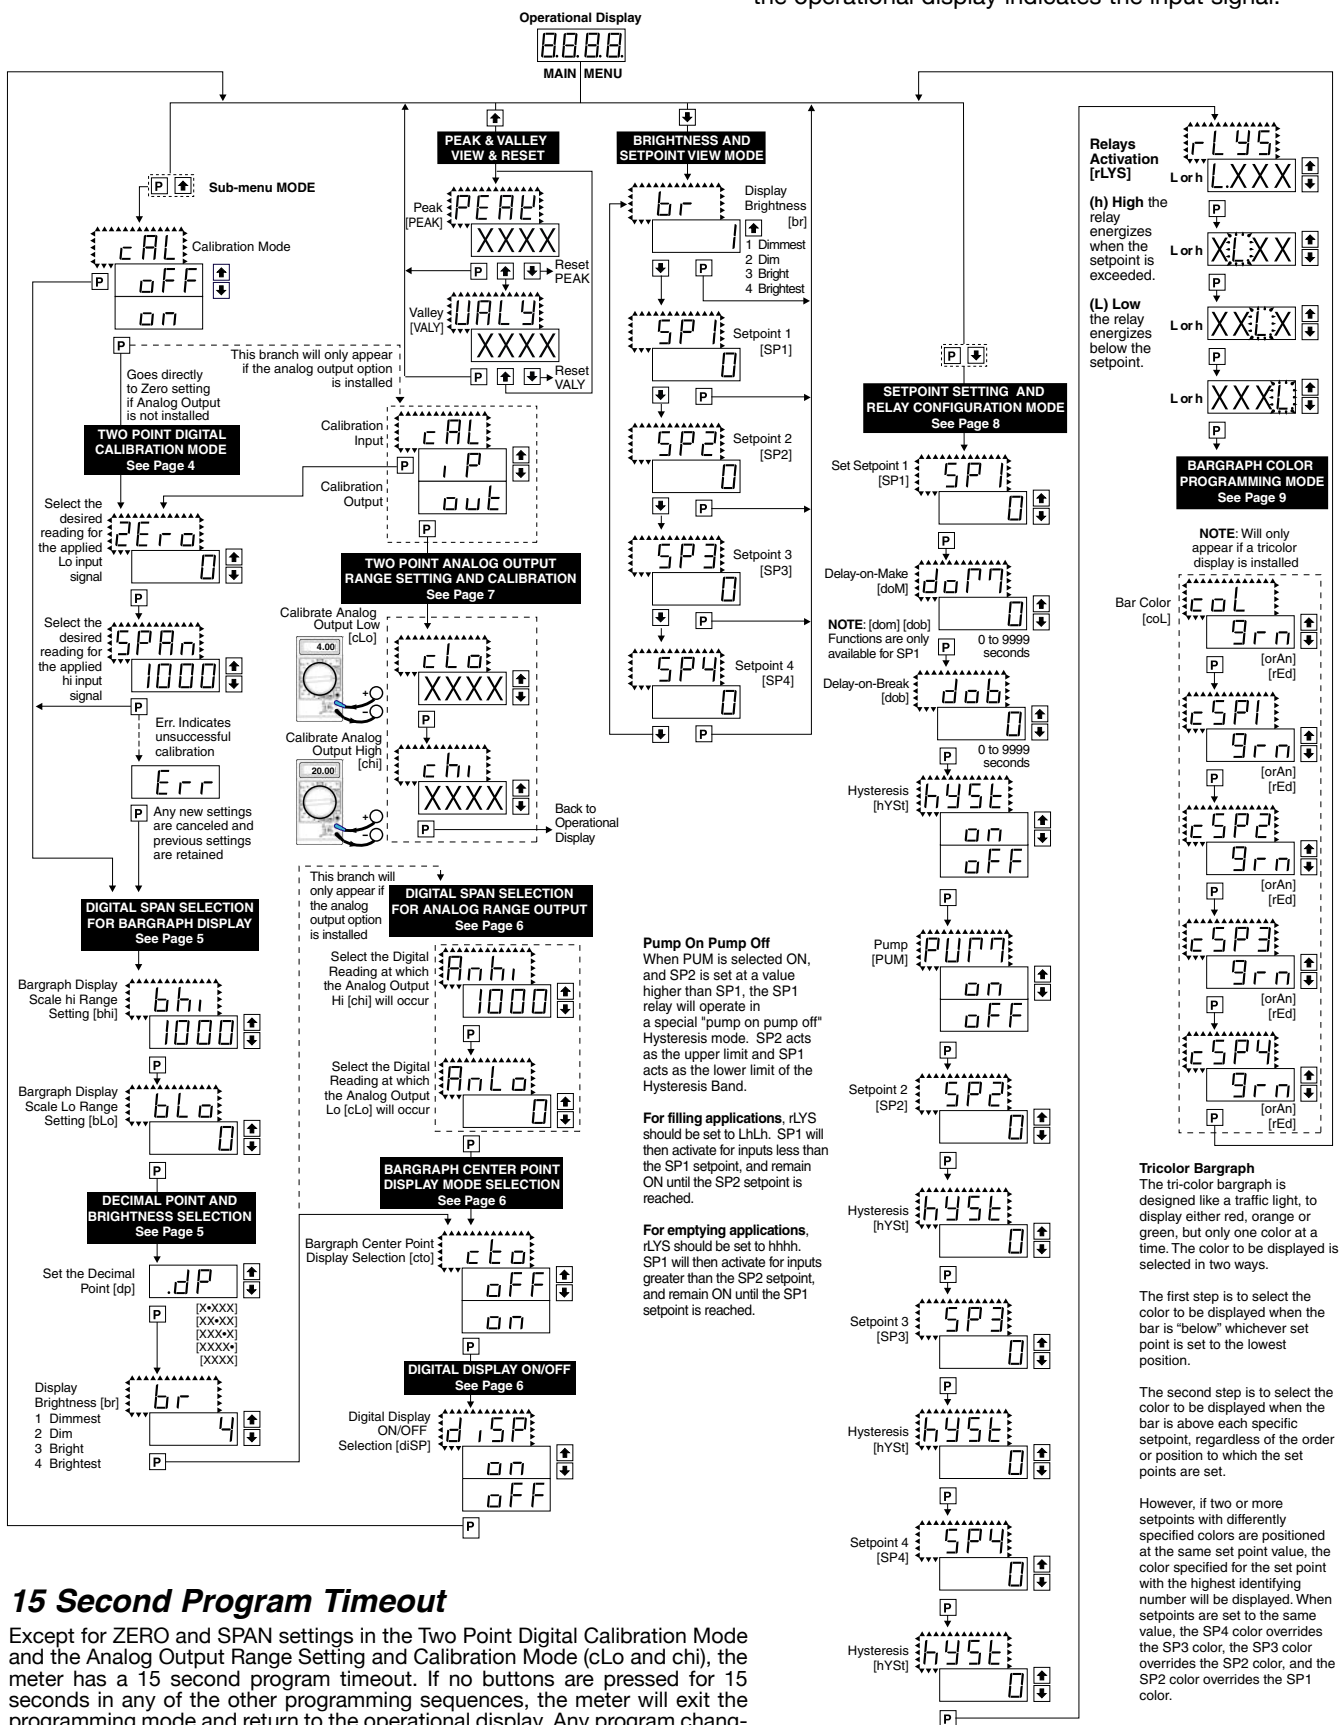

Two Point Digital Calibration Mode

This mode enables the meter to be calibrated by applying a zero or low input signal, entering the desired reading for that signal, then applying a high input signal, and then entering the desired reading for that signal. The meter then automatically calculates and programs in the requisite scale factor, within the following parameters.

1. Positive and negative signals may be applied, but the difference between the low and the high signal inputs must be at least 1000 counts or Err will be indicated.
2. Positive and Negative values for the desired reading can be entered, but the scale factor created can not exceed the Digital Display Span capability of the meter which is 12,000 counts between -1999 to 9999.
3. The internal Signal Span is limited to 3 V DC between -1 V DC to +2 V DC. Any outputs from an Input Signal Conditioning module that exceed these limits will cause the meter to indicate overrange regardless of the Digital Display Span scaled.

Note: Many input signal conditioners have provisions for analog calibration and scaling. If the meter is digitally set to read zero with a zero input (shorted input), and to read 1000 with a 1.000 V input, any pre-calibrated analog signal conditioner, with an output that does not exceed -1 V to +2 V, will read correctly without any further calibration when it is inserted in the meter.

STEP A Enter the Calibration Mode

- 1) Press the **P** and **↕** buttons at the same time. Display toggles between [CAL] and [oFF].
- 2) Press the **↕** or **↴** button. Display changes from [oFF] to [on].
- 3) Press the **P** button. Display toggles between [CAL] and [out].

Note: If at this point, the display skips directly to STEP C and toggles between [SPAN] and the previous [SPAN] setting, the software is detecting that the optional analog output hardware is NOT installed.

STEP B Select Two Point Digital Calibration of Input Signal

- 1) Press the **↕** or **↴** button to select CAL [iP] for input signal calibration.
- 2) Press the **P** button. Display toggles between [ZEro] and the previous zero setting.

STEP C Set the Meter's Low Input Signal Reading on the Digital Display

- 1) Apply a zero or low signal to the meter. (Positive or negative values are allowed).
- 2) Using the **↕** and **↴** buttons, adjust the meter display to the desired reading for the applied low input signal.
- 3) Press the **P** button. Display toggles between [SPAN] and the previous span setting.

STEP D Set the Meter's High Input Signal Reading on the Digital Display

- 1) Apply a high input signal to the meter.
- 2) Using the **↕** and **↴** buttons, adjust the digital display to the desired reading for the applied high input signal.
- 3) Press the **P** button.


The Digital Calibration Procedure is now complete.

If the digital calibration was successfully completed, the menu branches to the Digital Span Selection for Bargraph Display (see page 5), and the display flashes [bhi] and the previous setting.

ERROR Indicates Unsuccessful Calibration

If the calibration was unsuccessful, the display indicates [Err], the new calibration settings just entered will not take effect and the previously stored setting will remain. The three most likely causes of an error during calibration are:

1. The full scale and zero signals were too similar. The full scale signal must be at least 1000 counts greater than the zero or low input signal (positive and negative values are allowed).
2. The scaling requirement exceeded the digital display span capability of the meter (12,000 counts between -1999 to 9999).
3. No input signal present, or incorrect input signal connections.

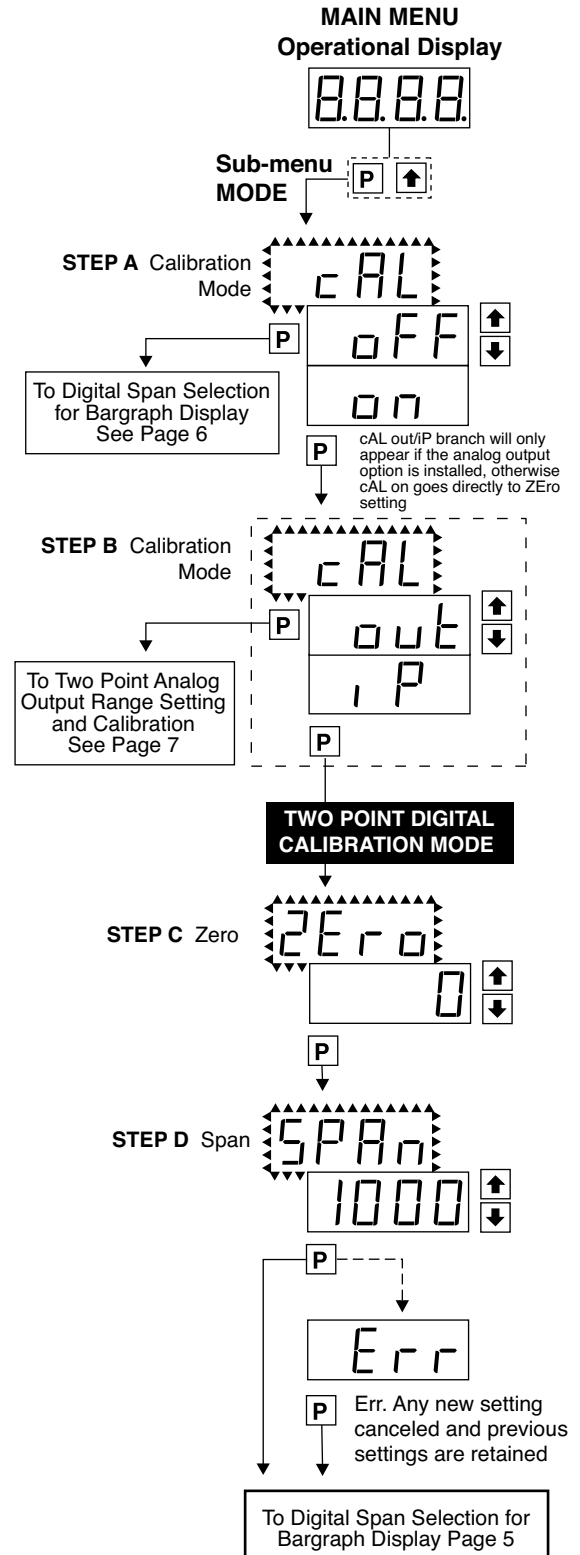

Digital Span Selection For Bargraph Display


The bargraph can be set to display full scale (0-101 bars) any portion of the digital reading from a minimum of 100 counts to a maximum of 12,000 counts. This provides higher resolution bargraph indication for those applications where the normal operating input signal range is less than the desired full scale display range of the digital display.

For Example:

If the full scale range of the meter has been set from -1999 to 9999 (0-12,000 counts), but the normal operating range of the input signal is between 4000 & 6000. The bargraph high parameter [bhi] can be set to 6000 and the bargraph low parameter [bLo] can be set to 4000.

This means that although the meter could digitally display a signal from -1999 to 9999 (0-12,000 counts), the bargraph display only begins to function at a reading of 4000, and reaches full scale indication at a reading of 6000. Although the digital display will continue reading up to 9999 before indicating overrange, the bargraph display will indicate its overrange by flashing for readings above 6000.

Example of Setting the Digital Span of the Bargraph Display to be Different than the Digital Display Range

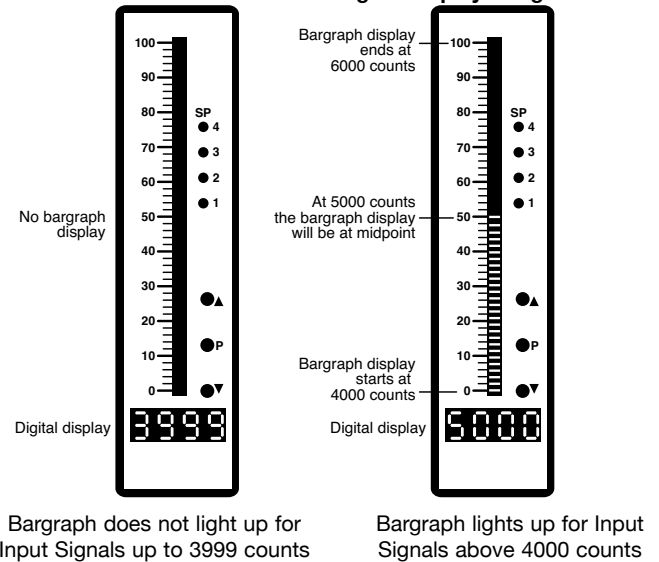

STEP A Enter the Calibration Sub Menu Mode

- 1) Press the **[P]** and **[↑]** buttons at the same time. Display toggles between [CAL] and [oFF].
- 2) Press the **[P]** button. Display toggles between [bhi] and the previous setting.

STEP B Set the Digital Span of the Bargraph Display (See example above)

- 1) Using the **[↑]** and **[↓]** buttons, adjust the display to the desired high parameter reading, e.g. 6000 counts.
- 2) Press the **[P]** button. Display toggles between [bLo] and the previous setting.
- 3) Using the **[↑]** and **[↓]** buttons, adjust the display to the desired low parameter reading, e.g. 4000 counts.
- 4) Press the **[P]** button. Display changes from [4000] to [dP].

Decimal Point and Brightness Selection


STEP C Set the Decimal Point

- 1) Using the **[↑]** and **[↓]** buttons, adjust the display to the desired decimal point setting.
- 2) Press the **[P]** button. Display toggles between [br] and the previous brightness setting.

STEP D Set the Bargraph and Digital Display Brightness

- 1) Using the **[↑]** and **[↓]** buttons, adjust the display to the desired brightness setting (4 is the brightest setting).
- 2) Press the **[P]** button. Display toggles between [Anhi] and the previous [Anhi] setting.

Note: If at this point, the display skips directly to STEP G and toggles between [Cto] and [oFF], the software is detecting that the optional analog output hardware is NOT installed.

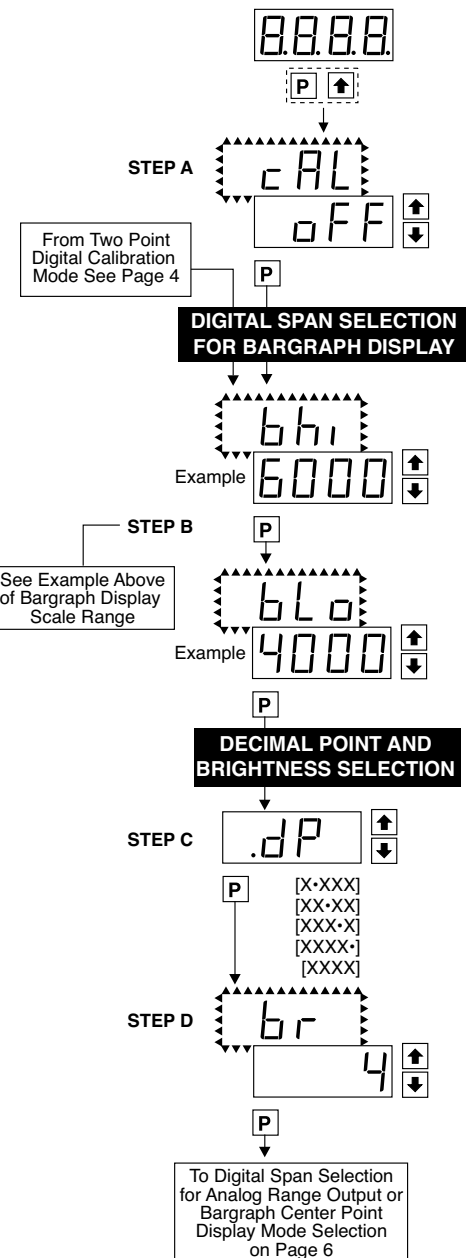

Digital Span Selection for Analog Range Output

STEP E Selecting the [AnHi] Digital Value for Analog High Output

- 1) Using the \uparrow and \downarrow buttons, adjust the display to the desired digital value at which the [chi] Calibrated Analog High output will occur. For digital readings outside the digital span selected, the analog output will linearly rise above the value set for chi, up to the maximum analog output capability. However, the analog output will not go lower than the calibrated value set for cLo (see below).
- 2) Press the \boxed{P} button. Display toggles between [AnLo] and previous [AnLo] setting.

STEP F Selecting the [AnLo] Digital Value for Analog Low Output

- 1) Using the \uparrow and \downarrow buttons, adjust the display to the desired digital value at which the [cLo] Calibrated Analog Low output will occur. For Digital readings outside the Digital Span selected, the analog output will not go lower than the calibrated value set for cLo.
- 2) Press the \boxed{P} button. The display toggles between [cto] and [oFF].

Note: Any two digital span points from -1999 to 9999 can be selected. The digital values for [AnHi] analog high and [AnLo] analog low can be reversed to provide a 20 to 4mA output. The digital span selected can be as small as two counts, when using the analog output to function as a Control or Alarm Driver. Small digital spans will cause the high resolution 16 bit D to A to increment digitally in stair case steps.

Bargraph Center Point Display Mode Selection

Example of Using the Center Point Bargraph Display Mode with a Unipolar Input

If the meter's full scale range is set to 5000 counts, the midpoint would be 2500 counts. If a signal of 2500 counts is applied only one segment at the 2500 count mark will light up. If a signal of 4000 counts is applied the segments between the center segment (2500 counts) and the 4000 count mark light up.

If a signal of 1000 counts is applied, the segments between the center segment (2500 counts) and the 1000 count mark will light up.

Example of Using the Center Point Bargraph Display Mode with Bipolar Signal Inputs

The meter may also be calibrated to display symmetrical bipolar signals such as ± 1 V or ± 10 V. When the center point display mode is selected, it will then function as a center zero meter. When positive signals are applied, the bar will go up from the center point, and when negative signals are applied, the bar will go down from the center point.

STEP G Bargraph Center Point Mode Selection (See example above)




- 1) To select bargraph center point mode, press the \uparrow or \downarrow button. Display changes from [oFF] to [on].
- 2) Press the \boxed{P} button. Display toggles between [diSP] and [on] or [oFF].

STEP H Digital Display ON/OFF Selection

- 1) To set the display to [oFF], press the \uparrow or \downarrow button. Display toggles between [diSP] and [oFF].
- 2) Press the \boxed{P} button. The display exits the calibration mode and returns to the operational display. Only the bargraph display is on and the digital display is off.

If the digital display is selected to be off, pressing any button to make programming changes or to view setpoints activates the digital display. When the procedure is complete, the digital display will then automatically switch off.

The Display/Bargraph settings are now complete.

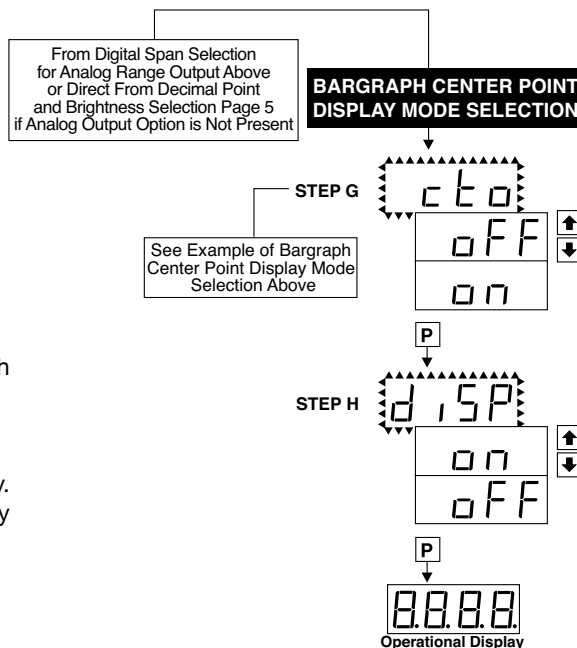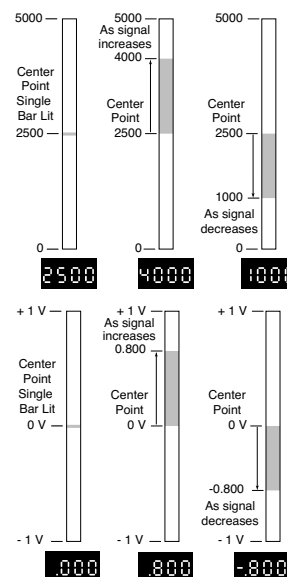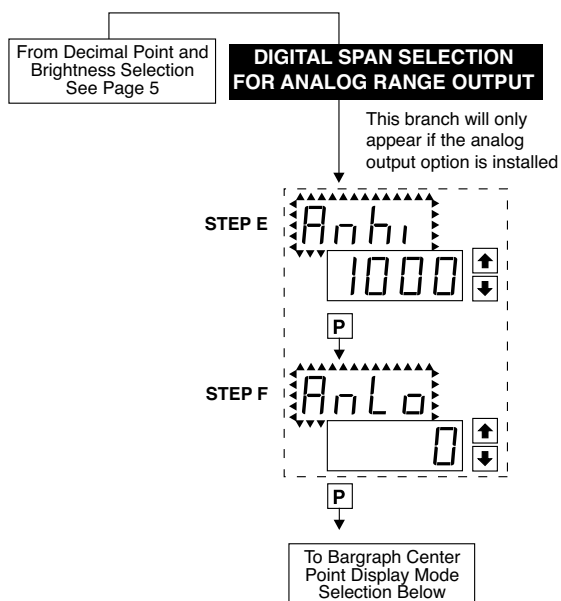

Setpoint Setting and Relay Configuration Mode

The following programming steps are required to enter the setpoint values and configure the relay functions in a meter with four relays using four setpoints. Generally if less than four relays are installed, the setpoints without relays are operational in software for tri-color control or display only purposes. To remove unwanted setpoint indications, set them to 9999 or -1999 depending on the relay activation mode selected.

STEP A Enter the Setpoint Mode

- 1) Press the **[P]** and **[↓]** buttons at the same time. Display toggles between [SP1] and the previous SP1 setting.

STEP B Set Setpoint 1 [SP1]

- 1) Using the **[↑]** and **[↓]** buttons, adjust the display to the desired SP1 value.
- 2) Press the **[P]** button. Display toggles between [doM] and the previous [doM] setting.

STEP C Set the SP1 Delay-on-Make [doM] Delay Time Setting

- 1) Using the **[↑]** and **[↓]** buttons, adjust the display to the desired [doM] value (0 to 9999 seconds). The reading must continuously remain in an alarm condition until this delay time has elapsed before the relay will make contact (energize).
- 2) Press the **[P]** button. Display toggles between [dob] and the previous [dob] setting.

STEP D Set the SP1 Delay-on-Break [dob] Delay Time Setting

- 1) Using the **[↑]** and **[↓]** buttons, adjust the display to the desired [dob] value (0 to 9999 seconds). The reading must continuously remain in a non-alarm condition until this delay time has elapsed before the relay will break contact (de-energize).
- 2) Press the **[P]** button. Display toggles between [hYSt] and the previous [hYSt] setting.

STEP E Select the Hysteresis [hYSt]

- 1) Using the **[↑]** and **[↓]** buttons, select the Hysteresis to be ON or OFF.
- 2) Press the **[P]** button. Display toggles between PUM and (on) or (oFF).

STEP F Select Pump [PUM] (on) or (oFF)

- 1) Using the **[↑]** and **[↓]** buttons, select the Pump to be ON or OFF. When PUM is selected ON, and SP2 is set at a value higher than SP1, the SP1 relay will operate in a special "pump on pump off" mode. SP2 acts as the upper limit and SP1 acts as the lower limit of the Hysteresis Band on the SP1 relay.

For filling applications:

[rLYS] should be set to [LhXX] (see step M). The SP1 relay and SP1 LED Annunciator will then activate for inputs less than the SP1 setpoint, and remain ON until the SP2 setpoint is reached.

For emptying applications:

[rLYS] should be set to [hhXX] (see step M). The SP1 relay and SP1 LED Annunciator will then activate for inputs greater than the SP2 setpoint, and remain ON until the SP1 setpoint is reached.

- 2) Press the **[P]** button. Display toggles between [SP2] and the previous SP2 setting.

STEP G Set Setpoint 2 (SP2)

- 1) Using the **[↑]** and **[↓]** buttons, adjust the display to the desired SP2 value.
- 2) Press the **[P]** button. Display toggles between [hySt] and the previous [hySt] setting.

STEP H Select the Hysteresis [hYSt]

- 1) Using the **[↑]** and **[↓]** buttons, select the Hysteresis to be ON or OFF.
- 2) Press the **[P]** button. Display toggles between [SP3] and the previous [SP3] setting.

STEP I Set Setpoint 3 (SP3) (No [doM] or [dob])

- 1) Using the **[↑]** and **[↓]** buttons, adjust the display to the desired SP3 value.
- 2) Press the **[P]** button. Display toggles between [hySt] and the previous [hySt] setting.

STEP J Select the Hysteresis [hYSt]

- 1) Using the **[↑]** and **[↓]** buttons, select the Hysteresis to be ON or OFF.
- 2) Press the **[P]** button. Display toggles between [SP4] and the previous [SP4] setting.


STEP K Set Setpoint 4 (SP4) (No [doM] or [dob])

- 1) Using the **[↑]** and **[↓]** buttons, adjust the display to the desired SP4 value.
- 2) Press the **[P]** button. Display toggles between [hySt] and the previous [hySt] setting.

STEP L Select the Hysteresis [hYSt]

- 1) Using the **[↑]** and **[↓]** buttons, select the Hysteresis to be ON or OFF.
- 2) Press the **[P]** button. Display toggles between [rLYS] and the previous relay setting.

Please Continue On Next Page.

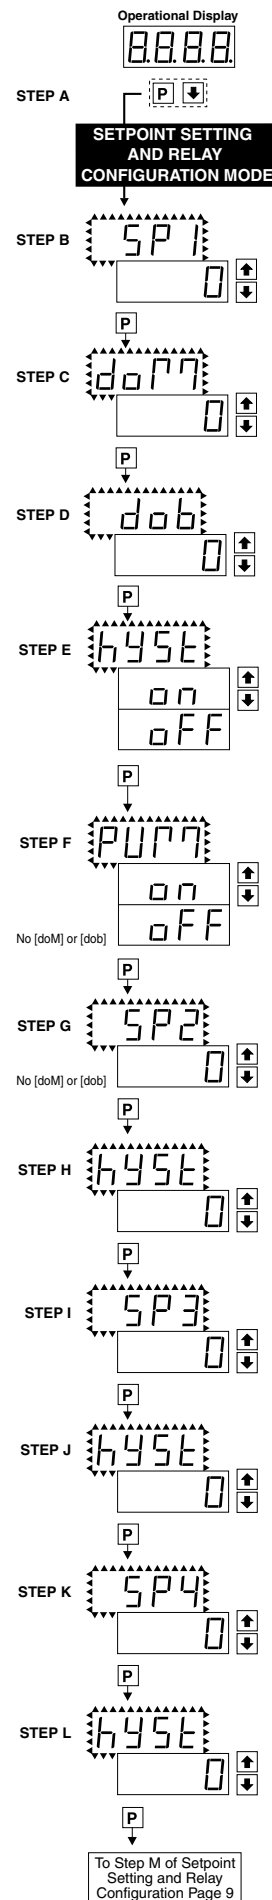

Setpoint Setting and Relay Configuration Mode Continued

STEP M Set Relay Activation mode [rLYS] for SP1

(h) High the relay energizes when the setpoint is exceeded. (L) Low the relay energizes below the setpoint. The setpoint is indicated from left to right SP1, SP2, SP3, SP4.

- 1) Using the and buttons, select (L) or (h) for the first digit, which corresponds to SP1.
- 2) Press the button. The SP2 Relay Activation digit begins to flash, and its decimal point is lit.

STEP N Set High (h) or Low (L) for SP2

- 1) Using the and buttons, select (L) or (h) for the second digit, which corresponds to SP2.
- 2) Press the button. The SP3 Relay Activation digit begins to flash, and its decimal point is lit.

STEP O Set High (h) or Low (L) for SP3

- 1) Using the and buttons, select (L) or (h) for the third digit, which corresponds to SP3.
- 2) Press the button. The SP4 Relay Activation digit begins to flash, and its decimal point is lit.

STEP P Set High (h) or Low (L) for SP4

- 1) Using the and buttons, select (L) or (h) for the fourth digit, which corresponds to SP4.
- 2) Press the button.

If a mono-color red or green display is installed then the Setpoint Relay Programming Mode is now complete and the meter returns to the operational display.

If a tricolor bargraph display is installed then the Bargraph Color Programming Mode will be entered and display toggles between [CoL] and the previous setting. Color selection menu will be displayed.

Bargraph Color Programming Mode

To comply with the latest safety requirements, the tri-color bargraph is designed like a traffic light, to display either red, orange or green, but only one color at a time. When the bar reaches a selected color change point, the entire bar will change to the color designated for that zone. This eliminates any ambiguity as to the signal status, especially just after transitioning to a new zone.

First (Step Q) is to select the color to be displayed, when the bar is “below*”, whichever set point is set to the lowest position.

Second (Steps R, S, T, and U) is to select the color to be displayed when the bar is above each specific set point, regardless of the order or position to which the set points are set.

However, if two or more setpoints with differently specified colors are positioned at the same set point value, the color specified for the set point with the highest identifying number will be displayed. When set points are set to the same value, the SP4 color overrides the SP3 color, the SP3 color overrides the SP2 color, and the SP2 color overrides the SP1 color.

STEP Q Select Bargraph Color when the bar is BELOW* the Setpoint that is set to the lowest position

- 1) Using the and buttons, select the desired bargraph color [grn], [oran] or [red]
- 2) Press the button. Display toggles between [CSP1] and the previous color setting.

STEP R Select Bargraph Color when the bar is ABOVE* SP1 Setpoint

- 1) Using the and buttons, select the desired bargraph color [grn], [oran] or [red]
- 2) Press the button. Display toggles between [CSP2] and the previous color setting.

STEP S Select Bargraph Color when the bar is ABOVE* SP2 Setpoint

- 1) Using the and buttons, select the desired bargraph color [grn], [oran] or [red]
- 2) Press the button. Display toggles between [CSP3] and the previous color setting.


STEP T Select Bargraph Color when the bar is ABOVE* SP3 Setpoint

- 1) Using the and buttons, select the desired bargraph color [grn], [oran] or [red]
- 2) Press the button. Display toggles between [CSP4] and the previous color setting.

STEP U Select Bargraph Color when the bar is ABOVE* SP4 Setpoint


- 1) Using the and buttons, select the desired bargraph color [grn], [oran] or [red]
- 2) Press the button. The meter exits the setpoint mode and returns to the operational display.

The Bargraph Color programming mode is now complete.

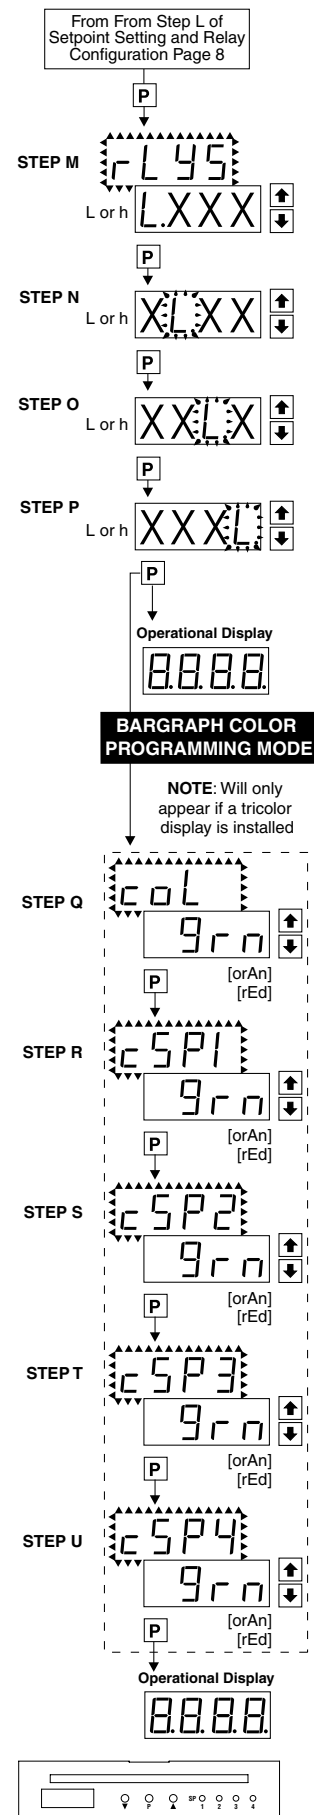

***Note:** For horizontal display formats BELOW* should be read as, “to the left” and ABOVE* should be read as, “to the right”.

Functional Diagram

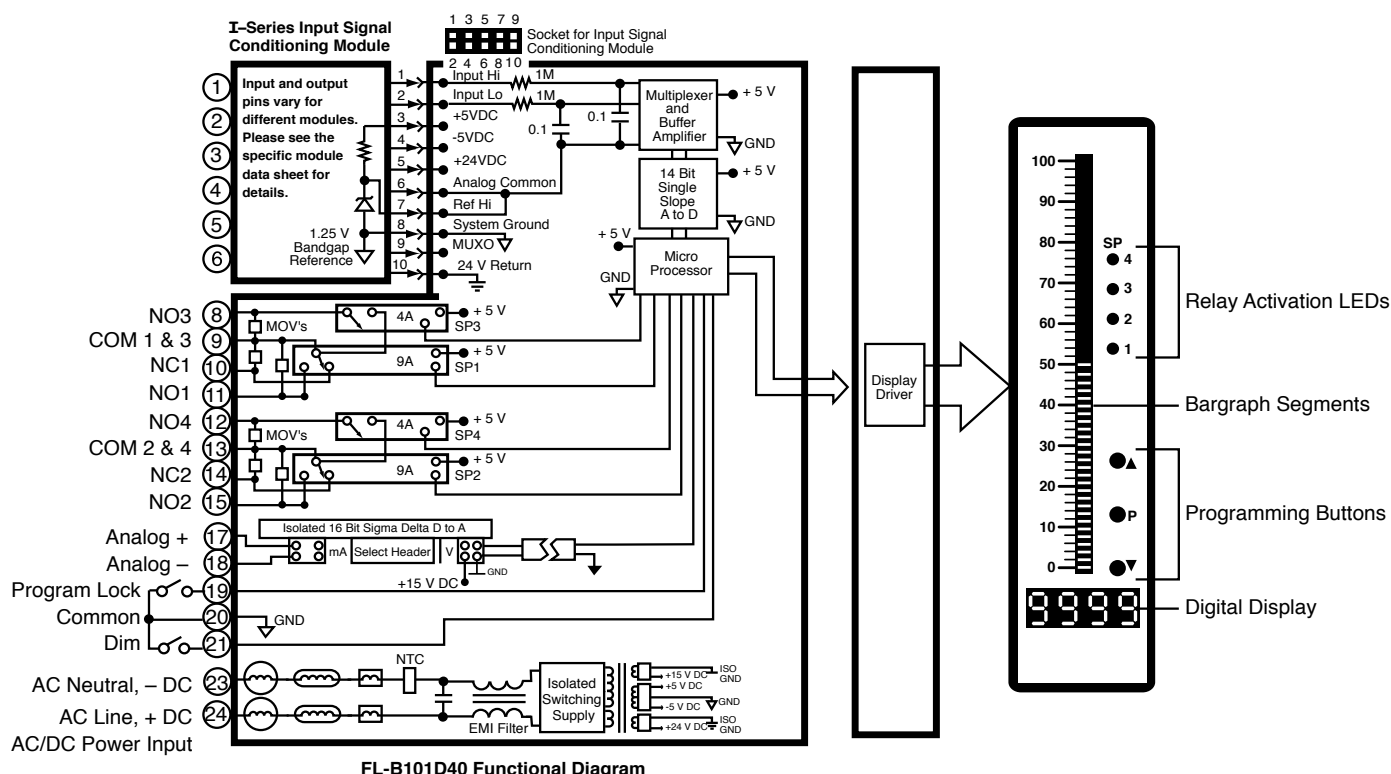


Connector Pinouts

This meter uses plug-in type screw terminal connectors for all input and output connections. The power supply connections (pins 23 and 24) have a unique plug and socket outline to prevent cross connection. The main board uses standard right-angled connectors.

Replacement 2-, 3-, and 4-pin plug connectors are available (see Accessories on page 20).



WARNING: AC and DC input signals and power supply voltages can be hazardous. Do Not connect live wires to screw terminal plugs, and do not insert, remove or handle screw terminal plugs with live wires connected.

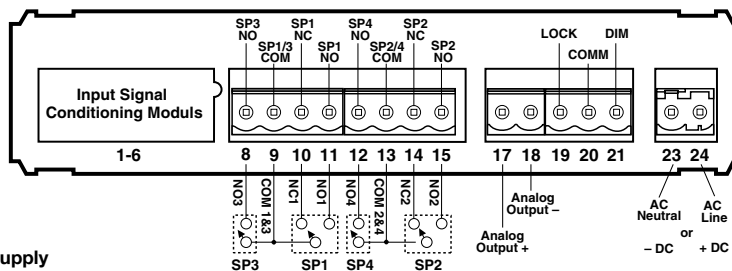

Note: The sequence of setpoint outputs is now 3-1-4-2, enabling delay on make (dom) and delay on break (dob) to be used with both Form "C" relays.

Pin Descriptions

Input Signal – Pins 1 to 6

Pins 1 to 6 are reserved for the input signal conditioner. See the data sheet for the selected input signal conditioner.

Pins 8 to 15 – Relay Output Pins

- Pin 8** **SP3 NO.** Normally Open 4 Amp Form A.
- Pin 9** **SP1/3 COM.** Common for SP1 and SP3.
- Pin 10** **SP1 NC.** Normally Closed 9 Amp Form C.
- Pin 11** **SP1 NO.** Normally Open 9 Amp Form C.
- Pin 12** **SP4 NO.** Normally Open 4 Amp Form A.
- Pin 13** **SP2/4 COM.** Common for SP2 and SP4.
- Pin 14** **SP2 NC.** Normally Closed 9 Amp Form C.
- Pin 15** **SP2 NO.** Normally Open 9 Amp Form C.

Pins 17 to 21 – Rear Panel Switches

- Pin 17** **ANALOG OUTPUT (+).** mA (0 to 20 mA/4 to 20 mA) or V (0 to 10 V) output is header selectable.


- Pin 18** **ANALOG OUTPUT (-).** mA (0 to 20 mA/4 to 20 mA) or V (0 to 10 V) output is header selectable.
- Pin 19** **Programming LOCK.** By connecting the LOCK pin to the COMMON pin, the meter's programmed parameters can be viewed but not changed.
- Pin 20** **COMMON.** To activate the LOCK or DIM functions from the rear of the meter, the respective pins have to be connected to the COMMON pin. This pin is connected to the internal power supply ground.
- Pin 21** **DIM.** By connecting the display dim (DIM) pin to the COMMON pin, the display brightness setting is halved.

Pins 23 and 24 – AC/DC Power Input

Auto-sensing AC/DC power supply. For voltages between 85-265 V AC / 95-300 V DC (PS1) or 18-48 V AC / 10-72 V DC (PS2).

- Pin 23** **AC Neutral / -DC.** Neutral power supply line.
- Pin 24** **AC line / +DC.** Live power supply line.

Component Layout

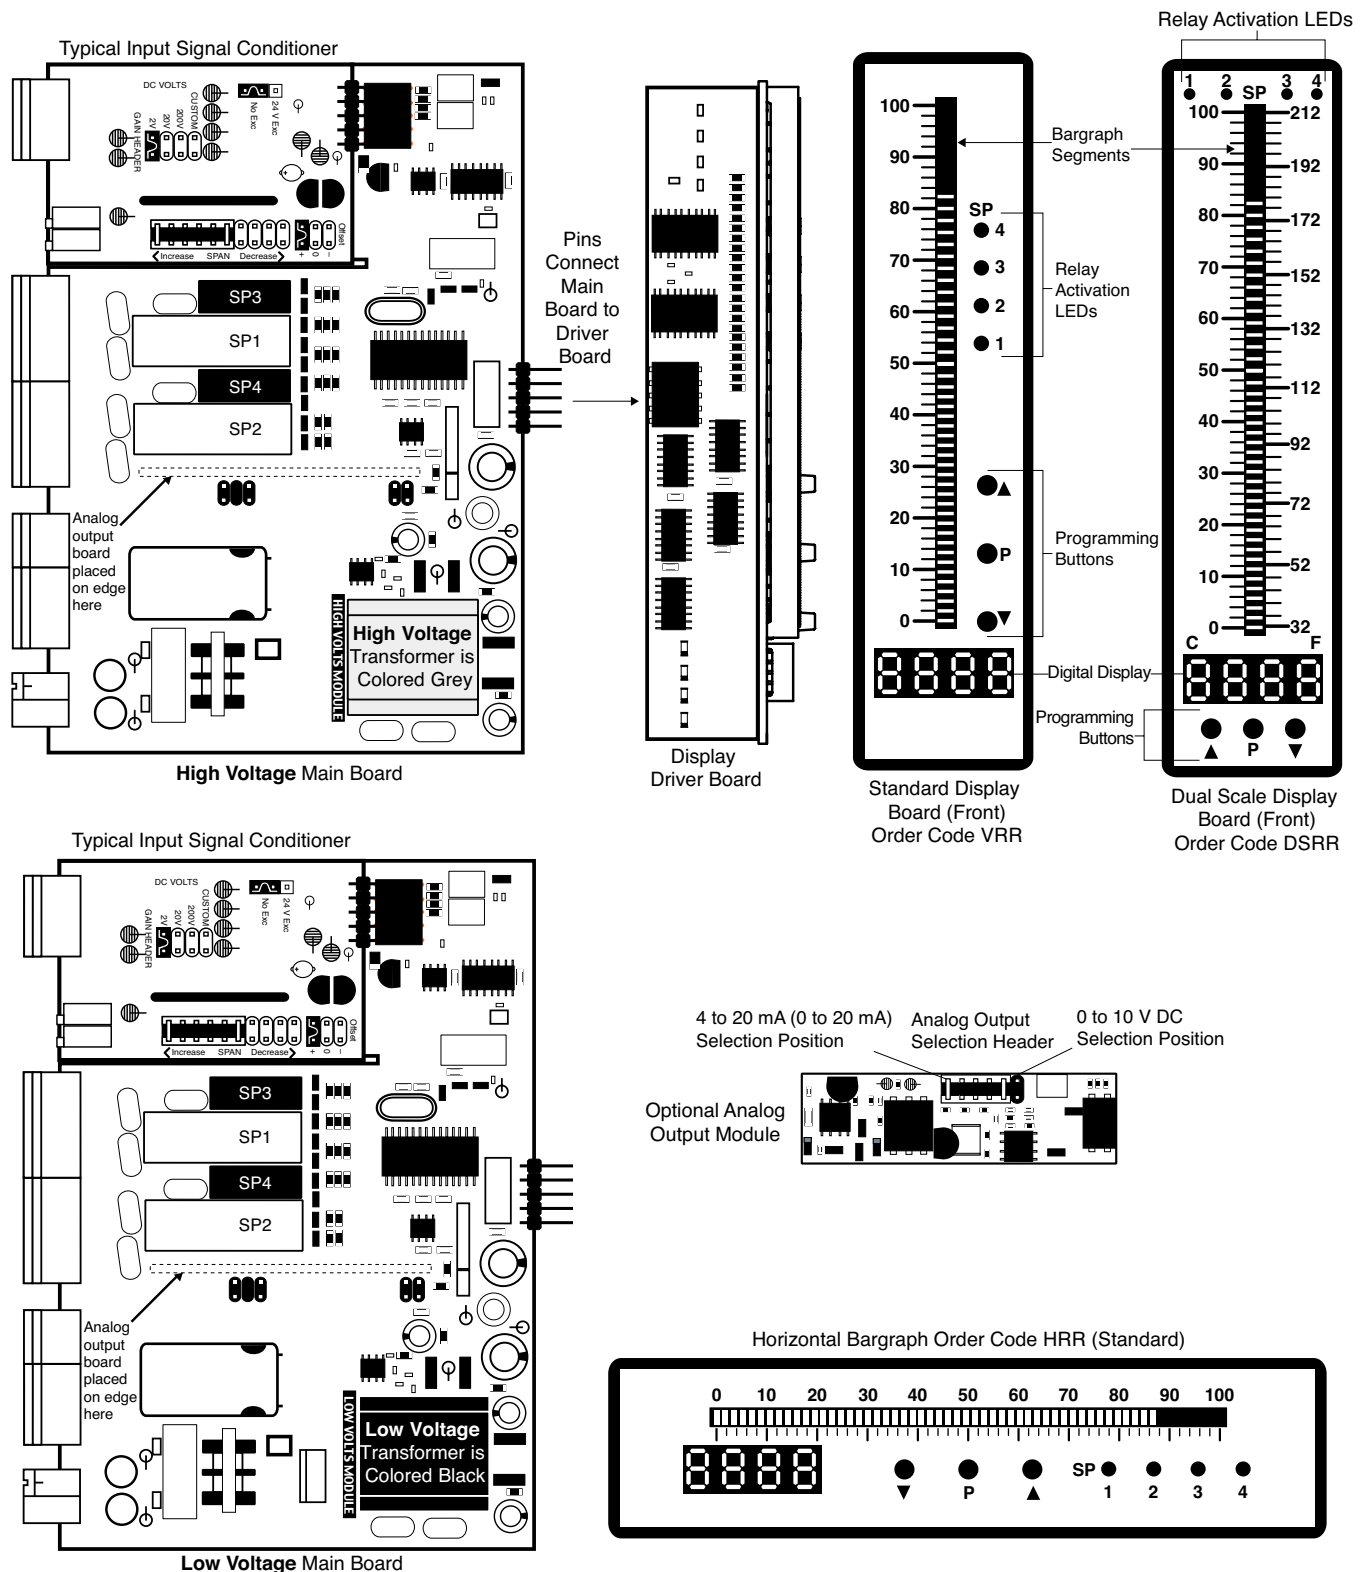


Connectors



WARNING

AC and DC input signals and power supply voltages can be hazardous. Do Not connect live wires to terminal blocks, and do not insert, remove or handle terminal blocks with live wires connected.

Standard plug-in screw terminal blocks provided by Texmate:

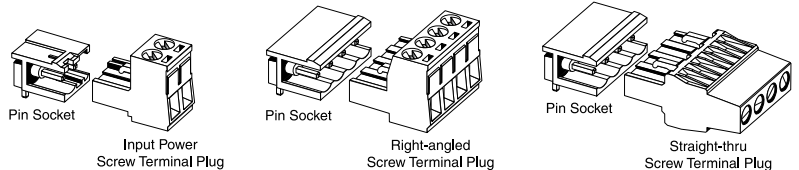










I-Series Input Signal Conditioning Modules

Many additional input modules are available and others are constantly being developed. Check with your local distributor or www.texmate.com for updated information.

Pre-calibrated **I-Series** input modules, that have span or zero potentiometers, can be interchanged between any **I-Series** compatible meter, without recalibration, because all of the analog scaling and reference circuitry is self-contained within the module. Where appropriate, all the standard ranges shown are designed to be header selectable by the user, and Texmate's unique SPAN ADJUST Header facilitates scaling to almost any required engineering unit. See Input Module Component Glossary and Calibration on pages 13 and 14. Also see Two Point Digital Calibration and Digital Calibration on page 4. Unless otherwise specified Texmate will ship all modules pre-calibrated with factory preselected ranges and/or scalings as shown in **BOLD** type. Other pre-calibrated standard ranges or custom ranges may be ordered. Factory installed custom scaling and other custom options are also available (see Ordering Information, Special Options on last page).


Symbols Indicate Module Compatibility Within Meter Families

	TIGER Family		TIGER Family		TIGER Family
	LEOPARD Family		LEOPARD Family		LEOPARD Family
	LYNX Family		LYNX Family		LYNX Family
ALL MODELS		SOME MODELS		MODEL SPECIFIC	




WARNING: AC and DC input signals and power supply voltages can be hazardous. Do Not insert, remove or handle modules with live wires connected to any terminal plugs.


IA01: AC Volts Scaled RMS, 200/300V AC

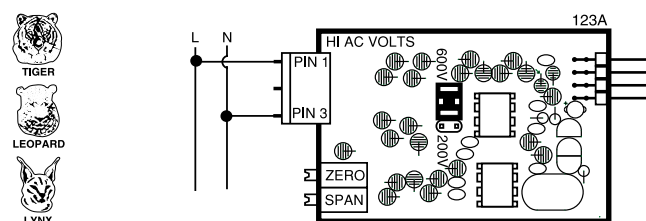


IA06: AC Volts True RMS, 300V AC

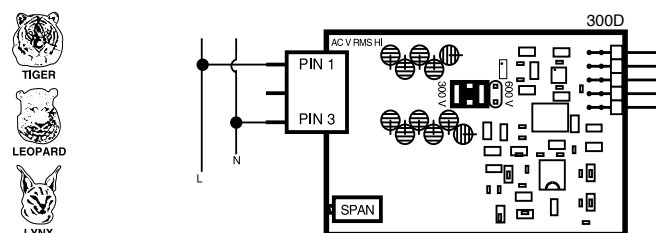


IA02: AC Volts Scaled RMS, 200mV/2V/20V AC

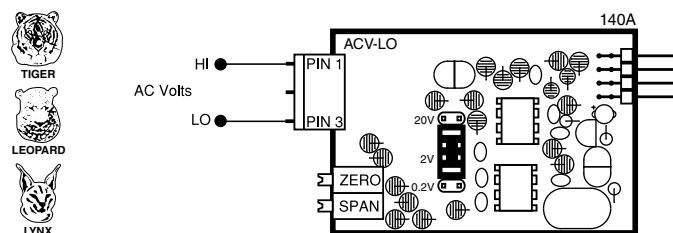


IA07: AC Volts True RMS, 200mV/2V/20V AC

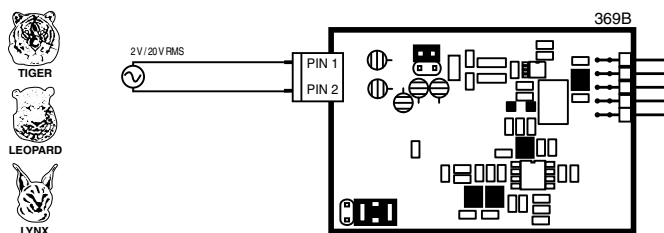

IA03: AC Milliamps Scaled RMS, 2/20/200mA AC

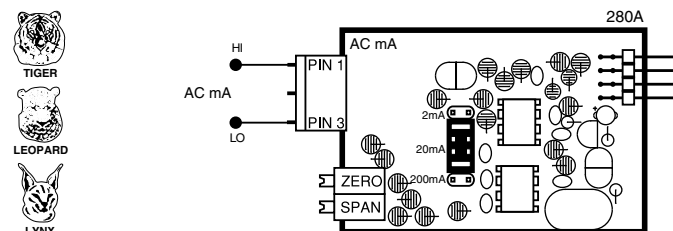


IA08: AC Milliamps True RMS, 2/20/200mA AC

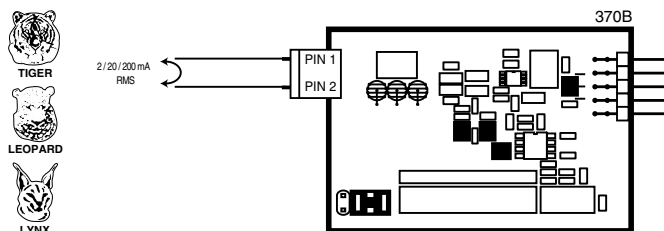


IA04: AC AC Amps Scaled RMS, 1 Amp AC

IA05: AC AC Amps Scaled RMS, 5 Amp AC

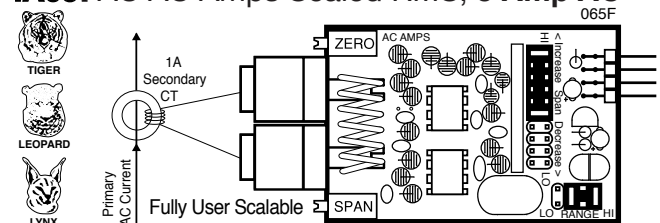


IA09: AC Amps True RMS, 1 Amp AC

IA11: AC Amps True RMS, 5 Amp AC

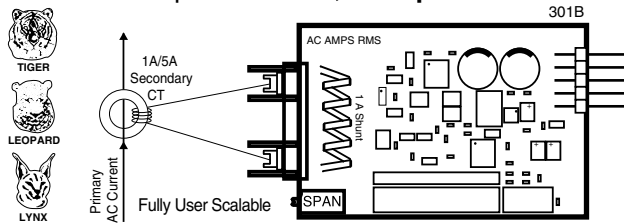


I-Series Input Signal Conditioning Modules


IA10: AC Millivolts, Scaled RMS, 100mV AC

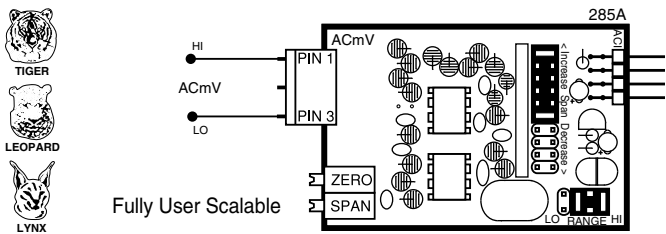


IA12: AC Millivolt RMS Sigma Delta

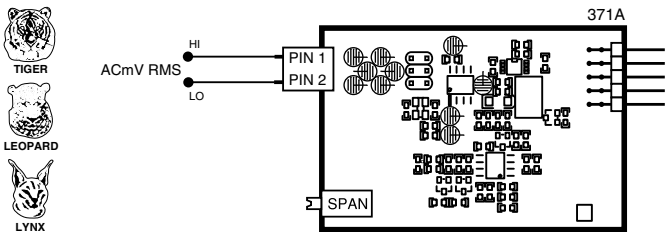


ID05: DC Volts 2/20/200/Custom V DC with Offset and 24V Exc.

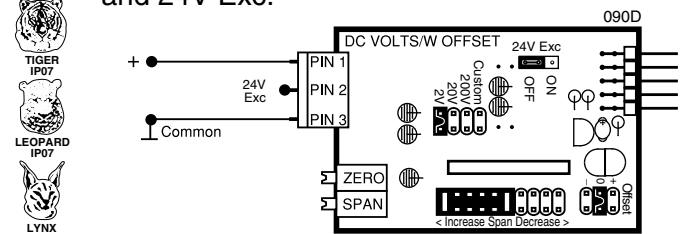


ID07: DC Milliamps, 2/20/200mA DC with Offset and 24V Exc

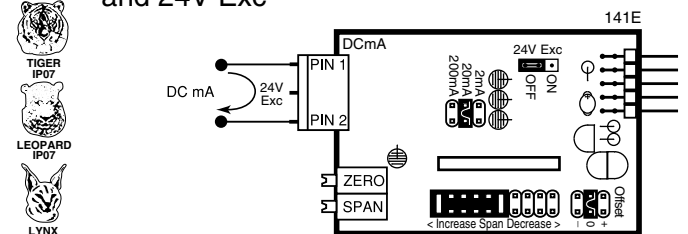


ID01: DC Volts, 2/20/200V/Custom w/24V DC Exc

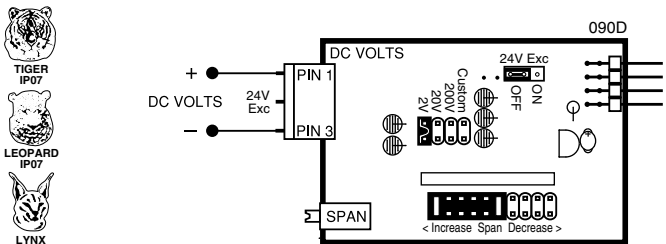


IF02: Line Frequency

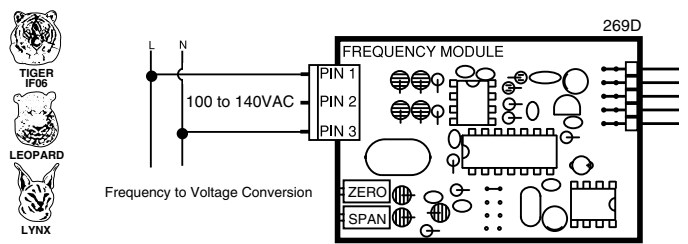


ID02: DC Millivolts, 20/50/100/200mV DC w/24V DC Exc

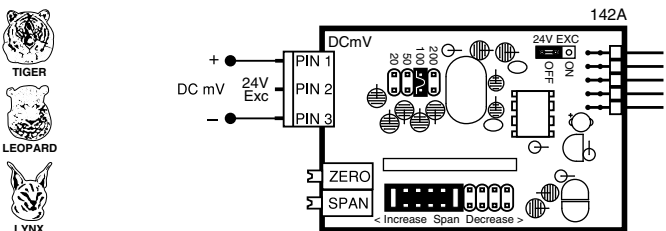

IGYZ: Universal Direct Pressure (Absolute or Differential/Gage) See below for ordering code options

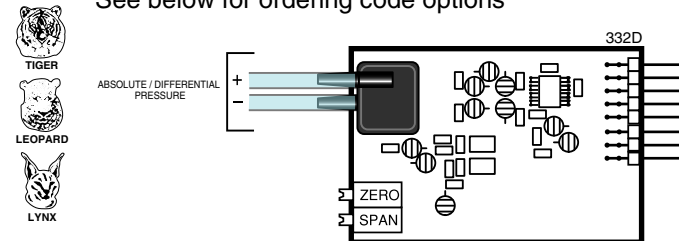

ID03: DC Milliamps, 2/20/200mA DC w/24V DC Exc

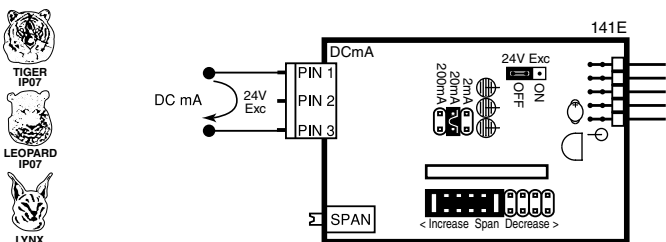

Direct Pressure (IGYX, IGYG & IGYZ) Ordering Code Options


Sensor Range	CH1 Order Code	CH2 Order Code
1 psi Absolute	A	A
1 psi Differential	B	B
5 psi Absolute	C	C
5 psi Differential	D	D
15 psi Absolute	E	E
15 psi Differential	F	F
30 psi Absolute	G	G
30 psi Differential	H	H
100 psi Absolute	J	J
100 psi Differential	K	K

For Single Channel IGYX with two digital inputs, the last digit of order code is always X.

For Universal Direct Pressure IGYZ, the last digit of order code is always Z.


ID04: DC Amps, 5A DC

ID09: DC Amps, 1A DC

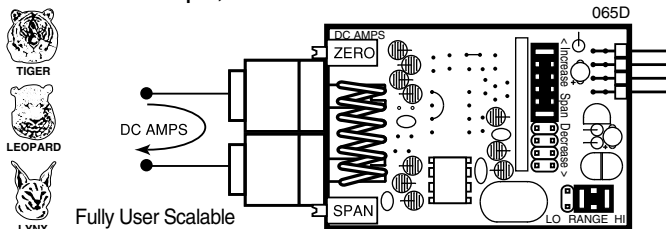


IP01: Process Loop, 4-20mA

IP02: Process Loop, 4-20mA with 24VDC EXC

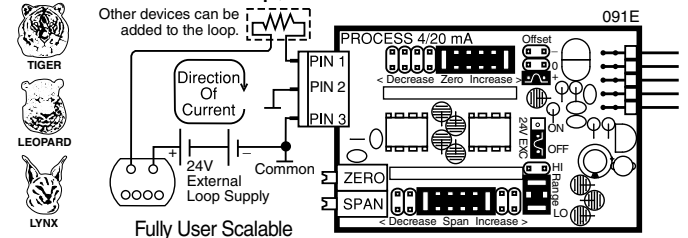


I-Series Input Signal Conditioning Modules

IP03: Process Input, 1-5V DC with Offset, 24V Exc

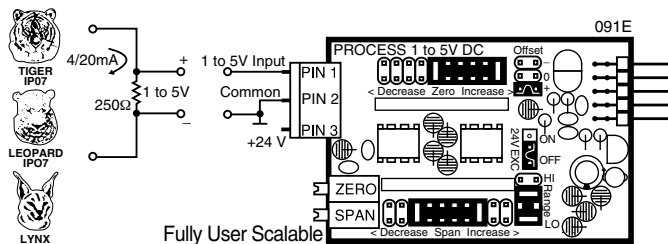


IR04: Resistance 2KΩ (Lynx only)

IR05: Resistance 2KΩ (Leopard only)

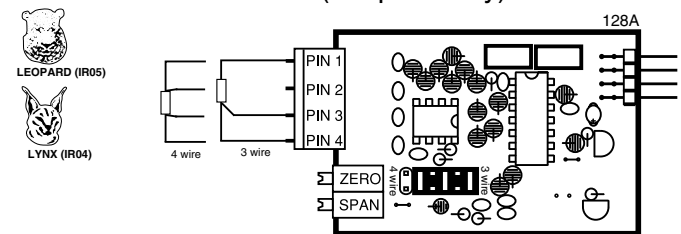

IP07: Universal Process Input


2V/5V/10V/20V/200V/2mA/20mA/Custom

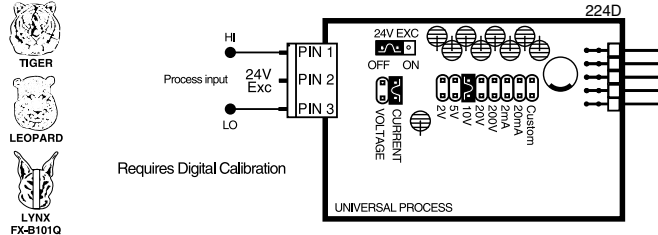


IS01: Strain Gage 5/10V DC Exc., 20/2mV/V, 4/6-wire

IS02: Pressure/Load Cell


5/10V DC Exc., 20/2mV/V, 4/6-wire

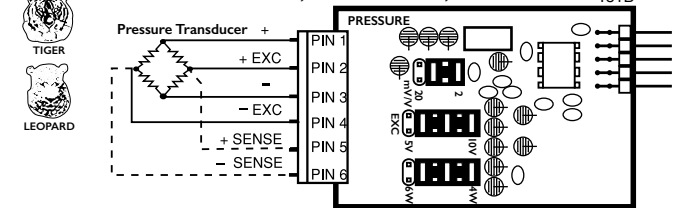


IPT1: Prototype Board for Custom Design

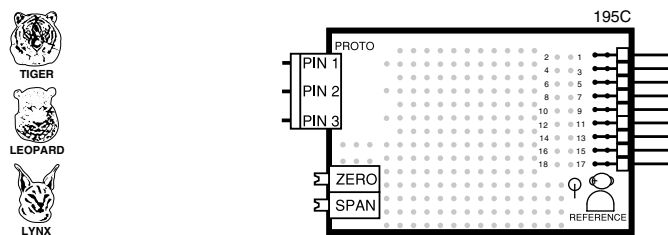


IS04: Pressure/Load Cell Ext Exc., 20/2mV/V, 4/6=wire

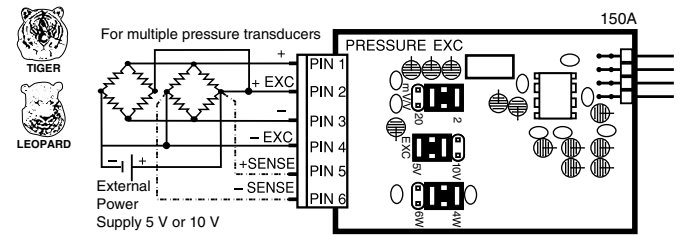


IR02: 3 wire Potentiometer 1KΩ min (0-F.S.)

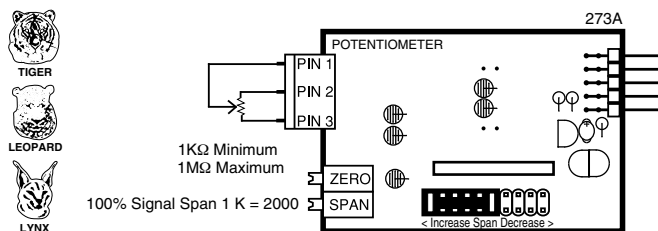


IS05: Pressure/Load Cell 20/2mV/V, 5/10V Exc 4-wire

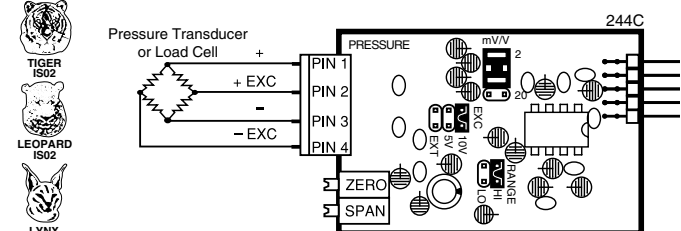


IR03: Linear Potentiometer 1KΩ min

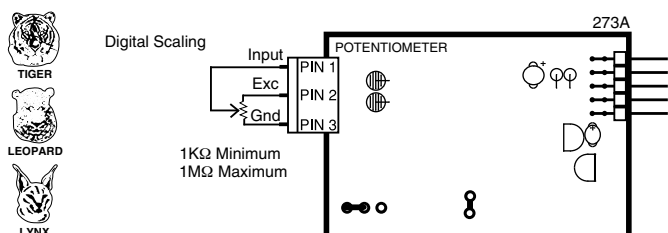

IS06: Pressure/Load Cell Ext Exc., 20/2mV/V, 4-wire

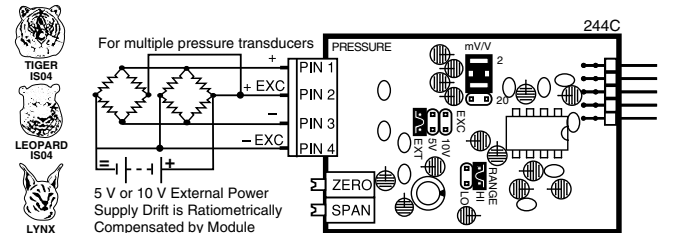

IS07: Pressure/Load Cell Ext Exc. High Impedance, 20/2mV/V, 4/6=wire

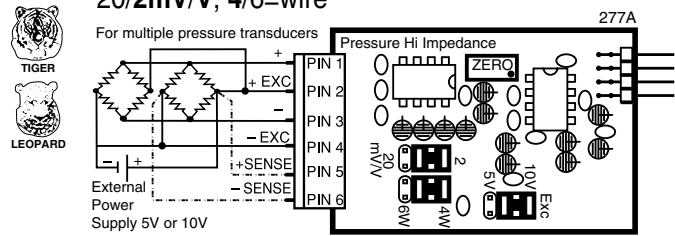


IT03: RTD, 100Ω Pt. 2/3/4-wire (-200 to 800°C)

IT04: RTD, 100Ω Pt. 2/3/4-wire (-200 to 1470°F)


IT05: RTD, 100Ω Pt. 2/3/4-wire (-199.9 to 199.9°F)

IT14: RTD, 100Ω Pt. 2/3/4-wire (-199.9 to 199.9°C)

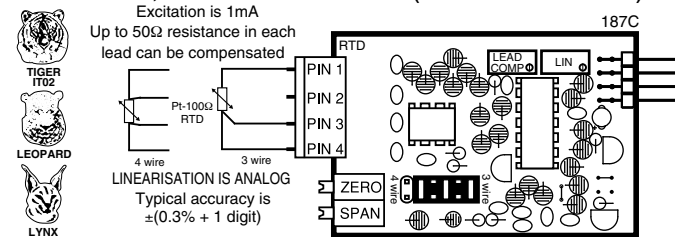


IT06: Thermocouple, J Type (0-1400 F)


IT08: Thermocouple, J Type (0-760 C)

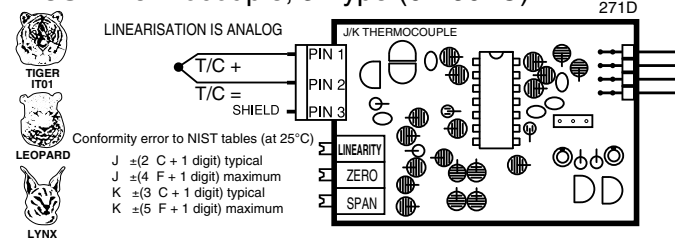

IT07: Thermocouple, K Type (0-1999 °F)

 
IT09: Thermocouple, K Type (0-1260 °C)

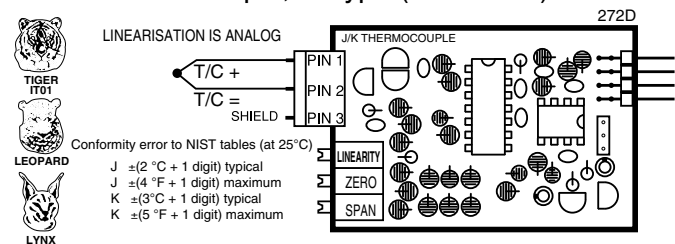




Input and Output Pins

 On most modules Pin 1 is the Signal High input and Pin 3 is the Signal Low input. Typically Pin 2 is used for Excitation Voltage output.




24V DC Output Header

 On some modules this header enables a 24V DC 25mA (max) Excitation/Auxiliary output to be connected to Pin 2.




INPUT RANGE Header

Range values are marked on the PCB. Typically two to four positions are provided, which are selected with either a single or multiple jumper clip. When provided, a custom range position is only functional when the option has been factory installed.

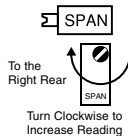



SPAN Potentiometer (Pot)

If provided, the 15 turn SPAN pot is always on the right side (as viewed from the rear of the meter). Typical adjustment is 20% of the input signal range.

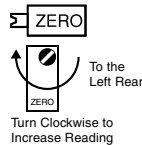



ZERO Potentiometer (Pot)

 If provided, the ZERO pot is always to the left of the SPAN pot (as viewed from the rear of the meter). Typically it enables the input signal to be offset $\pm 5\%$ of full scale (-100 to +100 counts).

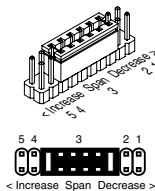



SPAN ADJUST Header

 This unique five-position header expands the adjustment range of the SPAN pot into five equal 20% steps, across 100% of the input Signal Span. Any input Signal Span can then be precisely scaled down to provide any required Digital Display span from 1999 counts to 001 (one count).

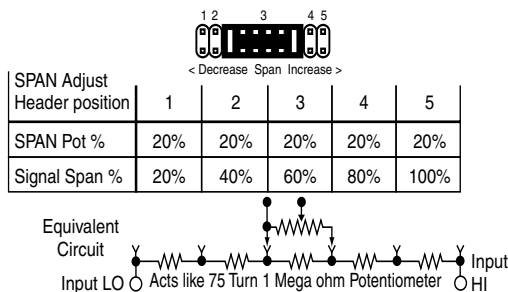



ZERO OFFSET RANGE Header

 When provided, this three position header increases the ZERO pot's capability to offset the input signal, to $\pm 25\%$ of the digital display span. For example a Negative offset enables a 1 to 5V input to display 0 to full scale. The user can select negative offset, positive offset, or no offset (ZERO pot disabled for two step non-interactive span and offset calibration).

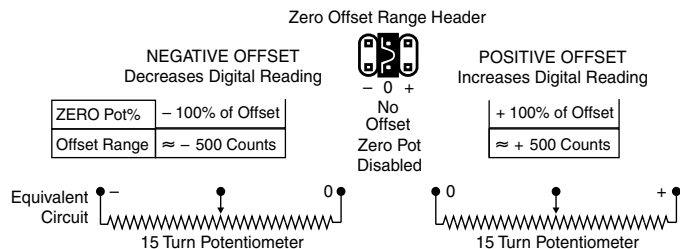


SPAN RANGE Header

When this header is provided it works in conjunction with the SPAN ADJUST Header by splitting its adjustment range into a Hi and a Lo range. This has the effect of dividing the adjustment range of the SPAN pot into ten equal 10% steps across 100% of the input Signal Span.

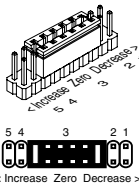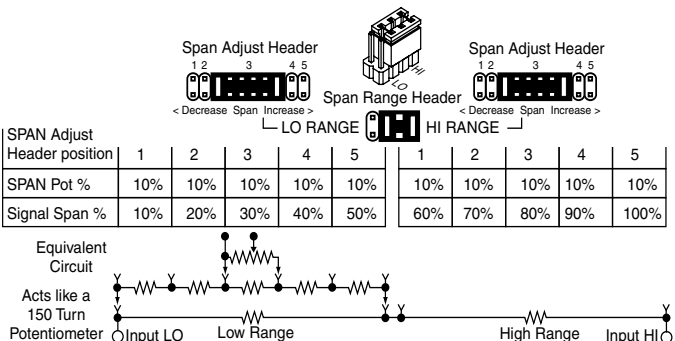

ZERO ADJUST Header

When this header is provided, it works in conjunction with the ZERO OFFSET RANGE Header, and expands the ZERO pot's offset capability into five equal negative steps or five equal positive steps. This enables virtually any degree of input signal offset required to display any desired engineering unit of measure.

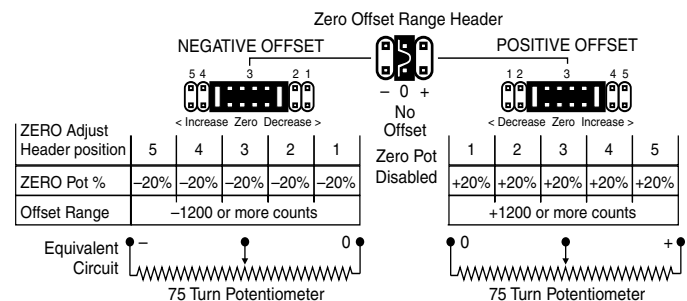

In addition to the analog calibration capabilities that enable many modules to be interchanged between different meters without loss of accuracy the Leopard Family of meters have enhanced Digital Calibration functions.

Basic standard range calibration of direct reading modules that utilize either Auto Zero or a ZERO pot, an INPUT RANGE Header and or a SPAN pot.

- 1 If the module has an INPUT RANGE Header, reposition the jumper clip to select the desired input signal range.
2. Apply a zero input or short the input pins. The display will auto zero, or if the module has a ZERO pot, it should be adjusted until the display reads zero.
- 3 Apply a known input signal that is at least 20% of the full scale input range and adjust the SPAN pot until the display reads the exact input value. For negative inputs, Leopard Family Meters will display negative overrange at 50% of full scale range.
- 4 Decimal Points. The selection or positioning of decimal points has no effect on the calibration of the modules

Wide range scaling, in engineering units not requiring offsets, with modules that utilize auto-zero or a ZERO pot, a SPAN RANGE Header and or a SPAN ADJUST Header.

Texmate's unique SPAN ADJUST and SPAN RANGE Headers provide the circuit equivalent of an ultra-precision one megohm 75 or 150 turn potentiometer that can infinitely scale down any Input Signal SPAN to provide any full scale Digital Display Span from 1999 (counts) to 001 (one count).

If the module has an INPUT RANGE Header, and the required full scale Digital Display Span (counts) is to be larger than the directly measured value of the input Signal Span, then the next lower range on the INPUT RANGE Header should be selected. The resulting over range Signal Span is then scaled down, by selecting the position of the SPAN RANGE Header and or the SPAN ADJUST Header, which will reduce the input Signal Span to a percentage, that the required Digital Display Span can be reached by calibration with the SPAN pot.

Example A: 0 to 10 V to read 0 to 1800 gallons.

Signal Span = 10V, Digital Display Span = 1800 counts

- 1 Select the 2 V INPUT RANGE Header position. This will provide a digital display of 1800 counts with an input of only 1.8 V which is $(1.8 \div 10) = 18\%$ of the examples 10 V Signal Span.
- 2 To scale down the Signal Span to 18% select the 20% Signal Span position on the SPAN ADJUST Header (position 1) or if the module has a SPAN RANGE Header, select (LO Range) and 20% Signal Span position on the SPAN ADJUST Header (position 2).
- 3 Apply a zero input or short the input pins. The display will auto zero, or if the module has a ZERO pot, it should be adjusted until the display reads zero.
- 4 Apply 10 V and adjust the SPAN pot until the display reads 1800.

Large offset scaling and calibration of process signal inputs with modules that utilize ZERO ADJUST Headers and or ZERO OFFSET RANGE Headers.

Texmate's unique ZERO OFFSET RANGE Header enables the use of a simple two step scaling and calibration procedure for those process signals that require large offsets. This eliminates the back and forth interaction, between zero and span settings, that is often required to calibrate less finely engineered products.

The first step is to set the ZERO OFFSET RANGE Header to the center position (No Offset) and scale down the Input Signal Span to a percentage that will enable calibration with the SPAN pot to reach the required Digital Display Span.

The second step is to set the ZERO ADJUST and or ZERO OFFSET RANGE Header to provide a positive or negative offset of sufficient counts that calibration with the ZERO pot will offset the Digital Display Span to produce the required digital reading.

Example B: 1 to 5 V to read -100 to 1500 °C.

Signal Span = 4V, Digital Display Span = 1600 counts

- 1 If the module has an INPUT RANGE Header the 2 V position should be selected. This will provide a digital display of 1600 counts for an input of 1.6 V which is $(1.6 \div 4) = 40\%$ of the examples 4 V signal span. To scale down the Signal Span to 40% select the 40% Signal Span position on the SPAN ADJUST Header (position 2).
- 2 If the module is a Process Input 1-5 V DC type, select the (Hi Range) position on the SPAN RANGE Header and the 100% Signal Span position on the SPAN ADJUST Header (position 5, max increase). This will provide a digital display of 1600 counts for an input of 4V which is 100% of the examples 4V Signal Span.
- 3 Set the ZERO OFFSET RANGE Header to the center position (no offset). Apply 1 V and adjust the SPAN pot until the display reads 400 . A 4V input would then read 1600 counts.
- 4 Set the ZERO OFFSET RANGE Header to the negative offset position. If the module has a ZERO ADJUST Header select the position that will provide a negative offset of ≈ -500 counts. Apply 1 V and adjust the ZERO pot until the display reads -100. Apply 5 V and check that the display reads 1500.

Example C: 4 to 20 mA to read 00.0 to +100.0%

Signal Span = 16 mA, Digital Display Span = 1000 counts.

- 1 The full scale Signal Span of the Process Input 4-20 mA modules is 0 to 20 mA for a full scale Digital Display Span of 0 to 2000 counts. This will provide a digital display of 1000 counts with an input of only 10 mA which is $(10 \div 16) = 62.5\%$ of the examples 16 mA signal span.
- 2 To scale down the Signal Span to 62.5% select the (Hi Range) Position on the Span Range Header and the 70% Signal Span position on the SPAN ADJUST Header (position 2).
- 3 Set the ZERO OFFSET RANGE Header to the center position (no offset). Apply 4 mA and adjust the SPAN pot until the display reads 250 . A 16 mA input would then read 1000 counts.
- 4 Set the ZERO OFFSET RANGE Header to the positive offset position. If the module has a ZERO ADJUST Header select the position that will provide a negative offset of ≈ -250 counts. Apply 4 mA and adjust the ZERO pot until the display reads 000. Apply 20 mA and check that the display reads 1000.

Custom Face Plates and Scales



Texmate Produces Thousands of Custom OEM Face Plates

Have Texmate Design and Build a Custom Face Plate to Suit your Next project!

- Custom face plates have a non-recurring artwork charge. A serial number is then assigned to each artwork, to facilitate re-ordering. We prefer custom logos and special artwork to be supplied in an Illustrator or Photoshop file format.
- The non-recurring artwork charge is less if you choose elements from our library. The standard scales and numbers in the library are shown below. The standard library captions are shown on the caption sheet.
- Small Run or One-Off custom face plates incur an installation charge, and are generally printed on a special plastic film, which is then laminated to custom faceplate blanks as required.

- Large Run (300 pieces min): custom face plates are production silk screened, issued a part number, and held in stock for free installation as required by customer orders.
- OEMs may also order Custom Meter Labels, Box Labels Custom Data Sheets and Instruction Manuals.

Part Number

Description

Small Run Custom Face plates for Bargraphs


ART-FB-S/L	NRC for artwork & set-up Faceplate
ART-FB-S/L/C	NRC for artwork & set-up Faceplate/Co.Logo
ART-FS1	Install Faceplate per meter - 1 color
ART-FS2	Install Faceplate per meter - 2 color
ART-FS3	Install Faceplate per meter - 3 color

Specify artwork serial number when ordering face plate installation. ie: AFB-XXXX

Large Run Custom Face plates for Bargraphs

ART-FL-001	Minimum order 300pcs- 1 color
ART-FL-002	Minimum order 300pcs- 2 color
ART-FL-003	Minimum order 300pcs- 3 color


When ordering Large Run Face plates to be installed specify the custom part number issued for each different artwork. ie: 77-FLXXXX

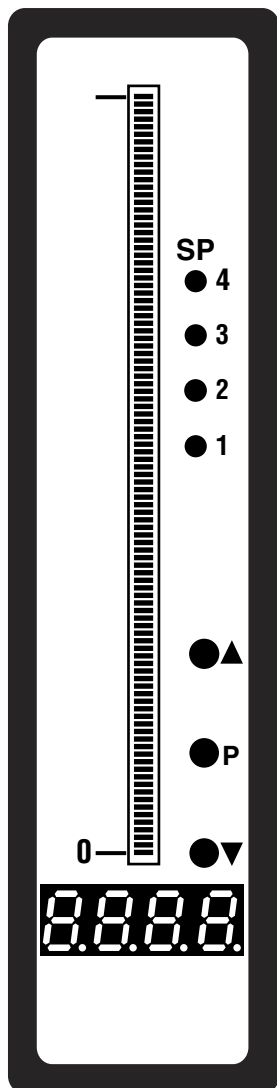

28 mm
(1.1")

Face plate scales and numbers are shown close to their actual size

1	1.2	1.5	2	2.5	3	4	4.5	5	6	7.5	8	9
10	12	15	20	25	30	40	45	50	60	75	80	90
100	120	150	200	250	300	400	450	500	600	750	800	900
1000	1200	1500	2000	2500	3000	4000	4500	5000	6000	7500	8000	9000
10	12	15	20	25	30	40	45	50	60	75	80	90
9						35	40	45		70		80
8	10			20	25				50		70	
7		12		15		30	35	40		60		70
6			15		20	25	30	35	40	50	60	
5	6		10	15	20		25	30		40	50	60
4		6		10	15	20		25	30		40	50
3	4			5	10	15	20		25	30		40
2		3		5	10	15	20		25	30	40	50
1	2				5	10	15	20		25	30	40
0	0	0	0	0	0	0	0	0	0	0	0	0
10x5	6x2x2	5x3x2	4x5x2	5x5x2	6x5	8x5	9x5	10x5	6x5	7.5x5	8x5	9x5
Div. 50	24	30	40	50	30	40	45	50	30	37.5	40	45

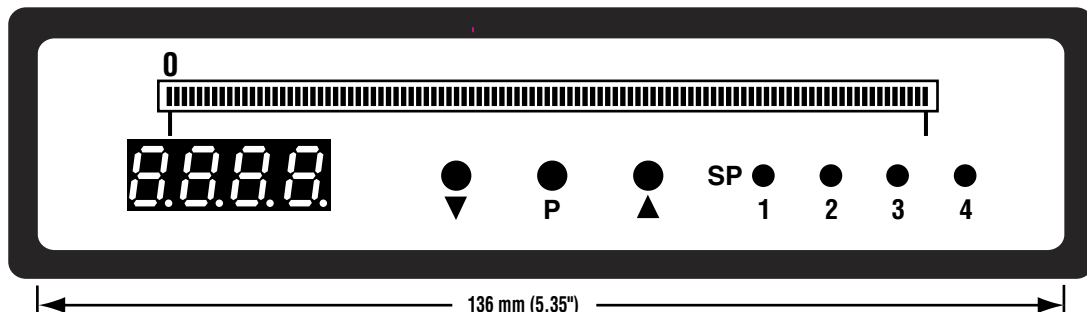

136 mm (5.35")


Installation

1. Install and wire meter per local applicable codes/regulations, the particular application, and good installation practices.

2. Install meter in a location that does not exceed the maximum operating temperature and that provides good air circulation.

3. Separate input/output leads from power lines to protect the meter from external noise. Input/output leads should be routed as far away as possible from contactors, control relays, transformers and other noisy components. Shielding cables for input/output leads is recommended with shield connection to earth ground near the meter preferred.

4. A circuit breaker or disconnect switch is required to disconnect power to the meter. The breaker/switch should be in close proximity to the meter and marked as the disconnecting device for the meter or meter circuit. The circuit breaker or wall switch must be rated for the applied voltage (e.g., 120VAC or 240VAC) and current appropriate for the electrical application (e.g., 15A or 20A).

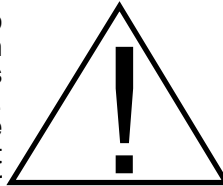

5. See *Case Dimensions* section for panel cutout information.

6. See *Connector Pinouts* section for wiring.

7. Use 28-12 AWG wiring, minimum 90°C (HH) temperature rating. Strip wire approximately 0.3 in. (7-8 mm).

8. Recommended torque on all terminal plug screws is 4.5 lb-in (0.51 N-m).

Ordering Information

BASIC MODEL #	DISPLAY	POWER SUPPLY	INPUT MODULES	ANALOG OUTPUT	RELAY OUTPUT	OPTIONS / ACCESSORIES
FL-B101D40						OA

Add to the basic model number the order code suffix for each standard option required. The last suffix is to indicate how many different special options and or accessories that you may require to be included with this product.

Ordering Example: FL-B101D40-VRR-PS1-IA01-OIC-R11-OA2 plus ZR and an OP-N4/144X36

► BASIC MODEL NUMBER

FL-B101D40 ... 144x36mm, Leopard, 101 Segment Bargraph, 4 Digit ...

Standard Options for this Model Number

Order Code Suffix	Description
-------------------	-------------

► DISPLAY

VRR ... Red LED Bargraph w/4 Digit Red DPM, Vertical.
VGG ... Green LED Bargraph w/4 Digit Green DPM, Vertical.
VGR ... Green LED Bargraph w/4 Digit Red DPM, Vertical.
VRG ... Red LED Bargraph w/4 Digit Green DPM, Vertical.
VTG ... Tri-Color Bargraph w/4 Digit Green DPM, Vertical.
VTR ... Tri-Color Bargraph w/4 Digit Red DPM, Vertical.
HRR ... Red LED Bargraph w/4 Digit Red DPM, Horizontal.
HGG ... Green LED Bargraph w/4 Digit Green DPM, Horizontal.
HGR ... Green LED Bargraph w/4 Digit Red DPM, Horizontal.
HRG ... Red LED Bargraph w/4 Digit Green DPM, Horizontal.
HTG ... Tri-Color Bargraph w/4 Digit Green DPM, Horizontal.
HTR ... Tri-Color Bargraph w/4 Digit Red DPM, Horizontal.
DSGG ... Dual Scale Green LED Vertical Bargraph w/4 Digit Green DPM.
DSGR ... Dual Scale Green LED Vertical Bargraph w/4 Digit Red DPM.
DSRG ... Dual Scale Red LED Vertical Bargraph w/4 Digit Green DPM.
DSRR ... Dual Scale Red LED Vertical Bargraph w/4 Digit Red DPM.
DSTG ... Dual Scale Tri-Color Vertical Bargraph w/4 Digit Green DPM.
DSTR ... Dual Scale Tri-Color Vertical Bargraph w/4 Digit Red DPM.

► POWER SUPPLY

PS185-265VAC/95-300VDC
PS2 ... 18-48VAC/10-72VDC

► INPUT MODULES (Partial List. See www.texmate.com)

Unless otherwise specified Texmate will ship all modules precalibrated with factory pre-selected ranges and/or scalings as shown in **BOLD** type.

IA01 ... AC-Volts Scaled RMS, 200/**300 AC**
IA02 ... AC-Volts Scaled RMS, 200mV/**2V/20V AC**
IA03 ... AC-mA Scaled RMS, 2/**20/200mA AC**
IA04 ... AC-Amps Scaled RMS, **0-1 Amp AC (0-100.00)**
IA05 ... AC-Amps Scaled RMS, **0-5 Amp AC (0-100.00)**
IA06 ... AC-Volts True RMS, 200/**300V AC**
IA07 ... AC-Volts True RMS, 200mV/**2V/20V AC**
IA08 ... AC-mA True RMS, 2/**20/200mA AC**
IA09 ... AC-Amps True RMS, **0-1 Amp AC (0-100.00)**
IA10 ... AC-Millivolt, Scaled RMS, **100mV AC**
IA11 ... AC-Amps True RMS, **0-5 Amp AC (0-100.00)**
IA12 ... AC-Millivolt, True RMS, **100mV AC**
ID01 ... DC-Volts, **2/20/200V/Custom** w/24V DC Exc.
ID02 ... DC-Millivolt, 20/50/**100/200mV DC** w/24V DC Exc.
ID03 ... DC-Milliamper, **2/20/200mA DC** w/24V DC Exc.
ID04 ... DC-Amps, **5A DC**
ID05 ... DC-Volts **2/20/200/Custom V DC** w/Offset and 24V Exc.
ID07 ... DC-Milliamper, **2/20/200mA DC** w/Offset and 24V Exc.
ID09 ... DC-Amps, **1A DC**
IF02 ... Line Frequency, 50-500VAC, 199.9Hz, or optional 400Hz.
IGY2 ... Universal Direct Pressure.

***View the IG- Ordering Code on page 13 to determine the value for Y & Z (IGAZ to IGKZ)**

IP01 ... Process Loop, **4-20mA(0-100.00)**
IP02 ... Process Loop, **4-20mA(0-100.00)** w/24VDC Exc.
IP03 ... Process Input, **1-5V DC(0-100.00)** w/Offset, 24V Exc.
IP07 ... Universal Process 2V/5V/**10V/20V/200V/2mA/20mA/Custom**
IPT1 ... Prototype Board for Custom Design

IR02 ... 3-Wire Potentiometer 1KΩ min (0-F.S.)
IR03 ... Linear Potentiometer, 3-wire, 1KΩ min
IR05 ... Resistance 2KΩ
IS01 ... Strain Gage 5/10VDC Exc., 20/**2mV/V, 4/6-wire**
IS02 ... Pressure 5/10VDC Exc., 20/**2mV/V, 4/6-wire**
IS04 ... Pressure Ext Exc., 20/**2mV/V, 4/6-wire**
IS05 ... Pressure/Load Cell 20/**2mV/V, 5/10V Exc 4-wire**
IS06 ... Pressure/Load Cell Ext Exc., 20/**2mV/V, 4-wire**
IS07 ... Pressure 20/**2mV/V** with High Impedance and External Excitation
IT03 ... RTD, 100Ω Pt. 2/**3/4-wire (-200 to 800°C)**
IT04 ... RTD, 100Ω Pt. 2/**3/4-wire (-200 to 1470°F)**
IT05 ... RTD, 100Ω Pt. 2/**3/4-wire (-190.0 to 199.0°F)**
IT06 ... Thermocouple, J Type **(0-1400 °F)**
IT07 ... Thermocouple, K Type **(0-1999°F)**
IT08 ... Thermocouple, J Type **(0-760 °C)**
IT09 ... Thermocouple, K Type **(0-1260°C)**

► ANALOG OUTPUT

OIC ... Isolated 16 Bit Current Output, 4-20mA
OIV ... Isolated 16 Bit Voltage Output, 0-10VDC

► RELAY OUTPUT

R11 ... Single 9A Form C Relay
R12 ... Dual 9A Form C Relays
R13 ... Dual 9A Form C & One 4A Form A Relays
R14 ... Dual 9A Form C & Dual 4A Form A Relays
R15 ... Single 9A Form C & Dual 4A Form A Relays
R16 ... Single 9A Form C & Single 4A Form A Relays

Special Options and Accessories

Part Number	Description	List
-------------	-------------	------

► SPECIAL OPTIONS (Specify Inputs or Outputs & Req. Reading)

ZR ... Range change from Standard Range shown in **BOLD** Type
ZS ... Custom Digital Display Scaling within Standard Ranges
CS-BAR ... Custom Bargraph Display Scaling within Standard Range
ZS-AO ... Custom Scaling of Analog Output

► ACCESSORIES (Specify Serial # for Custom Artwork Installation)

75-DMC144X36B ... Side Slide Brackets-Wide opening (2 pc)
75-DMC144X36 ... Side Slide Brackets-stand. (2 pc) - extra set
93-PLUG2P-DP ... Extra Screw Terminal Conn., 2 Pin Power Plug
93-PLUG2P-DR ... Extra Screw Terminal Conn., 2 Pin Plug
93-PLUG3P-DR ... Extra Screw Terminal Conn., 3 Pin Plug
93-PLUG4P-DR ... Extra Screw Terminal Conn., 4 Pin Plug
93-PLUG5P-DR ... Extra Screw Terminal Conn., 5 Pin Plug
OP-MTL144x36 ... Metal Surround Case, includes screw mounting clips
OP-MTLCLIP ... Screw Mounting Clips (2 pc) - to screw tighten slide brackets
OP-N4/144X36 ... 144x36mm clear lockable front cover-NEMA 4X, splash proof.
OP-PA/144X36 ... Panel Adapter for 144x36mm from 6 inch cutout

For Custom Face Plates and Scales see page 18.

Prices subject to change without notice.

WARRANTY

Texmate warrants that its products are free from defects in material and workmanship under normal use and service for a period of one year from date of shipment. Texmate's obligations under this warranty are limited to replacement or repair, at its option, at its factory, of any of the products which shall, within the applicable period after shipment, be returned to Texmate's facility, transportation charges pre-paid, and which are, after examination, disclosed to the satisfaction of Texmate to be thus defective. The warranty shall not apply to any equipment which shall have been repaired or altered, except by Texmate, or which shall have been subjected to misuse, negligence, or accident. In no case shall Texmate's liability exceed the original purchase price. The aforementioned provisions do not extend the original warranty period of any product which has been either repaired or replaced by Texmate.

USER'S RESPONSIBILITY

We are pleased to offer suggestions on the use of our various products either by way of printed matter or through direct contact with our sales/application engineering staff. However, since we have no control over the use of our products once they are shipped, NO WARRANTY WHETHER OF MERCHANTABILITY, FITNESS FOR PURPOSE, OR OTHERWISE is made beyond the repair, replacement, or refund of purchase price at the sole discretion of Texmate. Users shall determine the suitability of the product for the intended application before using, and the users assume all risk and liability whatsoever in connection therewith, regardless of any of our suggestions or statements as to application or construction. In no event shall Texmate's liability, in law or otherwise, be in excess of the purchase price of the product.

Texmate cannot assume responsibility for any circuitry described. No circuit patent or software licenses are implied. Texmate reserves the right to change circuitry, operating software, specifications, and prices without notice at any time.



1934 Kellogg Ave., Carlsbad, CA 92008

Tel: 1-760-598-9899 • 1-800-TEXMATE

Fax: 1-760-598-9828 • Email: orders@texmate.com

FL-B101D40 Technical Manual Copyright © 2019 Texmate Inc. All rights reserved.
Published by: Texmate Inc. USA. Information in this Technical Manual is subject to change without notice due to correction or enhancement. The information described in this manual is proprietary to Texmate, Inc. and may not be copied, reproduced or transmitted, in whole or in part, in connection with the design, manufacture, or sale of apparatus, device or private label product without the express written consent of Texmate, Inc.