

## FL-B202Q

Leopard Bargraph Meter  
Dual 101 Segment LEDs  
in a 9/64 DIN CASE



LEOPARD FAMILY



Dual - Inputs  
with Dual Input IDP4  
Universal DC volts, mA,  
4-20mA Input Module  
2 Setpoints per bar  
Vertical or Horizontal  
Configuration



MIN-MAX Display  
on Right Bar with  
Push Button Reset  
Left Bar Displays  
Single Input and  
4 Setpoints using  
Leopard Family  
I-Series Input  
Modules, such as  
AC amps,  
Temperature,  
Pressure, etc..

Dual Tracking  
Setpoints on Right  
bar. Adjustable by  
External Signal or  
Potentiometer  
input on CH2.  
Left Bar Displays  
Single Input on CH1  
with Dual Input IDP4  
Universal DC volts,  
mA, 4-20mA  
Input Module



### General Features

- Two 10 Amp Form C, and two 5 Amp Form A relays available
- Auto-sensing AC/DC power supply. For voltages between **85-265 V AC / 95-370 V DC (PS1)** or 15-48 V AC / 10-72 V DC (PS2).
- Optional isolated 16 bit analog output. User or factory scalable to 4 to 20 mA, 0 to 20 mA or 0 to 10 V across any desired span from  $\pm$  one bar to the full scale range
- 24 V DC excitation is available to power external 4/20 mA transmitters and 5 or 10 V DC excitation is available for resistance bridge type sensors.
- Provision to connect an external programming lockout switch.
- Optional NEMA-4 front cover.

### Software Features

- Utilizes the unique Quickset programming system.
- The two 101 segment bargraphs can be independently scaled.
- Five user selectable operating modes.
- Center zero display mode selectable for one or both bargraphs.
- Four programmable setpoints.
- Relay activation is individually selectable to occur above (HI) or below (LO) for each setpoint.

Smart dual-bar, dual-input or Single-input bargraph with up to four fully programmable set points and an isolated independently scalable 16-bit Analog output.

### Input Module Compatibility

**Dual input modes** utilize the FL-B202Q specific IDP4 Universal DC Volts, mA, 4-20mA dual-input module, see pages 14-15.

**Single Input modes** are compatible with the entire **LEOPARD FAMILY**: More than 38 different Plug-in I-Series Input Signal Conditioners are approved for Texmate's Leopard Family of meters. Some examples are shown on pages 13 - 17. See [www.texmate.com](http://www.texmate.com) for an up to date listing.



LEOPARD




LEOPARD

### Specifications

<b>Input Specification:</b>	.....	Depends on range & function selected
<b>A/D Converter:</b>	.....	14 bit single slope
<b>Accuracy:</b>	.....	$\pm(0.05\%$ of reading + 1segment)
<b>Temp. Coeff.:</b>	.....	100 ppm/ $^{\circ}$ C (Typical)
<b>Warm Up Time:</b>	.....	2 minutes
<b>Conversion Rate:</b>	.....	10 conversions per second (Typical)
<b>Bargraph Display:</b>	.....	<b>101 segment 4" vertical dual red bars(std)</b> , Dual green bars(optn), one red bar and one green bar(optn) Horizontal bars(optn)
<b>Polarity:</b>	.....	Selectable center zero
<b>Positive Overrange:</b>	.....	Bargraph display flashes
<b>Negative Overrange:</b>	.....	First segment of bargraph display flashes
<b>Relay Output:</b>	.....	Two 5 Amp Form A relays and Two 10 Amp Form C relays
<b>Analog Output:</b>	.....	Isolated 16 bit user scalable mA or V
<b>OIC (mA out)</b>	.....	4-20 mA @ 0 to 500 $\Omega$ max loop resistance
<b>OIV (volts out)</b>	.....	0-10 V DC @ 500 $\Omega$ or higher resistance
<b>Power Supply:</b>	.....	AC/DC Auto sensing wide range supply
<b>PS1 (std)</b>	.....	<b>85-265 VAC / 95-370 VDC @ 2.5W max 4.2W</b>
<b>PS2</b>	.....	15-48 VAC / 10-72 VDC @ 2.5W max 4.2W
<b>Operating Temp.:</b>	.....	0 to 60 $^{\circ}$ C
<b>Storage Temp:</b>	.....	-20 $^{\circ}$ C to 70 $^{\circ}$ C
<b>Relative Humidity:</b>	.....	95% (non condensing)
<b>Case Dimensions:</b>	.....	9/64 DIN (Bezel 36Wx144Hmm) Depth behind bezel (5.83") 148mm Plus (0.7") 18mm for connectors
<b>Weight:</b>	.....	9.5 oz., 12 oz when packed

### Index

Analog Output Scaling and Calibration .....8	External Setpoint Calibration .....10	Input Module Component Glossary .....18	Pin Descriptions .....11
Case Dimensions .....23	Functional Diagram .....11	I-Series Input Signal .....13-17	Setpoint Adjust .....9
Center Zero Mode Scaling For Bipolar Inputs .....7	General Features .....1	Conditioning Modules .....13-17	Software Features .....1
Component Layout .....12	Glossary of Programming Symbols and Modes of Operation .....2	Ordering Information .....24	Specifications .....1
Connector Pinouts .....11	Hinged Clear Lockable Poly NEMA 4X Splash Proof Cover .....23	One Point Quickset Rescaling and Calibration Procedure .....6	Standard Display Mode Calibration Procedures .....5
Connectors .....12	Input Module Analog Calibration Procedures .....19	Opening the Case to Access Mode Select Headers .....4	Standard Face Plate & Scales .....20
Controls and Indicators .....2	Input Module Compatibility .....1	Overview of Display Modes .....3	Std Scales and Caption Sheets .....20
Custom Face Plates and Scales .....21		Panel Adapter .....22	Two Point Quickset Scaling and Calibration .....5,6

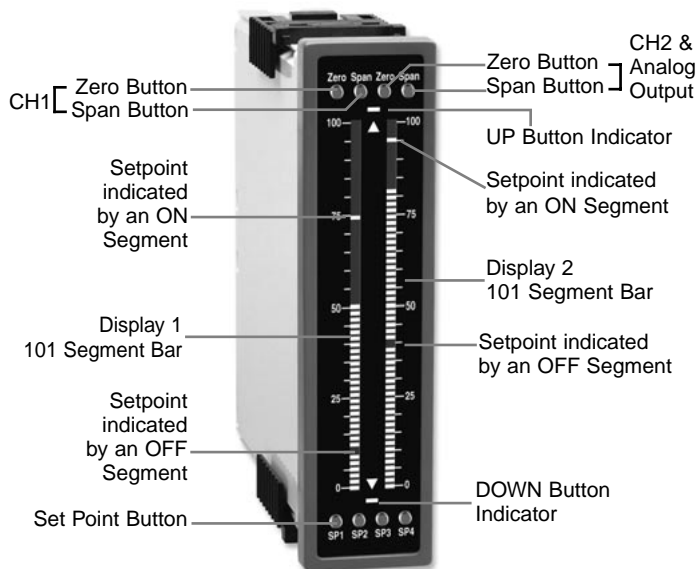


**Quickset Programming**

This bargraph features our unique QUICKSET PROGRAMMING. When a front panel button is pressed the associated function is directly changed. The direction of change will be either up or down, as indicated by the UP and DOWN indicator LEDs. After the indicator LED lights up there is a 0.5 second delay before any change occurs. When a button is released and pressed again the direction of change is reversed. As there are no menu or sub-menus to navigate, the programming and setup is quick and easy.

**Glossary of Programming Symbols and Modes of Operation**

To explain software programming procedures, logic diagrams are used to visually assist in following programming steps. The following symbols are used to represent the functions and displays of the meter:

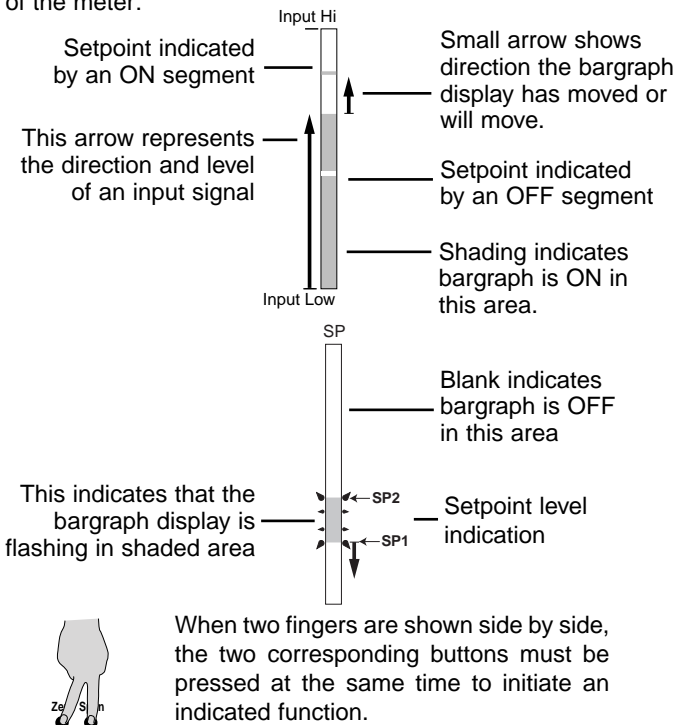

When two fingers are shown side by side, the two corresponding buttons must be pressed at the same time to initiate an indicated function.

**Relay Activation Mode Select Header**

When no jumper clips are installed the relays will activate when the display exceeds the set point. Any relay that has a jumper clip installed will activate when the display is less than the set point.



**Front Panel Buttons**

**Display 1 Zero Button**

The Display 1 Zero Button sets the Channel 1 low input signal scaling. See Pages 5 to 7 for Calibration Instructions.

**Display 1 Span Button**

The Display 1 Span Button sets the Channel 1 high input signal scaling. See Pages 5 to 7 for Calibration Instructions.

**Display 2 Zero Button/Analog Output Lo**

The Display 2 Zero Button sets the Channel 2 low input signal scaling. See Pages 5 to 7 for Calibration Instructions.

This button also functions as the Analog Output LO button. When the ZERO and SPAN buttons for DISPLAY 2 are simultaneously held down and the bargraph is powered up then the ZERO button will now function as the Analog Output LO button (and the SPAN button will now function as the Analog Output HI button). If the meter is turned OFF and then re-powered, this button will return to the original function of ZERO for DISPLAY 2. See Pages 10 for Analog Output Calibration Instructions.

**Display 2 Span Button/Analog Output Hi**

The Display 2 Span Button sets the Channel 2 high input signal scaling. See Pages 5 to 7 for Calibration Instructions.

This button also functions as the Analog Output HI button. (see zero button above for activation procedure). See Pages 10 for Analog Output Calibration Instructions.

**SP1, SP2, SP3 and SP4 Buttons**

These buttons setup the corresponding setpoints and Modes of Operations. See Pages 11 and 12 for Setpoint Adjustment Instructions.

**Standard or Center Zero Display Mode Select Header**

- CH1 CH2 •No jumper clips enables standard display on CH1 and CH2.
- CH1 CH2 •Add jumper clip to enable Center Zero display on selected channel.
- CH1 CH2 •Two jumper clips enable Center Zero display on both CH1 and CH2.

**Operating Mode Select Header:** This header selects one of the eight operating modes presently available.

- Mode 0 Dual inputs channels with two set points per input.
- Mode 1 Single input with 4 setpoints displayed on right side bargraph display.
- Mode 2 Single input with four set points displayed on left bargraph display with MIN MAX displayed on right side bargraph display.
- Mode 12 Single input with two tracking set points adjustable by an external potentiometer.

**When a jumper clip is inserted in the Mode 3 position, the Hysteresis function is added (see page 3 for an explanation of Hysteresis).**

 
- Mode 0 with Hysteresis.
- Mode 1 with Hysteresis.
- Mode 2 with Hysteresis.
- Mode 12 with Hysteresis.

# Over View of Display Modes, Scaling Capabilities and Operating Modes

## CH1 CH2 Standard Display Mode (May be selected for CH1 and or CH2 Displays)


### Standard Scaling

Standard display mode selected and scaled so bar increases as input signal increases from Low to Hi.



### Inverse Scaling

 
Standard display mode selected and scaled so the bar increases as the input signal decreases from Hi to Low.



## CH1 CH2 Center Zero Display Mode (May be selected for CH1 and or CH2 Displays)


### Bipolar center zero

Center point display mode selected and scaled, so the bar increases upward from zero, for increasing positive inputs and downward from zero for increasing negative inputs. When the input is zero, only the center segment will be on.

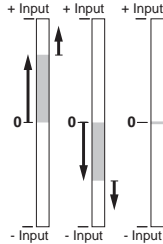

### Half-scale zero point

Center point display mode selected and scaled, so the bar increases upwards or downwards from the center point, for signals that are greater or less than half the calibrated full scale range respectively. When the input is equal to half the full scale range, only the center segment will be on.

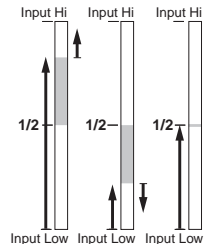


## MODE 1 2 3 Mode 0 Dual Channel Inputs

Utilizing the IDP4 Universal DC Volts, mA, 4-20mA dual-input module. Two set points per channel.

### Dual Display with Set Points

With Standard display or Center point mode selected, the setpoints are indicated by an **ON** segment outside the bar display area and by an **OFF** segment inside the bar display area.

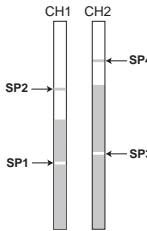


## MODE 1 2 3 Mode 1 Independent Set Point Display

Single channel input on CH1 using any Leopard family I-Series Input module with up to four set points displayed on the right hand bar.

### Independent Set Point Display

Standard or Center point display mode may be selected for the left hand bar displaying channel 1. The right hand bar displays all the setpoints as **ON** segments.

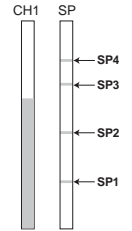


## MODE 1 2 3 Mode 2 MIN-MAX Display with Reset

Single channel input using any Leopard family I-Series Input module with up to four set points and a resettable MIN-MAX display on the right hand bar.

### MIN-MAX Display

Standard display or Center point display mode may be selected for the left hand display channel 1. The right hand bar displays the MIN-MAX of the CH 1 reading. Pressing SP 3 and SP 4 buttons simultaneously resets the MIN-MAX reading.

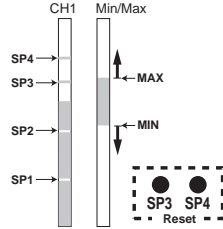


## MODE 1 2 3 Mode 12 Dual Externally Adjustable Setpoints

Single channel input on CH1 of a Dual channel IDP4 Universal DC Volts, mA, 4-20mA input module. CH2 input adjusts SP1 from an external signal or potentiometer. SP2, set by its front panel button, tracks SP1.

### Dual External Set Point Adjust

Standard or Center point display mode may be selected for the left hand bar displaying channel 1. The right hand bar displays the setpoints. All the bar segments above SP2 and below SP1 are **ON**, when SP1 is less than SP2. If SP1 is adjusted to be greater than SP2, the segments between will flash.

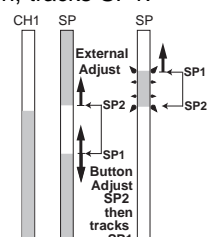


## Hysteresis Band between SP1 & SP2

When a jumper clip is inserted in the Mode 3 position, the Hysteresis function is added (see page 2 for selecting this function). In order for Hysteresis to function, SP2 must be set to a value greater than SP1, and SP2 should be selected as High (h) Setpoint (See page 9). When these conditions are met, and Mode 3 is selected, then a Hysteresis band is created for the SP1 relay, with the upper limit of SP2 and the lower limit of SP1. SP2 relay continues to operate normally.

•For a tank filling application SP1 is set to a Low (L) Setpoint. SP1 relay can control a pump that fills the tank. With Mode 3 selected, SP1 relay activates for inputs less than the SP1 level. Once activated, SP1 relay will stay ON until the tank is filled to the SP2 level.


•For a tank emptying application SP1 is set to a High (h) Setpoint. SP1 can control a pump that empties the tank. With Mode 3 selected, SP1 relay activates for inputs greater than the SP2 level. Once activated, SP1 relay will stay ON until the tank is emptied to the SP1 level.

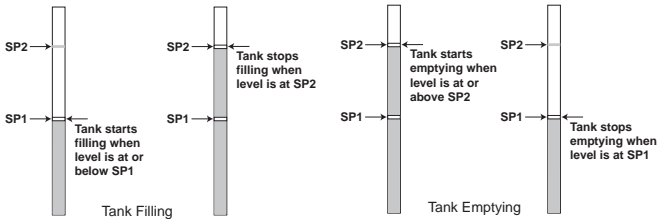

## Horizontal and Reverse Mounting with Custom Face Plate Installed

### Horizontal or Reverse mounting

Meters can be mounted horizontally in the panel and for those applications that require an opposite growth of the bar, the meter can be vertically or horizontally mounted upside down

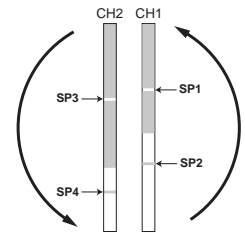


# Opening the Case to Access Mode Select Headers


The mode select headers are located on the Display Driver Board assembly. To change any of the modes, it is best to remove the Display Driver Board assembly from the case. Before removing the Display Driver Board assembly from the front of the case it is necessary to remove the rear cover and slide the main board back an inch, or remove it, to disengage the pin and socket connector between the main board and the display assembly.

## Step 1

Remove the front bezel by lightly levering the plastic catches up and forward in the a b c d sequence shown. Then remove the cover and scale faceplate.

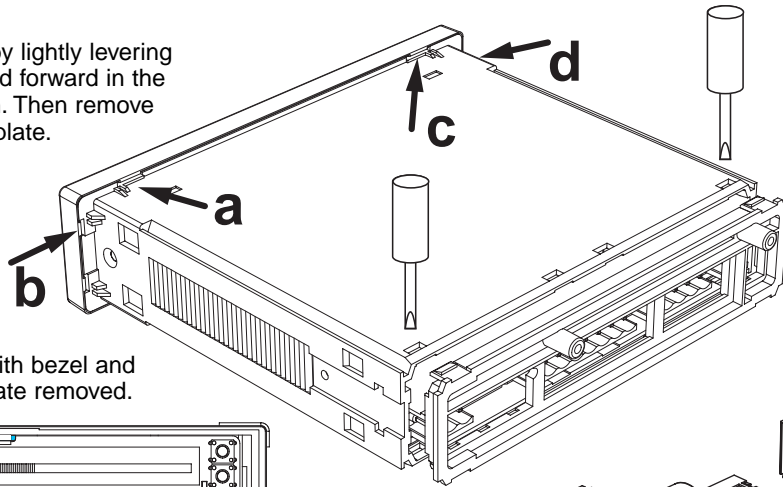


Front view with bezel and scale faceplate removed.

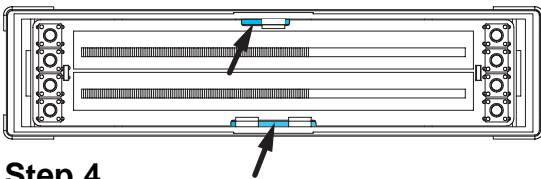

## Step 4

Starting with the top first, insert a small flat bladed screw driver and carefully lever the plastic catch up and tilt the Display Board assembly forward. Then repeat this action with the bottom catches.

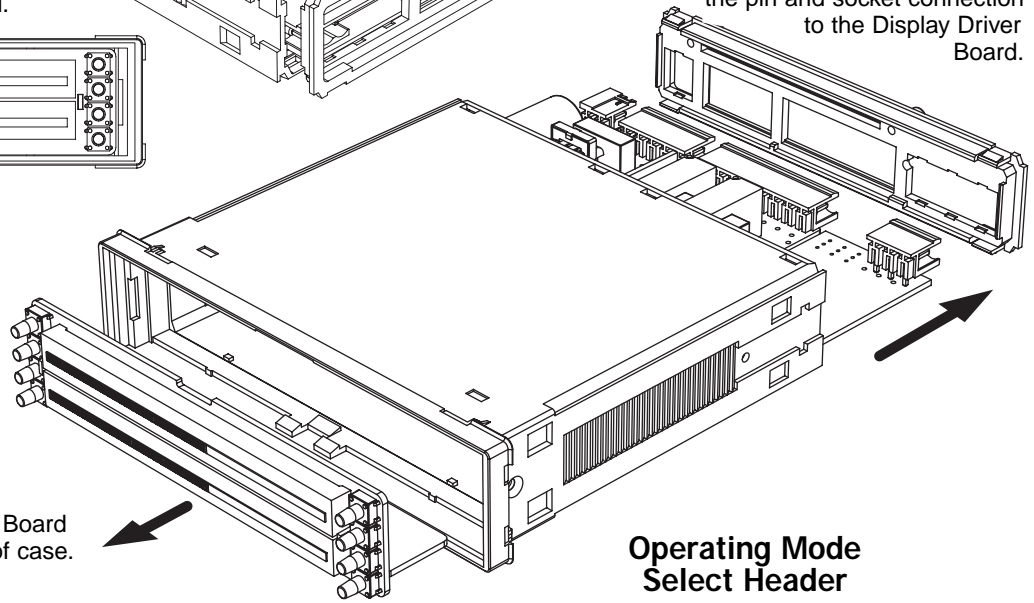

## Step 5

Remove the entire Display Board assembly by sliding it out of case.


## Step 2

Remove the rear cover plate by pressing down lightly with a small flat bladed screw driver to release two plastic catches, on either side of the case and levering backwards.

## Step 3

Slide the Main Board back approximately 1" to disengage the pin and socket connection to the Display Driver Board.

## Meter Exploded view

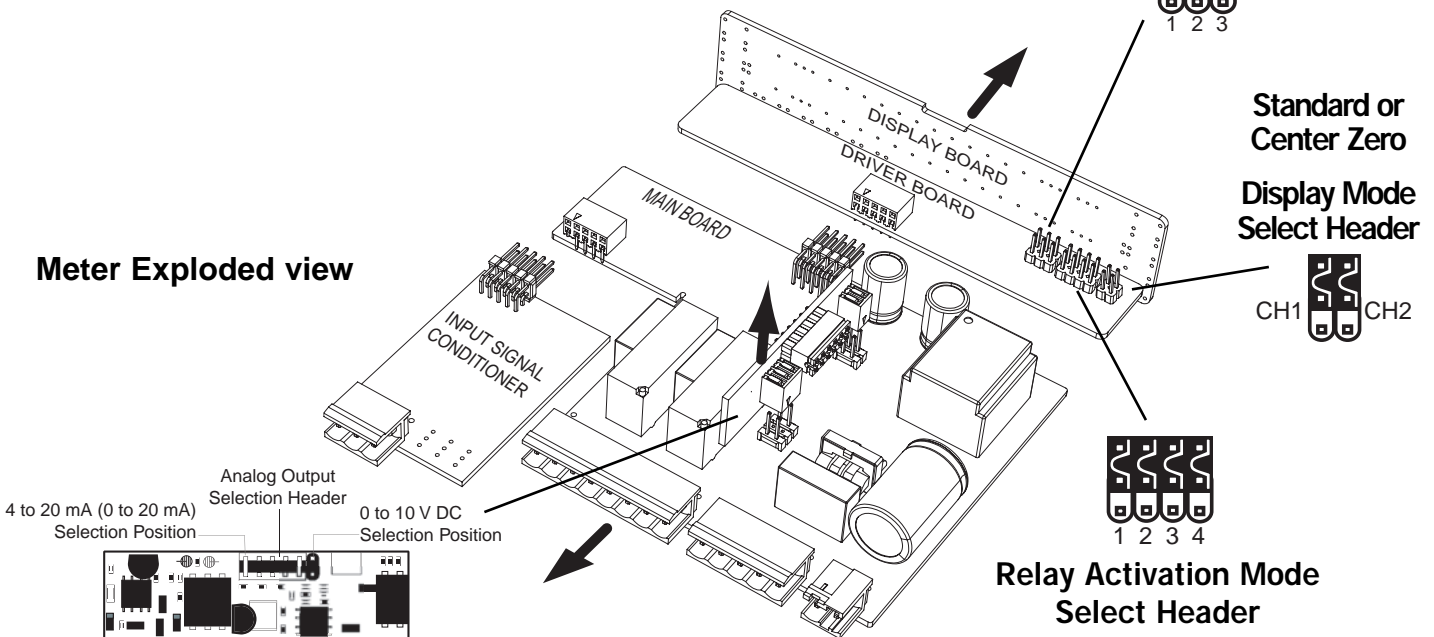

## Two Point Quickset Scaling and Calibration

Meters with **QUICKSET PROGRAMMING** feature a unique, easy-to-use, two point scaling and calibration system.


Scaling or calibration is accomplished simply, by applying a zero or low input signal and adjusting the bar to the desired reading, using the ZERO button. A higher input signal is then applied, and the bar is adjusted to the desired reading for that input value, using the SPAN button.

### IMPORTANT DETAILS THAT MAKE QUICKSET PROGRAMMING EASY TO USE AND UNDERSTAND

1. The zero and span buttons are functionally the same, except as follows: The ZERO button can initiate a scaling with input signals from zero to 95% of fullscale. The Span button can initiate a scaling with input signals from 5% of fullscale to 105% of fullscale.
2. When a Zero or Span button is pressed, the Up or Down indicator LED will immediately light up to show the direction, in which the Bar will move, after a 0.5 second delay. If the button is released and pressed again, the opposite Up or Down indicator will light up, and 0.5 seconds later the Bar will begin to move in that direction until the button is released. When the bar is being adjusted to zero or fullscale, the bar will automatically stop at the zero or fullscale position, and will not overshoot these positions, even if the button continues to be pressed.
3. While the bar is being adjusted, a new offset and scale factor is continuously being calculated. At the moment the button is released, and the scaling is accepted, the calculation data is memorized and implemented. The Scaling calculation is based on the new position of the Bar, the input signal being applied at that moment, and the previously memorized position of the Bar and the input signal that was being applied, when the other button was last released.
4. Positive and negative signals maybe integrated into a two point scaling. However when either a ZERO or SPAN button is pressed the input signal being applied, must be more than 5% higher or lower than the previously memorized value of the input signal, that was being applied when the other button was last released. If not, the bar will flash, the scaling will not be accepted, and the previous scaling will still be retained in memory.
5. Because of the requirement, that a new scaling input signal must be 5% higher or lower than the previously stored value, it can sometimes be difficult to implement a desired scaling, particularly when using a calibrator that only has fixed output values. In this case Reset the Scaling by pressing the ZERO and SPAN buttons simultaneously for two seconds. Both scaling memories will be erased and an internal default scale factor will be loaded. This provides a display of zero to fullscale on the bar for an input of approximately 0 to 100% of the range selected on the input signal conditioning module. After Resetting the Scaling a new calibration, using either button, can be implemented with new input signal values. It is good practice to always use the Zero button for lower input signals and the Span button for higher input signals, even when the bar display scale is inverted.
6. The larger the difference between two points used for calibration, the better the accuracy. However if the difference is too high, and the output from the input signal conditioning module is greater than +2.1VDC, or less than -1.05VDC, the bar will flash over range. The calibration will not then be accepted and, the previous scaling will still be retained in memory. In this case, either a lower input signal must be used, or a higher range on the input module should be selected to recalibrate the meter.

**Note:** Most input signal conditioners have provisions for analog calibration and scaling. If the meter's scale factor is set to read zero with a zero input (shorted input), and to read 10 Bars fullscale with a 2.000 V input, any pre-calibrated signal conditioner with an output that does not exceed - 1 V to + 2 V, will read correctly in the meter without any further calibration.

## Standard Display Mode Calibration Procedure

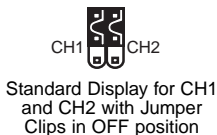

**Standard or Center Zero Display Mode** may be selected for CH1 and or CH2 displays, depending on the Operating Mode selected. If the standard display mode is not already selected open the meter case as showing on page 4 and move the jumper clips on the display mode select header to the OFF position.


### STEP A REVIEW THE INPUT MODULE STATUS

- 1) See pages 15 – 21 for information on input modules that may be used with this meter.
- 2) Only the IDP4 Universal Input module can be used for dual inputs and information on this module can be found on page 15.
- 3) Confirm that the correct range and input is selected on the input signal conditioning module.

**Note:** When undertaking an initial set up and primary scaling and calibration of the meter it is best to start with a reset of the scaling.

### STEP B RESET THE SCALING ON CHANNEL ONE

- 1) Apply power to the meter and press the CH1 ZERO and CH1 SPAN buttons simultaneously for 2 seconds. This erases any previously memorized scalings, and resets the scaling to the factory default, of approximately zero to full scale, for an input, that is 0 to 100% of the range selected on the input signal conditioner.

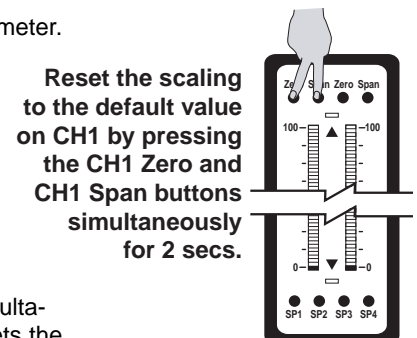


## Two Point Quickset Scaling and Calibration Procedure (continued)

**Note:** To calibrate the bargraph you must be able to input two input signals. Usually the minimum input (LO Input) and the maximum input (HI Input) signals are used for optimum accuracy. However a scaling can be accomplished with any two signals that are higher or lower than each other by more than 5% of fullscale and are not greater than +2.1VDC or less than -1.05VDC.


### STEP C SET THE LOW INPUT SIGNAL READING ON THE BAR

- 1) Apply the LO input signal (4ma in this example) to the CH1 input pins.
- 2) Using the CH1 ZERO button adjust the bar down to the required position.

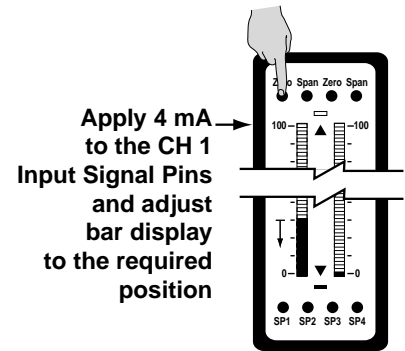

### STEP D SET THE HIGH INPUT SIGNAL READING ON THE BAR

- 1) Apply the high input signal (20mA in this example) to the CH1 input pins. Using the CH1 SPAN button adjust the bar to the required position. This position could be higher or lower than the position adjusted in Step 2. The scaling of CH1 for an input of 4 to 20mA is now complete.

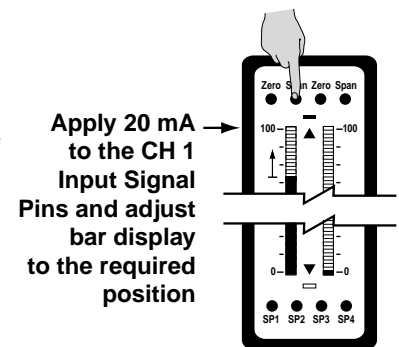

In the Dual input mode, the procedure for calibrating CH2 is the same, except that the input signal is applied to the CH2 input pins and adjustments are made with the CH2 ZERO and CH2 SPAN buttons.

## One Point Quickset Rescaling and Calibration Procedure


### ONE POINT RECALIBRATION

As explained earlier, the FL-B202Q bargraph is calibrated using two point calibration. Once a bargraph is calibrated, the low end of the range may be then recalibrated without affecting the calibration of the high end, and vice versa.

For example, take an FL-B202Q that has been calibrated to read zero to full scale for an input of 4 to 20mA. If now the scaling has to be changed to read zero to full scale for an input of 0 to 20mA, only the low (4 mA) end needs to be recalibrated. The high (20 mA) end of the scaling is left untouched, and so does not change. The following one point recalibration procedure is used for this purpose.

### STEP A RECALIBRATE THE LOW INPUT SIGNAL READING ON THE BAR

- 1) Apply the LO input signal (0ma in this example) to the CH1 input pins. The first segment will flash, indicating an under range condition.
- 2) Using the CH1 ZERO button adjust the bar up to the required position.
- 3) The FL-B202Q has now been recalibrated to read zero to fullscale for a 0 to 20 mA input.

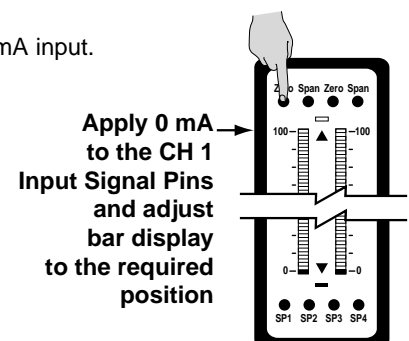

## Center Zero Mode Scaling For Bipolar Inputs

The procedure for scaling the bar graph for bipolar signals is very simple. If say CH1 has to be scaled for -1V to +1V, the steps are as follows:

### STEP A SELECT THE CENTER ZERO DISPLAY MODE FOR CH1

- 1) Following the instructions on page 4, remove the meter from the case.
- 2) Select the Center Zero Mode for CH1 by repositioning the jumper clip on the Center Zero Display Mode Select Header.

CH1, Center  
Zero Mode  
Selected



### STEP B REVIEW THE INPUT MODULE STATUS


- 1) See pages 15 – 21 for information on input modules that may be use with this meter.
- 2) Only the IDP4 Universal Input module can be used for dual inputs and information on this module can be found on page 15.
- 3) Confirm that the correct range and input is selected on the input signal conditioning module.

**Note:** When undertaking an initial set up and primary scaling and calibration of the meter it is best to start with a reset of the scaling.

### STEP C RESET THE SCALING ON CHANNEL ONE

- 1) Apply power to the meter and press the CH1 ZERO and CH1 SPAN buttons simultaneously for 2 seconds. This erases any previously memorized scalings, and resets the scaling to the factory default, of approximately zero to full scale, for an input, that is 0 to 100% of the range selected on the input signal conditioner.


Reset the scaling to the default value on CH1 by pressing the CH1 Zero and CH1 Span buttons simultaneously for 2 secs.

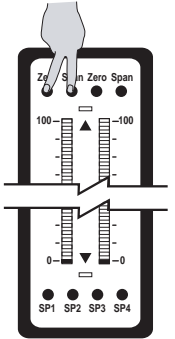

### STEP D SET THE LOW INPUT SIGNAL READING ON THE BAR

- 1) Apply the LO input signal (-1V in this example) to the CH1 input pins.
- 2) Using the CH1 ZERO button adjust the bar down to the required position. In this case, all the bar segments from mid point down to the bottom will be ON.


Apply -1V to the CH 1 Input Signal Pins and adjust bar display to the required position

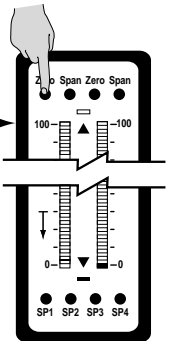

### STEP E SET THE HIGH INPUT SIGNAL READING ON THE BAR

- 1) Apply the high input signal (+1V in this example) to the CH1 input pins.
- 2) Using the CH1 SPAN button adjust the bar to the required position. This position could be higher or lower than the position adjusted in Step 2. In this case, all the bar segments from mid point up to the top will be ON.
- 3) The scaling of CH1 for an input of -1V to +1V is now complete.

Apply +1V to the CH 1 Input Signal Pins and adjust bar display to the required position

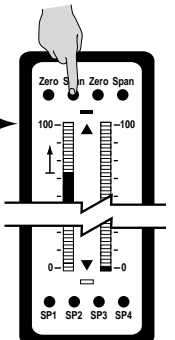

# Analog Output Scaling and Calibration


When the optional analog output module is installed, an independently calibrated 16 bit isolated, voltage or current analog output is available. **The analog signal is independently scaled to the input signal and not to the bargraph display.** It is important to note that the Analog Output is completely independently of the bargraph display. This means for example that the bargraph display may be scaled to go from zero to full scale as the input changes from 0 to 5V, while at the same time, the analog output is scaled to go from 4 to 20mA as the input changes from 2 to 3V. Rescaling the bargraph or the analog output will not affect the scaling of the other.

To calibrate the Analog Output you must be able to input two input signals. Usually the minimum input (LO Input) and the maximum (HI Input) signals are used for maximum accuracy.

For example the five steps to obtain an Analog Output of 4mA to 20mA for an input of 0 to 10V are:


## STEP A ACCESS THE ANALOG CALIBRATION MODE

- 1) Confirm the internal analog output module is installed and that the required voltage or current output option is selected.
- 2) Turn OFF the power to the bargraph.
- 3) Hold down the DISPLAY 2 ZERO and DISPLAY 2 SPAN buttons simultaneously and re-power the bargraph. The DISPLAY 2 ZERO button will now function as the LO button and the DISPLAY 2 SPAN button will now function as the HI button for calibrating the Analog Output.

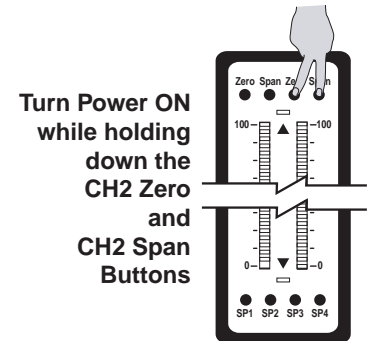

## STEP B RESET THE ANALOG OUTPUT SCALING

- 1) Press the LO and HI buttons simultaneously and hold them down for 2 seconds. This will reset the analog output scaling to the default value. The default analog output scaling is approximately 0 to 20mA (0 to 10V if voltage output option is selected) for an input that is 0 to 100% of the range selected on the input signal conditioner.

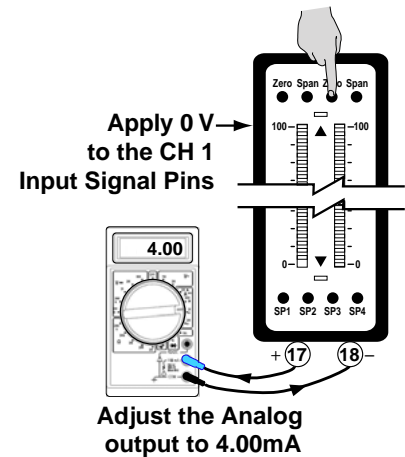


## STEP C CALIBRATE ANALOG OUTPUT FOR LO SIGNAL

- 1) Apply the low input signal (0V in this example) to the meter.
- 2) Connect an external multimeter to the analog output pins (Pins 17 and 18).
- 3) Using the LO button adjust the analog output as measured on the external multimeter to be the required value. (4mA in this example). When the LO button is pressed, the UP or DOWN indicator LED shows the direction of change. To reverse the direction of change release the LO button and press down again. Initially the output changes very slowly, but speeds up as the LO button remains pressed down. The analog output for a low input can be set in this step to any value in the range of 0 to 20mA or 0 to 10V (if the voltage output option is selected).


## STEP D CALIBRATE ANALOG OUTPUT FOR HI SIGNAL

- 1) Next apply the high input signal (10V in this example) to the meter.
- 2) Using the HI button, adjust the analog output as measured on the external multimeter to be the required value. (20mA in this example). When the HI button is pressed the UP or DOWN indicator LED shows the direction of change. Release the HI button and press again to reverse the direction of change. Initially the output changes very slowly, but speeds up as the HI button continues to remain pressed. This output may be higher or lower than the value set in Step 2, and may be any value in the range of 0 to 20mA or 0 to 10V. This allows the easy reversal of analog output that is required in some applications.

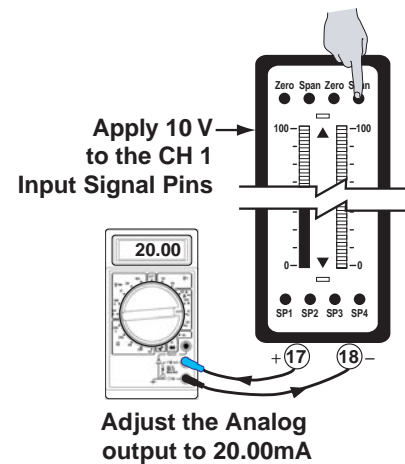

## STEP E EXIT THE ANALOG OUTPUT CALIBRATION MODE

- 1) Turn OFF the power to the bargraph
- 2) Re-power the bargraph. The two buttons will now return to their original function of DISPLAY 2 ZERO and DISPLAY 2 SPAN.
- 3) Calibration is now complete and the bar is scaled for a 0 to 10V input to produce an analog output of 4 to 20mA.

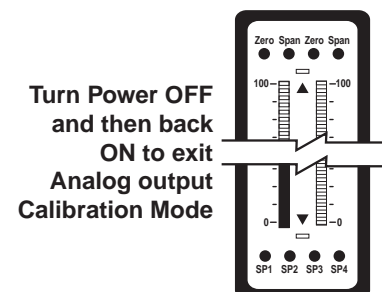




The bargraph has the option to have up to 4 setpoints (two 10A Form C relays and two 5A Form A relays) installed. Each relay may be set to activate either above or below its setpoint by inserting jumper clips on the Relay Activation header which is located on the Display Driver Board. See the layout diagram on Page 4 and 14 for the exact location. The steps to setup the setpoints are as follows:

## 1) SELECT THE RELAY ACTIVATION MODE FOR EACH INSTALLED RELAY

 Make sure that the required relays have been installed in the meter. Refer to the component layout on Page 14 for relay positions. If a jumper clip is installed in a specific relay position on the Relay Activation Mode Header, that relay will activate when the display bar is lower than the programmed setpoint. If no jumper clip is installed in a specific relay position on the Relay Activation Mode Header, that relay will activate when the display bar is equal to or higher than the programmed setpoint. The Diagrams below show some of the various possibilities for relay activation.

### Default


SP1, SP2, SP3, and SP4 all activate when input is equal to or higher than set point.



SP2 and SP4 activate when input is lower than set point. SP1 and SP3 activate when input is equal to or higher than set point.



 SP2 activate when input is lower than set point. SP1, SP3 and SP4 activate when input is equal to or higher than set point.



SP1 and SP3 activate when input is lower than set point. SP2 and SP4 activate when input is equal to or higher than set point.



SP1, SP2, SP3, and SP4 all activate when input is lower than set point.




SP1 and SP2 activate when input is lower than set point. SP3 and SP4 activate when input is equal to or higher than set point.



## 2) ADJUST THE SETPOINT FOR EACH RELAY

The setpoint for each relay is set by the front panel buttons marked SP1, SP2, SP3 and SP4. When a front panel button is pressed and held down, the associated setpoint is directly changed. The direction of change will be either up or down, as indicated by the UP and DOWN indicator LEDs. After the indicator LED lights up there is a 0.5 second delay before any change occurs. To reverse the direction of change, release the button and then press down again. As there are no menus or sub-menus to navigate, the programming and setup is quick and easy.

Setpoints are indicated on the bar display by an ON segment if the bar is below the setpoint and with an OFF segment if the bar display is above the setpoint.


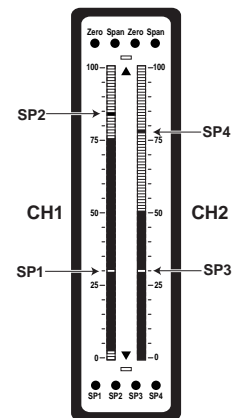


## EXTERNALLY ADJUSTABLE SETPOINT

The FL-B202Q may be configured to have SP1 as an external setpoint by selecting either Mode 3 or Mode 12. This external SP1 setpoint is adjusted either by a 10KΩ potentiometer connected as shown in Figure 1.a or by an external voltage or current as shown in Figure 1.b. This feature is used for adjusting the setpoint when the operator is located some distance away from the meter installation. In Mode 3 SP1 is an external setpoint and SP2 is a normal setpoint that is set by the SP2 front panel button.

In Mode 12 SP1 is an external setpoint and SP2 is a tracking setpoint that is set by the SP2 front panel button. Once SP2 is set, it will track any change in setpoint SP1 so that the window or difference between SP1 and SP2 is maintained constant.

In Mode 3 and Mode 12, the CH2 signal is used to adjust the SP1 setpoint. Therefore when a mode with an external setpoint is selected, even though the Universal Dual Input module IDP4 is used, only one input channel CH1 is available to measure input signals. It follows then, that before using this feature, CH2 has must be calibrated for the signal that will adjust the SP1 setpoint. A reference voltage of approximately 1V is provided on Pin 5 of the IDP4 Universal Dual Input module, for use with an external potentiometer.

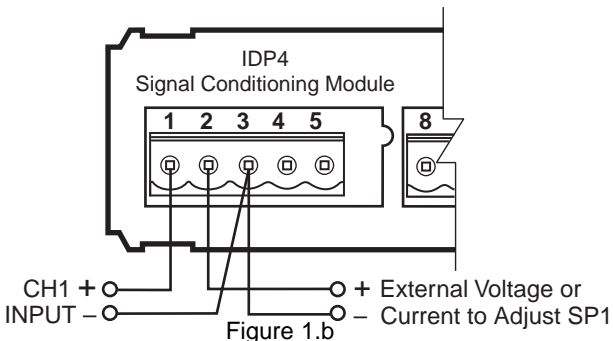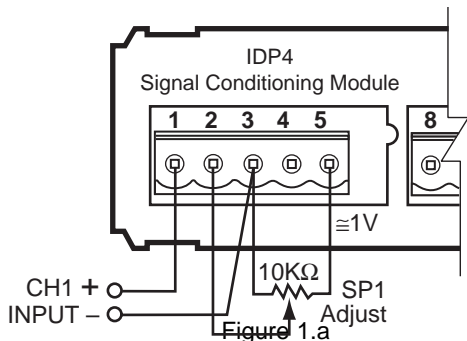

### External Setpoint Calibration

In Mode 3 and Mode 12, SP1 is an external setpoint that is adjusted by an external potentiometer or by an external signal. Before the external setpoint mode is selected, CH2 has to be scaled. The four steps to calibrate CH2 and then select the external setpoint mode are as follows.

#### 1) SELECT DUAL INPUT MODE 0

Select Mode 0 (See Page 8). If an external potentiometer is to be used with the internal reference of approximately 1V, then select the 2V range on CH2 of IDP4, the dual input signal conditioner. If some other signal is to control the external setpoint, then select the range of CH2 accordingly.

#### 2) CALIBRATE CH2 LO

Apply the minimum input signal to the CH2 input pins. If an external potentiometer is to be used with the internal reference of approximately 1V, then this minimum input signal is 0V. If some other signal is to control the external setpoint, input the appropriate signal at this stage. Using the CH2 ZERO button calibrate the CH2 bar to read zero. (See Page 6 for detailed instructions)


#### 3) CALIBRATE CH2 HI

Apply the maximum input signal to the CH2 input pins. If an external potentiometer is to be used with the internal reference of approximately 1V, then connect Pin 5 to Pin 2. If some other signal is to control the external setpoint, input the appropriate signal at this stage. Using the CH2 SPAN button calibrate the CH2 bar to read full scale. (See Page 6 for detailed instructions)

#### 4) SELECT REQUIRED EXTERNAL SETPOINT MODE 3 OR MODE 12

Check that the CH2 bar has been calibrated correctly, and then select the required external setpoint Mode 3 (One external setpoint and one normal setpoint) or Mode 12 (One external setpoint and one tracking setpoint). As the external 10KΩ potentiometer wiper moves from one end to the other, (or as the setpoint signal increases from Lo to Hi), setpoint SP1 will move from the zero position to the full scale position on bar 2.

# Functional Diagram

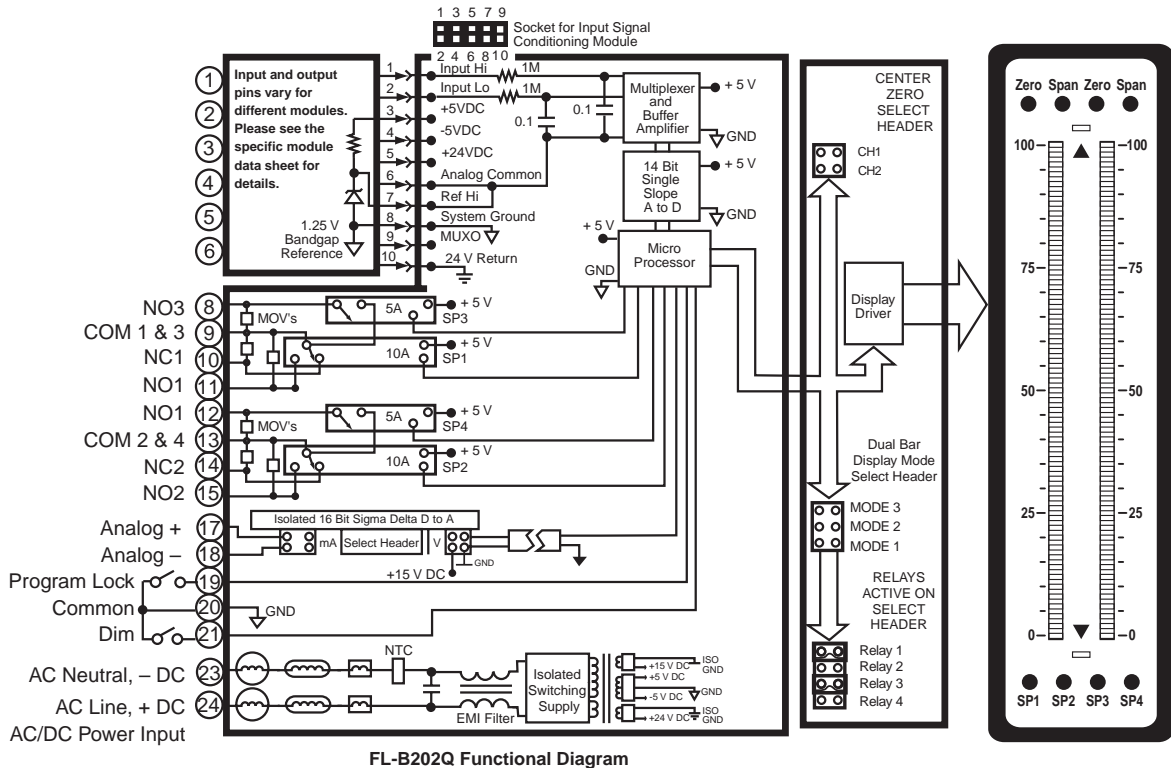


FL-B202Q Functional Diagram

## Connector Pinouts

This meter uses plug-in type screw terminal connectors for all input and output connections. The power supply connections (pins 23 and 24) have a unique plug and socket outline to prevent cross connection. The main board uses standard right-angled connectors.

Replacement 2-, 3-, and 4-pin plug connectors are available (see Accessories on page 16).

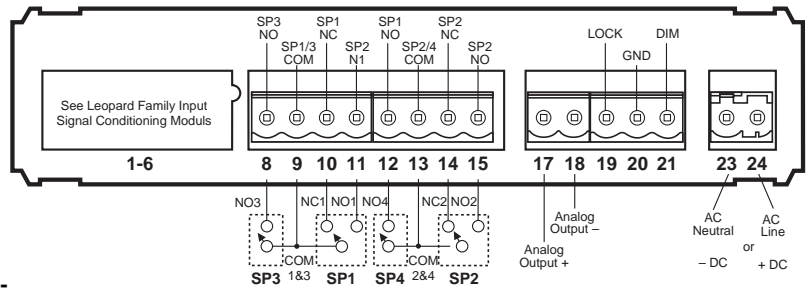

### WARNING

AC and DC power supply voltages are hazardous. Make sure the power supply is isolated before connecting to the meter.

Note: The sequence of setpoint outputs on meters shipped prior to 2002 was 1-2-3-4. The sequence is now 3-1-4-2, enabling delay on make (dom) and delay on break (dob) to be used with both Form "C" relays.

## Pin Descriptions

### Input Signal – Pins 1 to 6

Pins 1 to 6 are reserved for the input signal conditioner. See the data sheet for the selected input signal conditioner.

### Pins 8 to 15 – Relay Output Pins

- Pin 8 SP3 NO. Normally Open 5 Amp Form A.
- Pin 9 SP1/3 COM. Common for SP1 and SP3.
- Pin 10 SP1 NC. Normally Closed 10 Amp Form C.
- Pin 11 SP1 NO. Normally Open 10 Amp Form C.
- Pin 12 SP4 NO. Normally Open 5 Amp Form A.
- Pin 13 SP2/4 COM. Common for SP3 and SP4.
- Pin 14 SP2 NC. Normally Closed 10 Amp Form C.
- Pin 15 SP2 NO. Normally Open 10 Amp Form C.

### Pins 17 to 21 – Rear Panel Switches

- Pin 17 ANALOG OUTPUT (+). mA (0 to 20 mA/4 to 20 mA) or V (0 to 10 V) output is header selectable.


- Pin 18 ANALOG OUTPUT (-). mA (0 to 20 mA/4 to 20 mA) or V (0 to 10 V) output is header selectable.
- Pin 19 PROGRAMMING LOCK. By connecting the LOCK pin to the COMMON pin, the meter's programmed parameters can be viewed but not changed.
- Pin 20 COMMON. To activate the LOCK or DIM functions from the rear of the meter, the respective pins have to be connected to the COMMON pin. This pin is connected to the internal power supply ground.
- Pin 21 DIM. By connecting the display dim (DIM) pin to the COMMON pin, the display brightness setting is halved.

### Pins 23 and 24 – AC/DC Power Input






Auto-sensing AC/DC power supply. For voltages between 85-265 V AC / 95-370 V DC (PS1) or 18-48 V AC / 10-72 V DC (PS2).

- Pin 23 AC Neutral / -DC. Neutral power supply line.
- Pin 24 AC line / +DC. Live power supply line.

# Component Layout

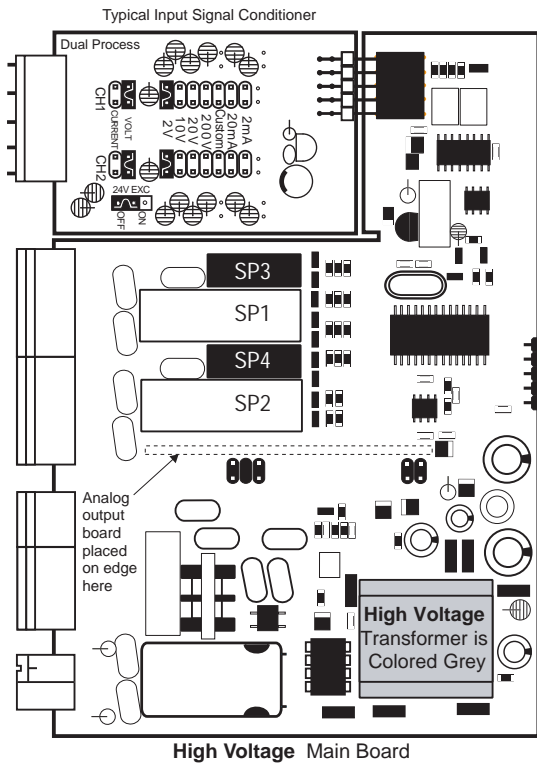

Pins Connect Main Board to Driver Board

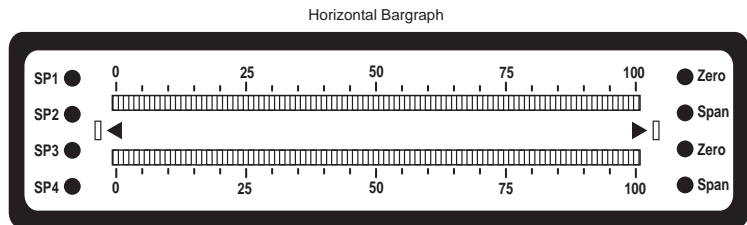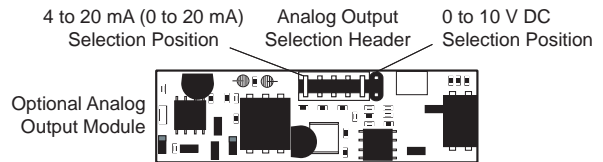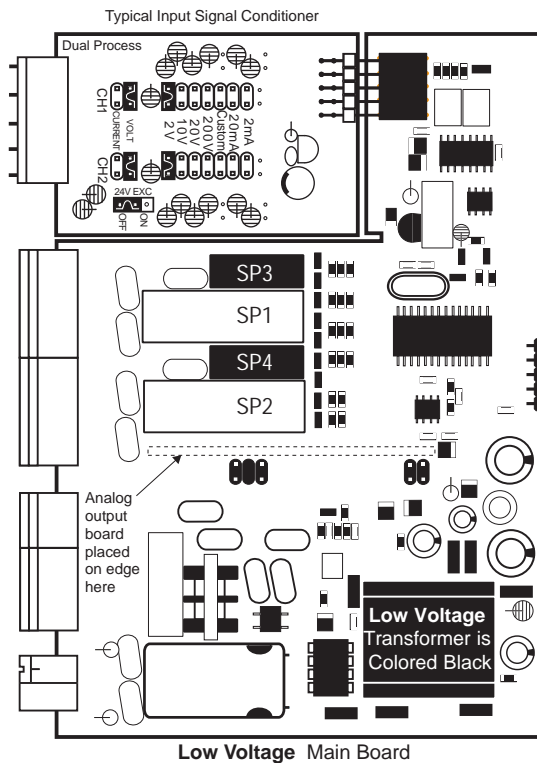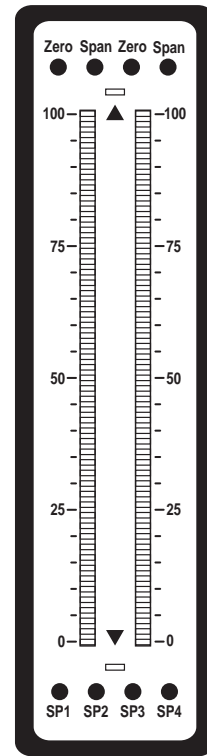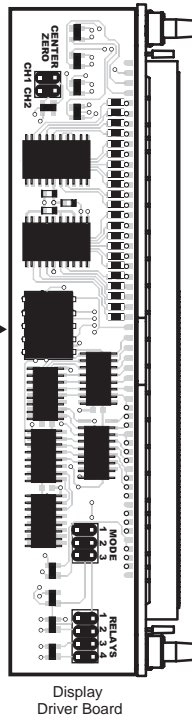


## Connectors

### WARNING



AC and DC input signals and power supply voltages can be hazardous. Do Not connect live wires to terminal blocks, and do not insert, remove or handle terminal blocks with live wires connected.

Standard plug-in screw terminal blocks provided by Texmate:

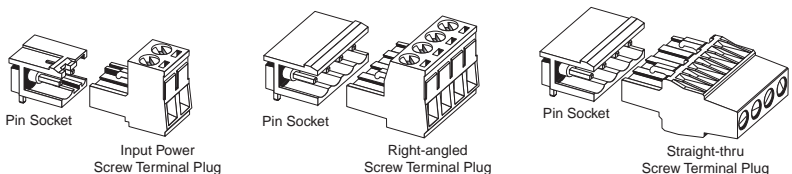










# I-Series Input Signal Conditioning Modules

Many additional input modules are available and others are constantly being developed. Check with your local distributor or [www.texmate.com](http://www.texmate.com) for updated information.

Pre-calibrated **I-Series** input modules, that have span or zero potentiometers, can be interchanged between any **I-Series** compatible meter, without recalibration, because all of the analog scaling and reference circuitry is self-contained within the module. Where appropriate, all the standard ranges shown are designed to be header selectable by the user, and Texmate's unique SPAN ADJUST Header facilitates scaling to almost any required engineering unit. See Input Module Component Glossary and Calibration on pages 13 and 14. Also see Two Point Digital Calibration and Digital Calibration on page 4.


Unless otherwise specified Texmate will ship all modules pre-calibrated with factory preselected ranges and/or scalings as shown in **BOLD** type. Other pre-calibrated standard ranges or custom ranges may be ordered. Factory installed custom scaling and other custom options are also available (see Ordering Information, Special Options on last page).

Symbols Indicate Module Compatibility Within Meter Families		
 TIGER Family	 LEOPARD Family	 LYNX Family
 TIGER Family	 LEOPARD Family	 LYNX Family
 TIGER Family	 LEOPARD Family	 LYNX Family
<b>ALL MODELS</b>	<b>SOME MODELS</b>	<b>MODEL SPECIFIC</b>




**WARNING:** AC and DC input signals and power supply voltages can be hazardous. Do Not insert, remove or handle modules with live wires connected to any terminal plugs.


IA01: AC Volts Scaled RMS, 200/600V AC

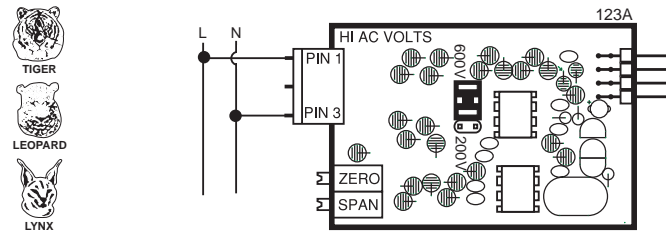


IA06: AC Volts True RMS, 300/600V AC

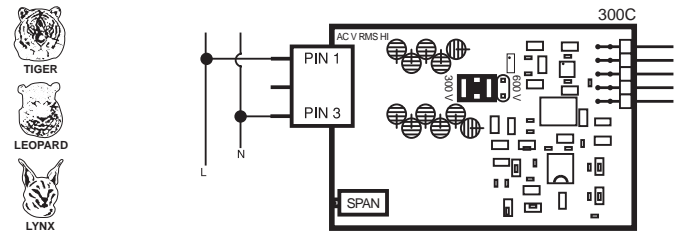


IA02: AC Volts Scaled RMS, 200mV/2V/20V AC

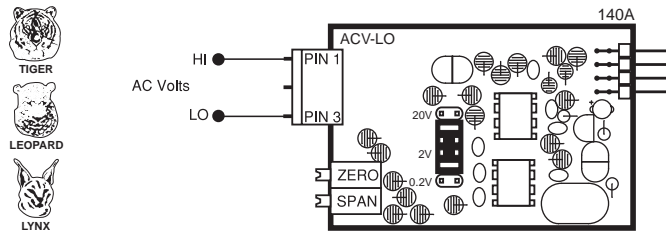


IA07: AC Volts True RMS, 200mV/2V/20V AC

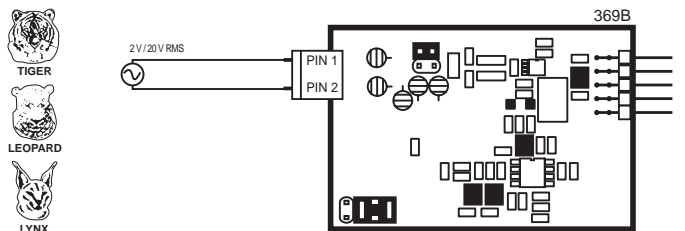

IA03: AC Milliamps Scaled RMS, 2/20/200mA AC

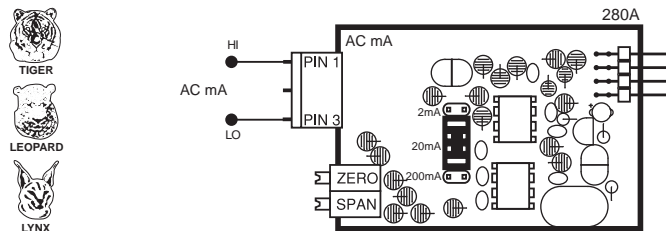


IA08: AC Milliamps True RMS, 2/20/200mA AC

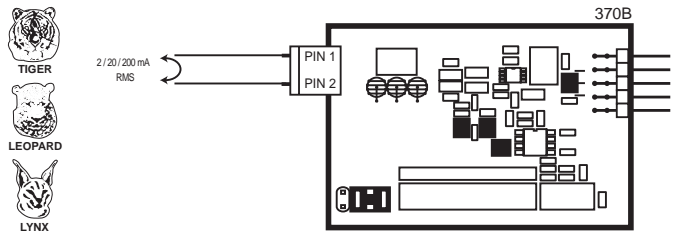


IA04: AC Amps Scaled RMS, 1 Amp AC

IA05: AC Amps Scaled RMS, 5 Amp AC

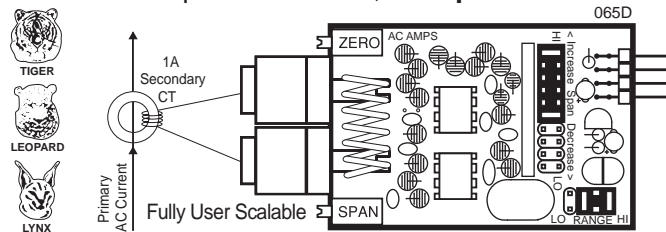


IA09: AC Amps True RMS, 1 Amp AC

IA11: AC Amps True RMS, 5 Amp AC

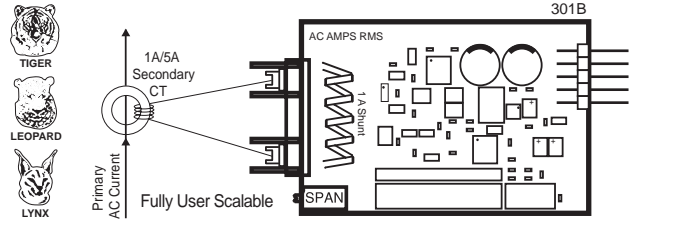


# I-Series Input Signal Conditioning Modules


IA10 AC Millivolts, Scaled RMS, **100mV AC**

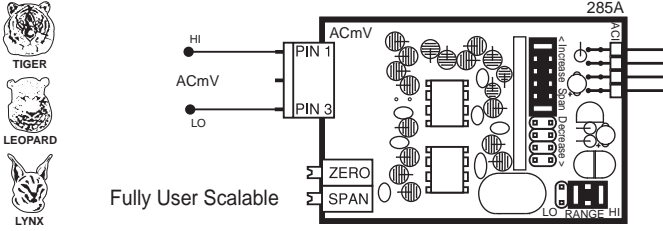


ID04: DC Amps, **5A DC**  
ID09: DC Amps, **1A DC**

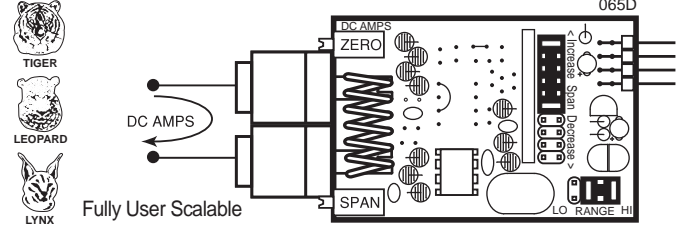


IA12: AC Millivolt RMS Sigma Delta

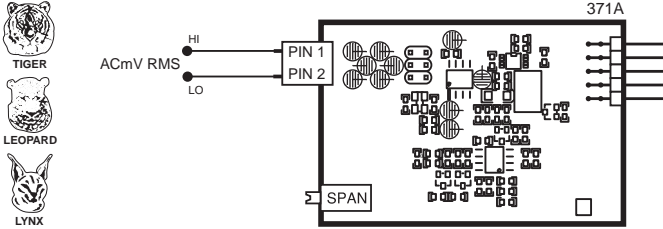


ID05: DC Volts **2/20/200/Custom V DC with Offset**  
and **24V Exc.**

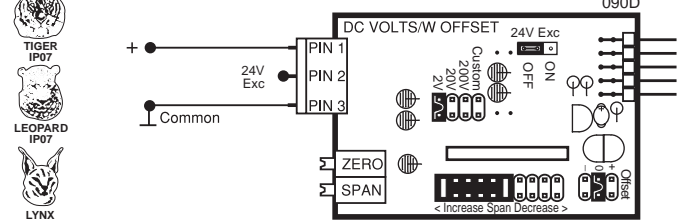


ID01: DC Volts, **2/20/200V/Custom w/24V DC Exc**

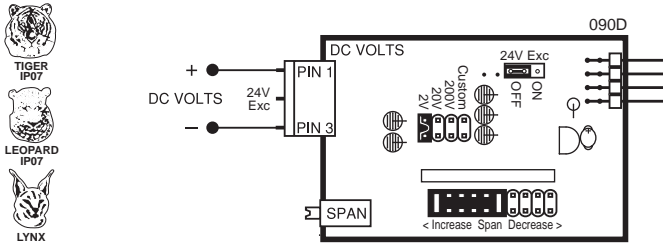



ID07: DC Milliamps, **2/20/200mA DC with Offset**  
and **24V Exc**

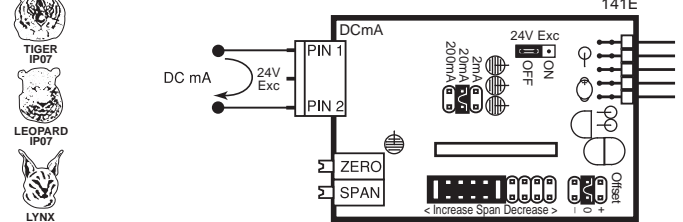


ID02: DC Millivolts, **20/50/100/200mV DC w/24V DC Exc**

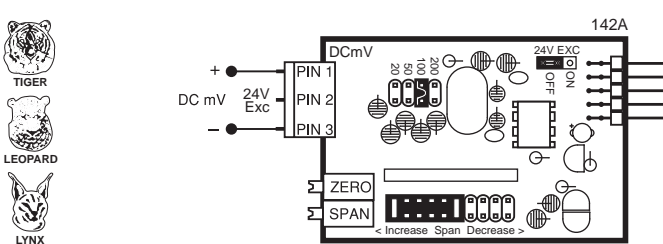



IDP4: Dual Channel Universal Process  
**2V/10V/20V/200V/2mA/20mA/Custom**

 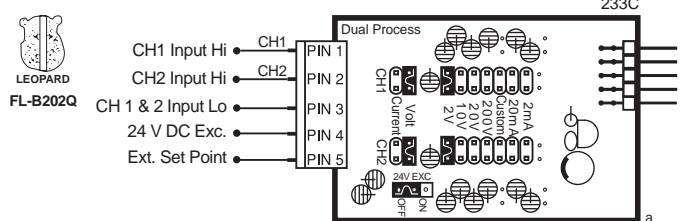


ID03: DC Milliamps, **2/20/200mA DC w/24V DC Exc**

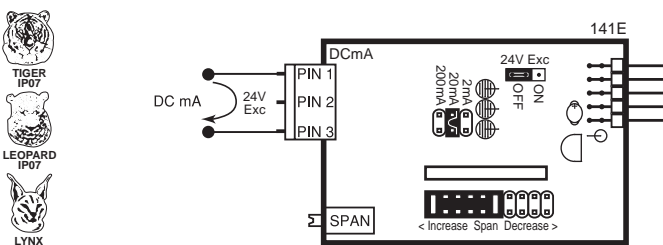

 
Dual Channel DC mA **2 mA/20 mA/Custom**  
Connection for IDP4 (2 mA DC range shown)

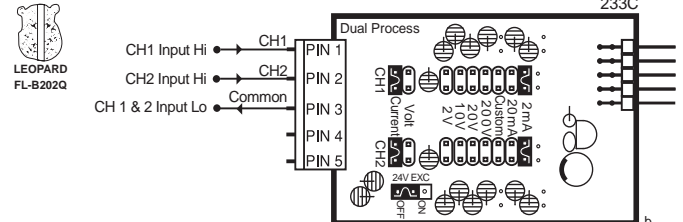


**Dual 4-20 mA Connection for IDP4**

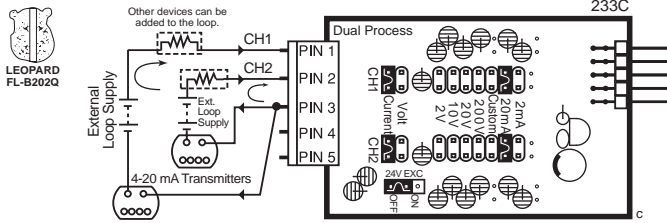


**4-20 mA Connection for IDP4 with External Setpoint option - excitation provided by the meter**

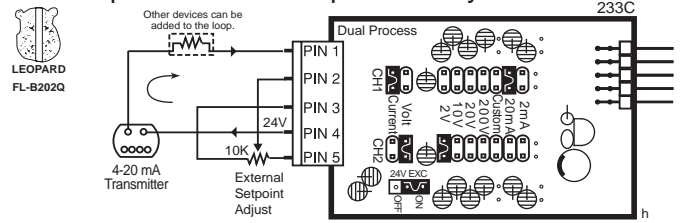


**Dual Channel 4-20 mA Connection for IDP4  
Excitation provided by the meter**

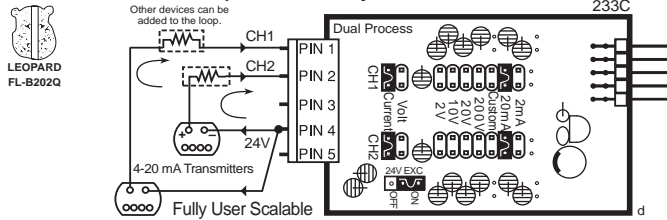


**IF02: Line Frequency**

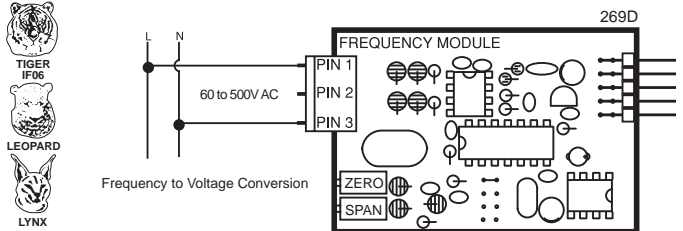


**DC Volt Connection for IDP4 with External Setpoint option 2 V/10 V/20 V/200 V/Custom**

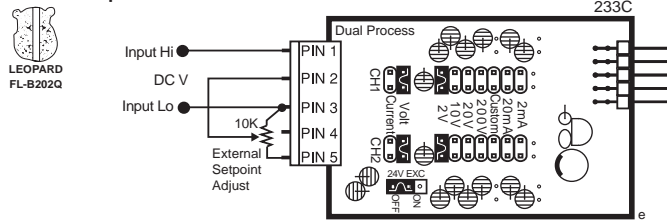

**IGYZ: Universal Direct Pressure (Absolute or Differential/Gage)  
See below for ordering code options**

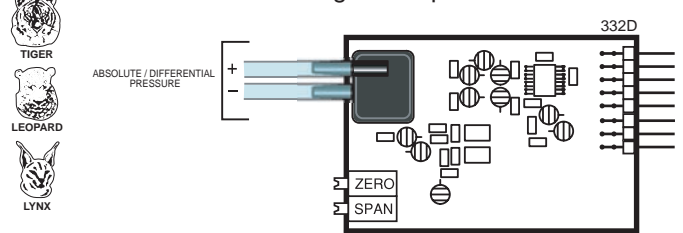

**DC mA Connection for IDP4 with External Setpoint option 2 mA/20 mA/Custom**

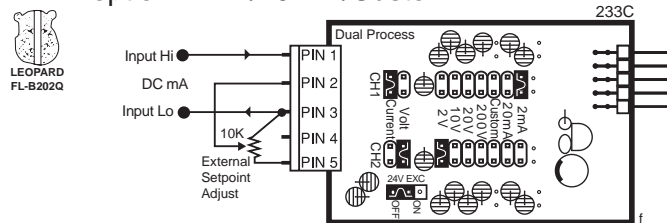


**Ordering Code Options for Direct Pressure (IGYX, IGYG & IGYZ)**

Sensor Range	CH1 Order Code	CH2 Order Code
1 psi Absolute	A	A
1 psi Differential	B	B
5 psi Absolute	C	C
5 psi Differential	D	D
15 psi Absolute	E	E
15 psi Differential	F	F
30 psi Absolute	G	G
30 psi Differential	H	H
100 psi Absolute	J	J
100 psi Differential	K	K


For Single Channel IGYX with two digital inputs, the last digit of order code is always X.

For Universal Direct Pressure IGYZ, the last digit of order code is always Z.


**4-20 mA Connection for IDP4 with External Setpoint option**

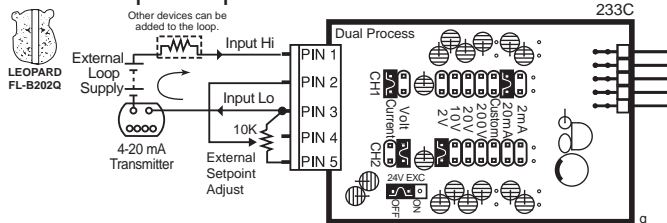


**IP01: Process Loop, 4-20mA  
IP02: Process Loop, 4-20mA with 24VDC EXC**

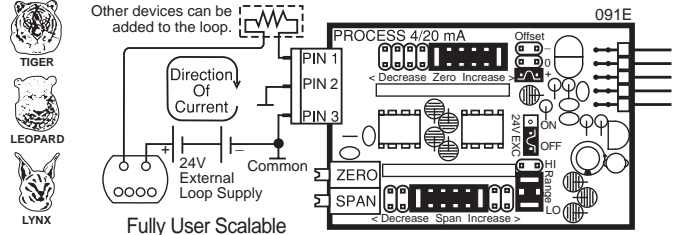


**IP03: Process Input, 1-5V DC with Offset, 24V Exc**

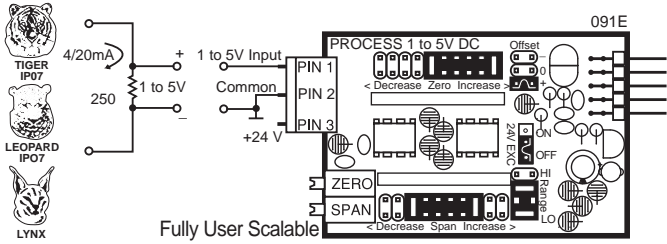


**IR04: Resistance 2KΩ (Lynx only)**  
**IR05: Resistance 2KΩ (Leopard only)**

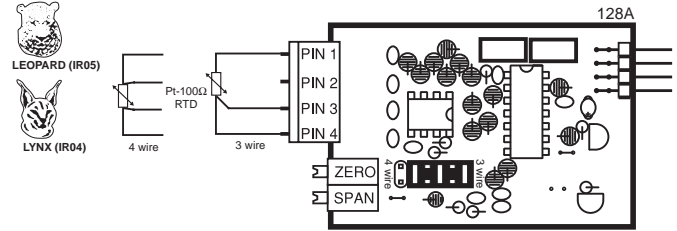


**IP07: Universal Process Input**  
 2V/5V/10V/20V/200V/2mA/20mA/Custom

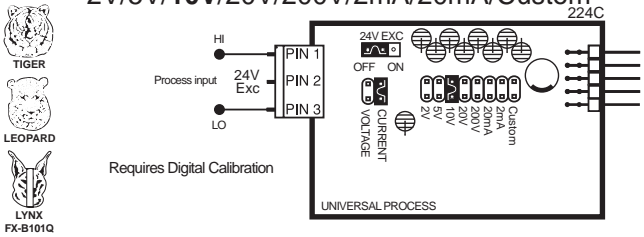


**IS01: Strain Gage 5/10VDC Exc., 20/2mV/V, 4/6-wire**  
**IS02: Pressure/Load Cell 5/10VDC Exc., 20/2mV/V, 4/6-wire**

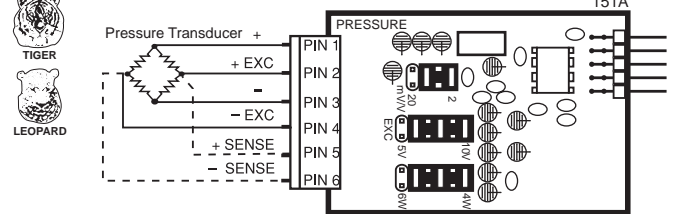


**IPT1: Prototype Board for Custom Design**

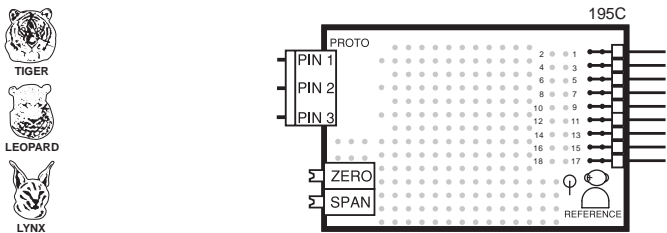


**IS04: Pressure/Load Cell Ext Exc., 20/2mV/V, 4/6-wire**

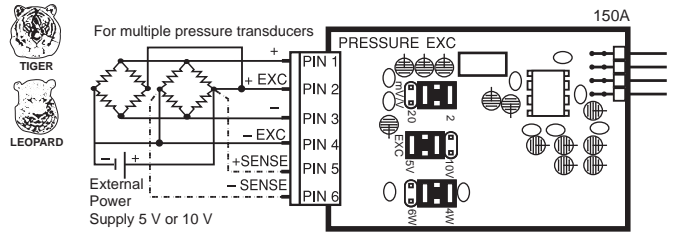


**IR02: 3 wire Potentiometer 1K min (0-F.S.)**

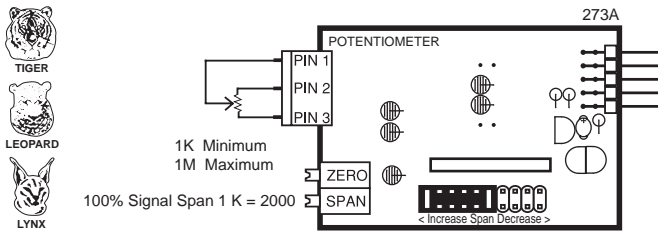


**IS05: Pressure/Load Cell 20/2mV/V, 5/10V Exc 4-wire**

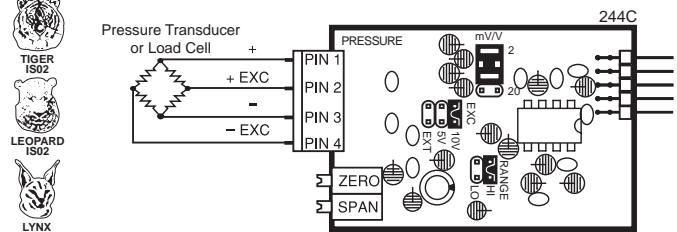

**IR03: Linear Potentiometer 1KΩ min**

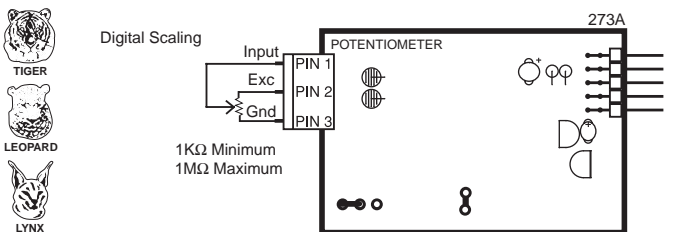


**IS06: Pressure/Load Cell Ext Exc., 20/2mV/V, 4-wire**

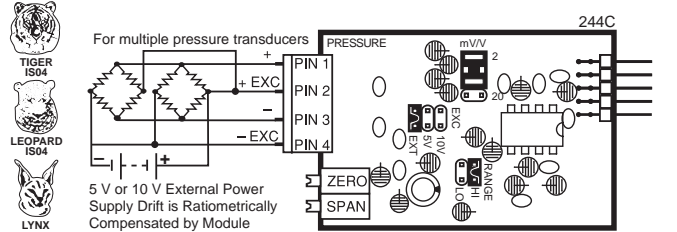



**IS07: Pressure/Load Cell Ext Exc. High Impedance, 20/2mV/V, 4/6-wire**

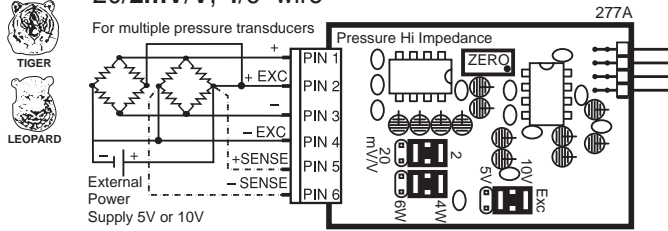


**IT03: RTD, 100 Pt. 2/ 3/4-wire (-200 to 800°C)**

**IT04: RTD, 100 Pt. 2/ 3/4-wire (-200 to 1470°F)**


**IT05: RTD, 100Ω Pt. 2/3/4-wire (-199.9 to 199.9°F)**

**IT14: RTD, 100Ω Pt. 2/3/4-wire (-199.9 to 199.9°C)**

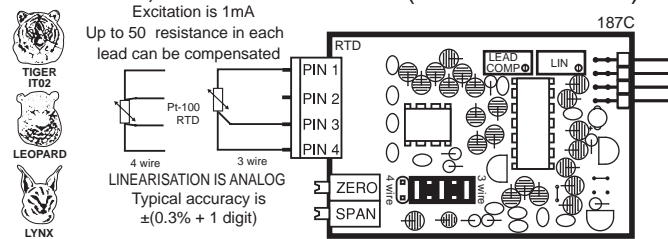


**IT06: Thermocouple, J Type (0-1400 °F)**

**IT08: Thermocouple, J Type (0-760 °C)**

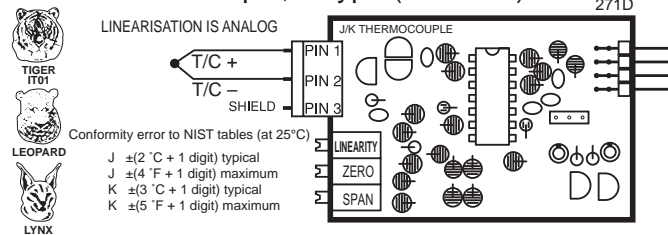


**IT07: Thermocouple, K Type (0-1999 °F)**

**IT09: Thermocouple, K Type (0-1260 °C)**

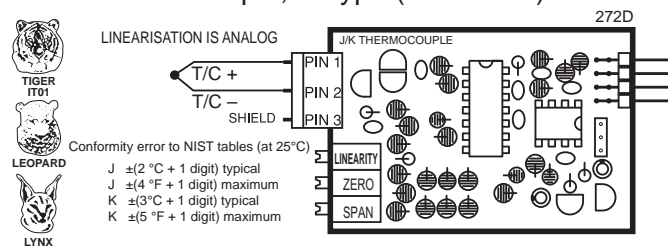


 Dual input modules, and those modules exclusively compatible with the Leopard or Tiger Families, do not have zero and span adjustments. These modules are scaled and calibrated using the internal software functions of each individual meter.




### Input and Output Pins

 On most modules Pin 1 is the Signal High input and Pin 3 is the Signal Low input. Typically Pin 2 is used for Excitation Voltage output.




### 24 V DC Output for 4-20 mA Header

On some modules this header enables a 24 V DC 25 mA (max) Excitation/Auxiliary output to be connected to Pin 2 that can power most 4-20 mA process loop sensors.

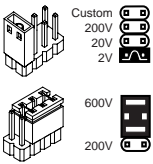


### INPUT RANGE Headers

Range values are marked on the PCB. Typically two to eight positions are provided, which are selected with either a single or multiple jumper clip. When provided, a custom range position is only functional when the option has been factory installed.

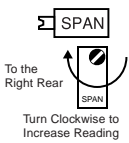

### SPAN Potentiometer (Pot)


If provided, the 15 turn SPAN pot is always on the right side (as viewed from the rear of the meter). Typical adjustment is 20% of the input signal range.

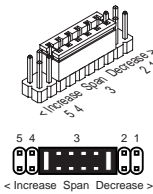

### SPAN ADJUST Header

This unique five-position header expands the adjustment range of the SPAN pot into five equal 20% steps, across 100% of the input Signal Span. Any input Signal Span can then be precisely scaled down to provide any required Display span from full scale to the smallest viewable unit.


 
SPAN Adjust Header position	1	2	3	4	5
SPAN Pot %	20%	20%	20%	20%	20%
Signal Span %	20%	40%	60%	80%	100%



### SPAN RANGE Header


When this header is provided it works in conjunction with the SPAN ADJUST Header by splitting its adjustment range into a Hi and a Lo range. This has the effect of dividing the adjustment range of the SPAN pot into ten equal 10% steps across 100% of the input Signal Span.

 SPAN Adjust Header position	Span Adjust Header					Span Range Header				
	1	2	3	4	5	1	2	3	4	5
SPAN Pot %	10%	10%	10%	10%	10%	10%	10%	10%	10%	10%
Signal Span %	10%	20%	30%	40%	50%	60%	70%	80%	90%	100%

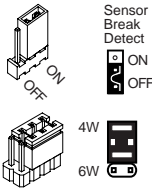


### Function Select Headers

On some modules various functions such as Amps and Volts, 4 wire and 6 wire, or cold junction compensation are selected by header positions that are marked on the PCB.

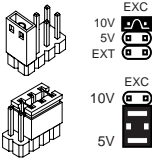



### Excitation Output Select Headers

When excitation outputs are provided, they are typically 5 V DC max 30 mA, 10 V DC max 30 mA (300Ω or higher resistance) or external supply. They are selected by either a single or multiple jumper clip.

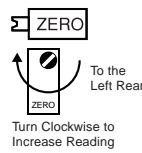



### ZERO Potentiometer (Pot)

  If provided, the ZERO pot is always to the left of the SPAN pot (as viewed from the rear of the meter). Typically it enables the input signal to be offset  $\pm 5\%$  of the full scale display span.



### ZERO OFFSET RANGE Header

When provided, this three position header increases the ZERO pot's capability to offset the input signal, by  $\pm 25\%$  of the full scale display span. For example a Negative offset enables a 1 to 5 V input to display 0 to full scale. The user can select negative offset, positive offset, or no offset (ZERO pot disabled for two step non-interactive span and offset calibration).

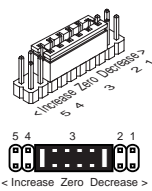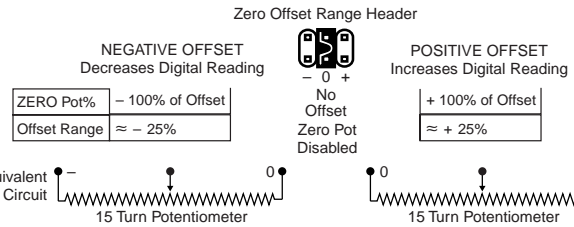

### ZERO ADJUST Header

When this header is provided, it works in conjunction with the ZERO OFFSET RANGE Header, and expands the ZERO pot's offset capability into five equal negative steps or five equal positive steps. This enables virtually any degree of input signal offset required to display any desired engineering unit of measure.

ZERO Adjust Header Position	Zero Adjust Header					Zero Offset Range Header				
	5	4	3	2	1	1	2	3	4	5
ZERO Pot Span	6400	6400	6400	6400	6400	6400	6400	6400	6400	6400
Offset Range	-25200 to +31600	-18900 to +25300	-12600 to +19000	-6300 to +12700	0 to -6400	0 to +6400	+6300 to +12700	+12600 to +19000	+18900 to +25300	+25200 to +31600

CALIBRATE position, Zero Pot disengaged (no offset applied)

Tiger, Leopard and Q-Series Lynx meters have software calibration and scaling functions that can expand or be used in conjunction with the analog capabilities of any compatible modules.

**Note:** I-Series modules with analog calibration and scaling capability can be interchanged between any compatible meter without recalibration. However, meters that also have software scaling and calibration capabilities such as meters in the Leopard and Tiger families or Lynx Q-Series (Quickset programming), must have their software scaling set to unity gain.

### Basic standard range calibration of direct reading modules that utilize either Auto Zero or a ZERO pot, an INPUT RANGE Header and or a SPAN pot.

- 1 If the module has an INPUT RANGE Header, reposition the jumper clip to select the desired input signal range.
2. Apply a zero input or short the input pins. The display will auto zero, or if the module has a ZERO pot, it should be adjusted until the display reads zero.
- 3 Apply a known input signal that is at least 20% of the full scale input range and adjust the SPAN pot until the display reads the exact input value. The Lynx family of Q meters can accept negative signals also, and may be scaled for inputs from -50% to +100% of the range selected on the input signal conditioning module.

### Wide range scaling, in engineering units not requiring offsets, with modules that utilize auto-zero or a ZERO pot, a SPAN RANGE Header and or a SPAN ADJUST Header.

Texmate's unique SPAN ADJUST and SPAN RANGE Headers provide the circuit equivalent of an ultra-precision one megohm 75 or 150 turn potentiometer that can infinitely scale down any Input Signal SPAN to provide any Display Span from full scale to the smallest viewable unit.

If the module has an INPUT RANGE Header, and the required full scale Display Span (digital counts or bargraph segments) is to be larger than the directly measured value of the input Signal Span, then the next lower range on the INPUT RANGE Header should be selected. The resulting over range Signal Span is then scaled down, by selecting the position of the SPAN RANGE Header and or the SPAN ADJUST Header, which will reduce the input Signal Span to a percentage, that the required Display Span can be reached by calibration with the SPAN pot.

**Example A:** Using a FL-B202Q bargraph meter

Input signal 0 to 10 V to read zero to full scale.

Signal Span = 10 V, Display Span = 100 segments

- 1 Select the 2 V INPUT RANGE Header position. The standard direct scaling will provide a display of 100 segments with an input of only 2 V which is  $(2 \div 10) = 20\%$  of the examples 10 V Signal Span.
- 2 To scale down the Signal Span to 20% select the 20% Signal Span position on the SPAN ADJUST Header (position 1) or if the module has a SPAN RANGE Header, select (LO Range) and 20% Signal Span position on the SPAN ADJUST Header (position 2).
- 3 Apply a zero input or short the input pins. The display will auto zero, or if the module has a ZERO pot, it should be adjusted until the display reads zero.
- 4 Apply 10 V and adjust the SPAN pot until the display reads full scale.

### Large offset scaling and calibration of process signal inputs with modules that utilize ZERO ADJUST Headers and or ZERO OFFSET RANGE Headers.

Texmate's unique ZERO OFFSET RANGE Header enables the use of a simple two step scaling and calibration procedure for those process signals that require large offsets. This eliminates the back and forth interaction, between zero and span settings, that is often required to calibrate less finely engineered products.

The first step is to set the ZERO OFFSET RANGE Header to the center position (No Offset) and scale down the Input Signal Span to a percentage that will enable calibration with the SPAN pot to reach the required Display Span.

The second step is to set the ZERO ADJUST and or ZERO OFFSET RANGE Header to provide a positive or negative offset so that calibration with the ZERO pot will offset the Display Span to produce the required display reading.

**Example B:** Using a FL-B202Q Bargraph meter.

Input signal 1 to 5 V to read zero to full scale.

Signal Span = 4 V, Display Span = 100 segments

- 1 If the module has an INPUT RANGE Header the 2 V position should be selected. This will provide a display of 101 segments for an input of 2 V which is  $(2 \div 4) = 50\%$  of the examples 4 V signal span. To scale down the Signal Span to 50% select the next higher 60% Signal Span position on the SPAN ADJUST Header (position 3).
- 2 If the module is a Process Input 1-5 V DC type, select the (Hi Range) position on the SPAN RANGE Header and the 100% Signal Span position on the SPAN ADJUST Header (position 5, max increase). This will provide a display of 101 segments for an input of 4 V which is 100% of the examples 4 V Signal Span.
- 3 Set the ZERO OFFSET RANGE Header to the center position (no offset). Apply 1 V and adjust the SPAN pot until the display reads 25 segments. A 4 V input would then read 100 segments.
- 4 Set the ZERO OFFSET RANGE Header to the negative offset position. If the module has a ZERO ADJUST Header select the position that will provide a negative offset of  $\approx 25$  segments. Apply 1 V and adjust the ZERO pot until the display reads zero. Apply 5 V and check that the display reads full scale.

**Example C:** Using a FL-B202Q Bargraph meter

Input signal 4 to 20 mA to read zero to full scale


Signal Span = 16 mA, Display Span = 100 segments

- 1 The full scale Signal Span of the Process Input 4-20 mA modules is 0 to 20 mA for a full scale Display Span of 0 to 100 segments.
- 2 Select the (Lo Range) Position on the Span Range Header and the 70% Signal Span position on the SPAN ADJUST Header (position 2).
- 3 Set the ZERO OFFSET RANGE Header to the center position (no offset). Apply 4 mA and adjust the SPAN pot until the display reads 25 segments. A 16 mA input would then read 100 segments.
- 4 Set the ZERO OFFSET RANGE Header to the positive offset position. If the module has a ZERO ADJUST Header select the position that will provide a negative offset of  $\approx -25$  segments. Apply 4 mA and adjust the ZERO pot until the display reads zero. Apply 20 mA and check that the display reads full scale.

# Standard Face Plates and Scales

Unless otherwise specified, a standard 0-100 scaled face plate with white letters on a black background is provided with each meter. In those cases where a temperature module is ordered, a 0 – 200°F (white on black) face plate will be provided as standard.

Alternatively a face plate with black letters on a white background or a blank, white or black face plate, may be ordered as a no charge substitute. For temperature applications there are also several different optional face plates that may be ordered as a no charge substitute. (See below). Customized face plates with special scaling can also be ordered (see following page).

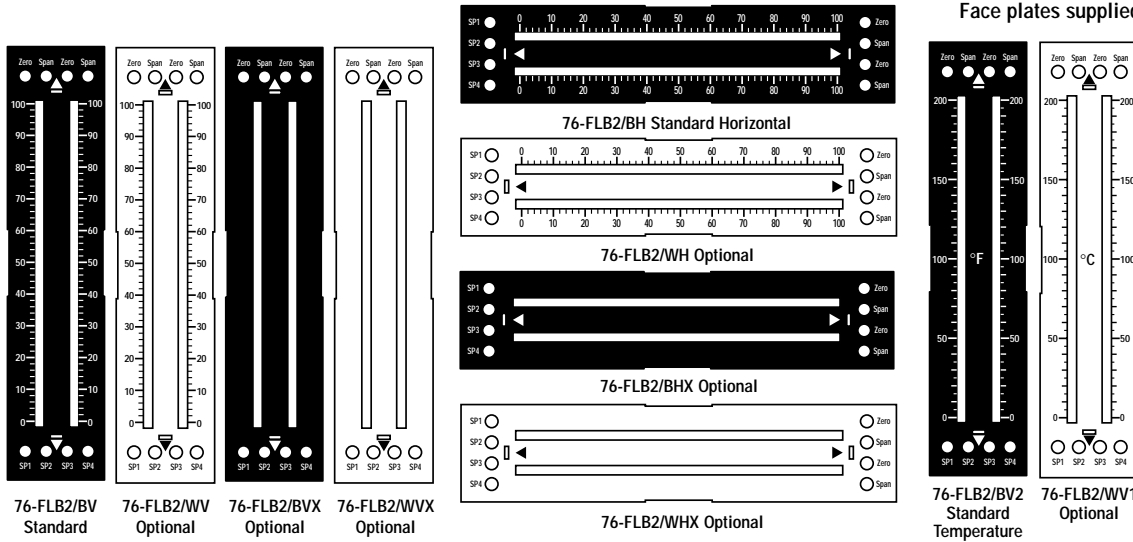

Face plates supplied with temperature modules.


Other optional face plates for temperature are also available in the following ranges:

- 0 to 200
- 0 to 1000
- 200 to +200 (Zero Center Mode)

When ordering, specify white letters on a black background or black letters on a white background. Horizontal or vertical format and °F or °C caption.

# Standard Scales and Caption Sheets (white or black lettering for do-it-yourself customizing)

Clear self-adhesive caption sheets with white or black lettering are provided for each meter shipped with a standard or optional faceplate.

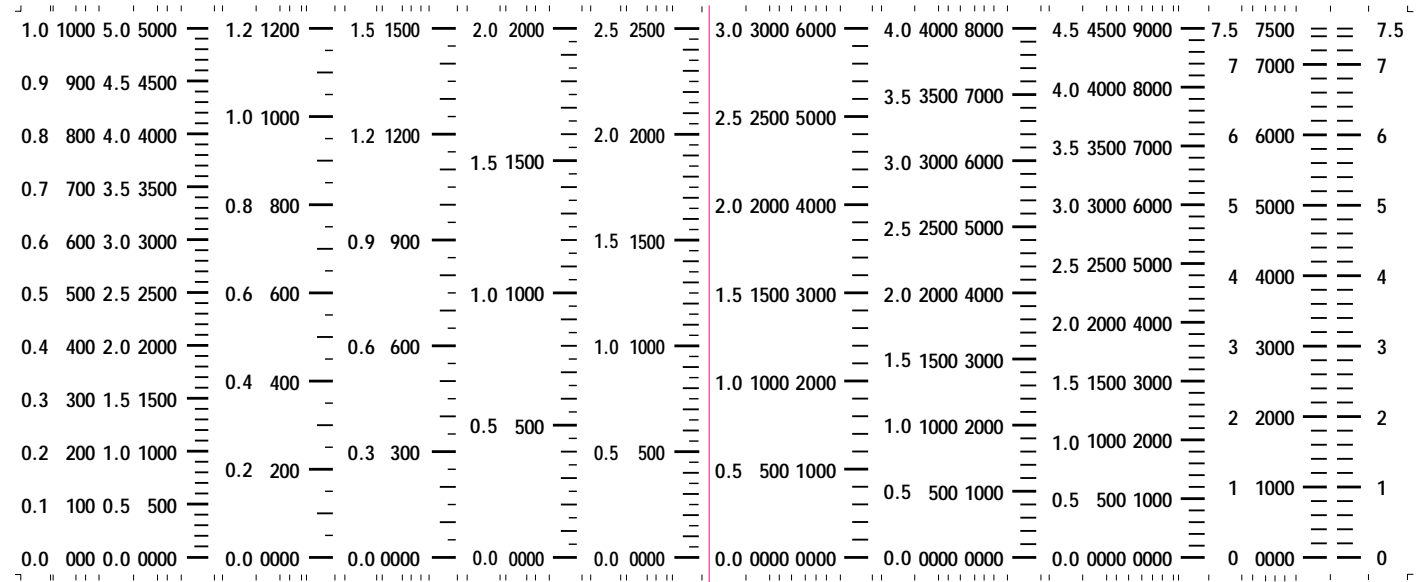


A	AC	E <sub>b</sub>	Btu	bars	CFH	BHP	Low	inch/	CosØ	AMPS	BBL/HR	AHEAD	AC Vars	AC Amperes	AC Kilowatts	AIR PRESSURE	AC Milliampers
J	Ah	KJ	bar	cal <sub>15</sub>	CFM	IPS	High	Kcal	FEET	GALS	BBL/MIN	ALARM	AC Volts	AC Kilovars	AC Millivolts	AC Kiloamperes	Battery Voltage
K	cd	kV	cal	cm <sup>-1</sup>	CFS	IPH	MGD	kg/hr	Hold	INHG	DEG/MIN	BOILER	AC Watts	AC Kilovolts	BPH X 1000	AC Megavars	Backup Voltage
l	dB	kW	cm	cm <sup>2</sup>	COS	Kg/h	Mld	kVAR	Km <sup>3</sup> /h	m/min	FT H <sub>2</sub> O	Cycles	BEARING	AIR FLOW	CFH x 1000	AC Megawatts	Displacement
m	DC	ml	FT <sup>3</sup>	cm <sup>3</sup>	CPH	KPH	MPH	kW/s	MWH	m/sec	In. H <sub>2</sub> O	Depth	COOLANT	BBLs/HOUR	DC Amperes	AC Watts/Vars	DC Amps to Ground
V	FT	NL	lbs	dm <sup>3</sup>	CPM	KPM	MPS	RPM	mWs	Nm <sup>3</sup> /h	Kg/cm <sup>2</sup>	HEATER	DC Volts	BFM AMPS	DC Kilovolts	CENTIMETERS	DC Microamperes
α	HP	Pa	IN <sup>2</sup>	H <sub>2</sub> O	CPS	KPS	N/m <sup>2</sup>	MPM	mbar	Ohms	KNOTS	Height	DC Watts	BHP x 100	DC Kilowatts	DC Kiloamperes	DC Milliampers
β	Hz	PF	kg/	kPa	DCA	KWH	ORP	M <sup>3</sup> /hr	ml/m <sup>3</sup>	PSIA	kg/sec	Hertz	Humidity	Degrees C	DC Millivolts	DC FAN AMPS	GALLONS / MINUTE
φ	Kg	pH	mA	l/s	FPH	lb/ft	PPH	Upm	mm/s	PSID	Mvars	Hours	ENGINE	DC Current	FPM X 100	IN. H <sub>2</sub> O PRESS	GENERATOR AMPS
Ω	kA	sin	mS	l/h	FPM	lb/in	PPM	VAC	Peak	PSIG	mmH <sub>2</sub> O	INCHES	EXHAUST	Dew Point	FPM X 1000	LBS/MINUTE	LBS PER GALLON
Δ	L <sup>3</sup>	t/h	mV	l/m	FPS	LPH	PPS	Vars	PORT	PSIR	mmHg	Input	Humidity	Degrees C	GPM X 1000	LEVEL INCHES	LOAD LIMIT PERCENT
μ	m <sup>3</sup>	yd <sup>3</sup>	Nm	lb/h	GAL	LPM	RPH	VDC	STRB	SCFM	VOLTS	PORT	METERS	Degrees F	HORSEPOWER	LEVEL GALLONS	MANIFOLD PRESSURE
∂	W	μA	oz	MW	GMP	LPS	RPS	w/m <sup>2</sup>	TARE	TORR	%LOAD	PUMP	Output	Degrees K	INCHES WC	LEVEL PERCENT	MILL LOAD AMPS
∇	°C	μS	RH	min	GPH	m <sup>3</sup> /h	phi	YPM	TONS	U/min	%OPEN	Preset	Percent	Degrees R	INCHES H <sub>2</sub> O	MILLIMETERS	MOTOR LOAD AMPS
∠	°K	μΩ	μm	Sm <sup>3</sup>	GPS	m <sup>3</sup> /S	X10	μPa	%KW	X1000	←	Reset	Program	FPM X 10	KILOWATTS	Percent Current	Percent Horsepower
												SHAFT	Pounds	Frequency	LBS X 1000	Percent Load	OXYGEN PERCENT
												SPEED	Pulses	FUEL FLOW	MEGAWATTS	PERCENT OPEN	TEMPERATURE °C
												Setup	RUDDER	GALLONS	Power Factor	RATE OF TURN	TEMPERATURE °F
												TABLE	SPINDLE	IN. WATER	Phase Angle	STEAM TEMP °F	Motor Load Percent
												Total	SO ROOT	LEVEL FT.	RPM X 100	TONS / HOUR	LEFT RIGHT
												VALVE	Set Point	LBS X 100	STARBOARD	OIL PRESSURE	FRONT REAR
												Valley	THRUST	POSITION	TANK LEVEL	WATER LEVEL	FORWARD REVERSE
												WATTS	TURBINE	TONS X 10	VAC MM HG	1000 LBS/HOUR	TOP BOTTOM (L-119)

### **Fits 6" Edgewise Pointer Meter Cut-Outs**

The adapter snaps on the 36x144 mm (1.42"x5.69") case and enables single unit or stack mounting in an existing 6" edgewise pointer meter cut-out.

When extra panel mounting tightness is required, order the optional screw mount clip. P/N (OPMTLCLIP)

Adapter uses wide jaw mounting slide clips. P/N (75-DMC14436B)

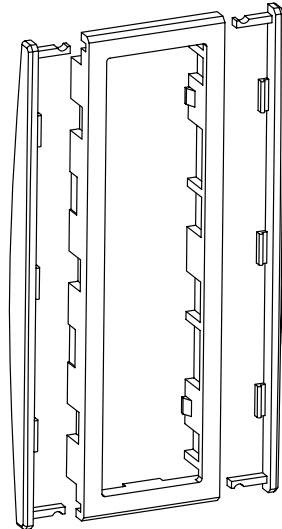


**Fits existing cut-outs for 6" (150 mm) edgewise switchboard pointer meters from:**

- Crompton
- G.E.
- Westinghouse
- Yokogawa
- and most others



Width: 43.7 mm to 48 mm (1.72" to 1.89")

Height: 143.4 mm to 149 mm (5.62" to 5.88")

Two bezel trim strips are provided with each adapter to finish off the edge of each individually mounted meter or the edge of each stack mounted array.

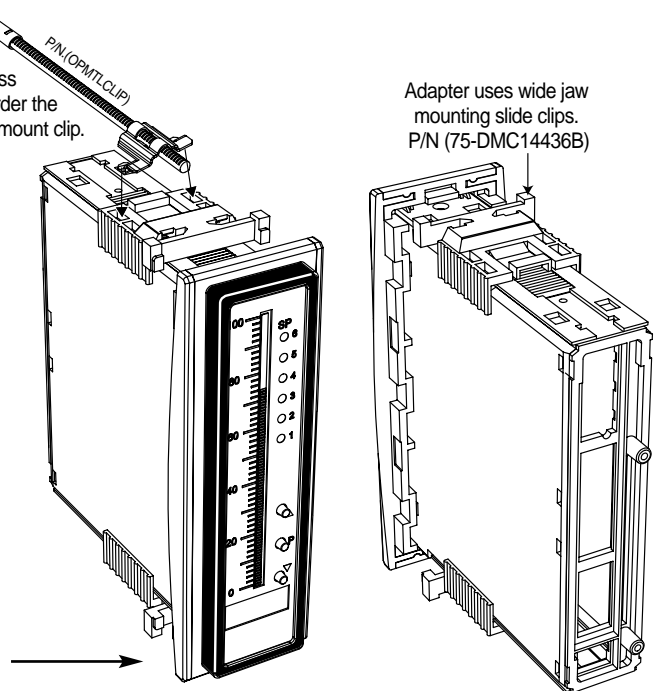


**Panel Adapter**  
Part #: OP-PA/144X36

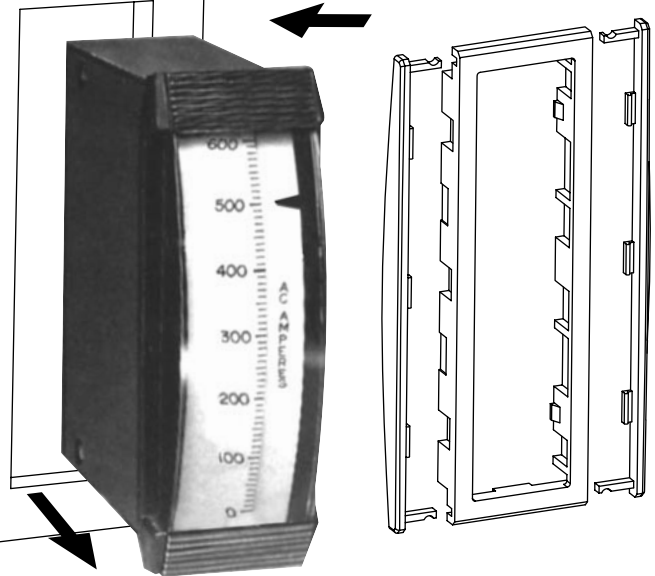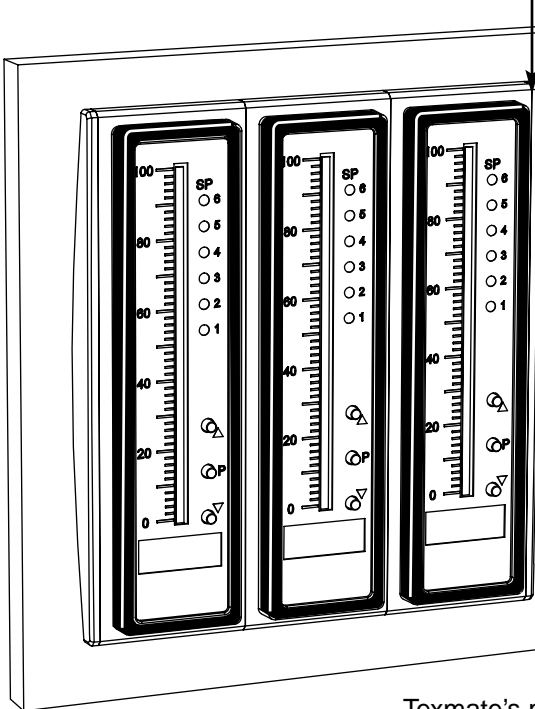

Texmate's panel adapter enables modern DIN meters to fit in existing cutouts individually or stacked when replacing old 6" edgewise mechanical pointer meters.

## Case Dimensions

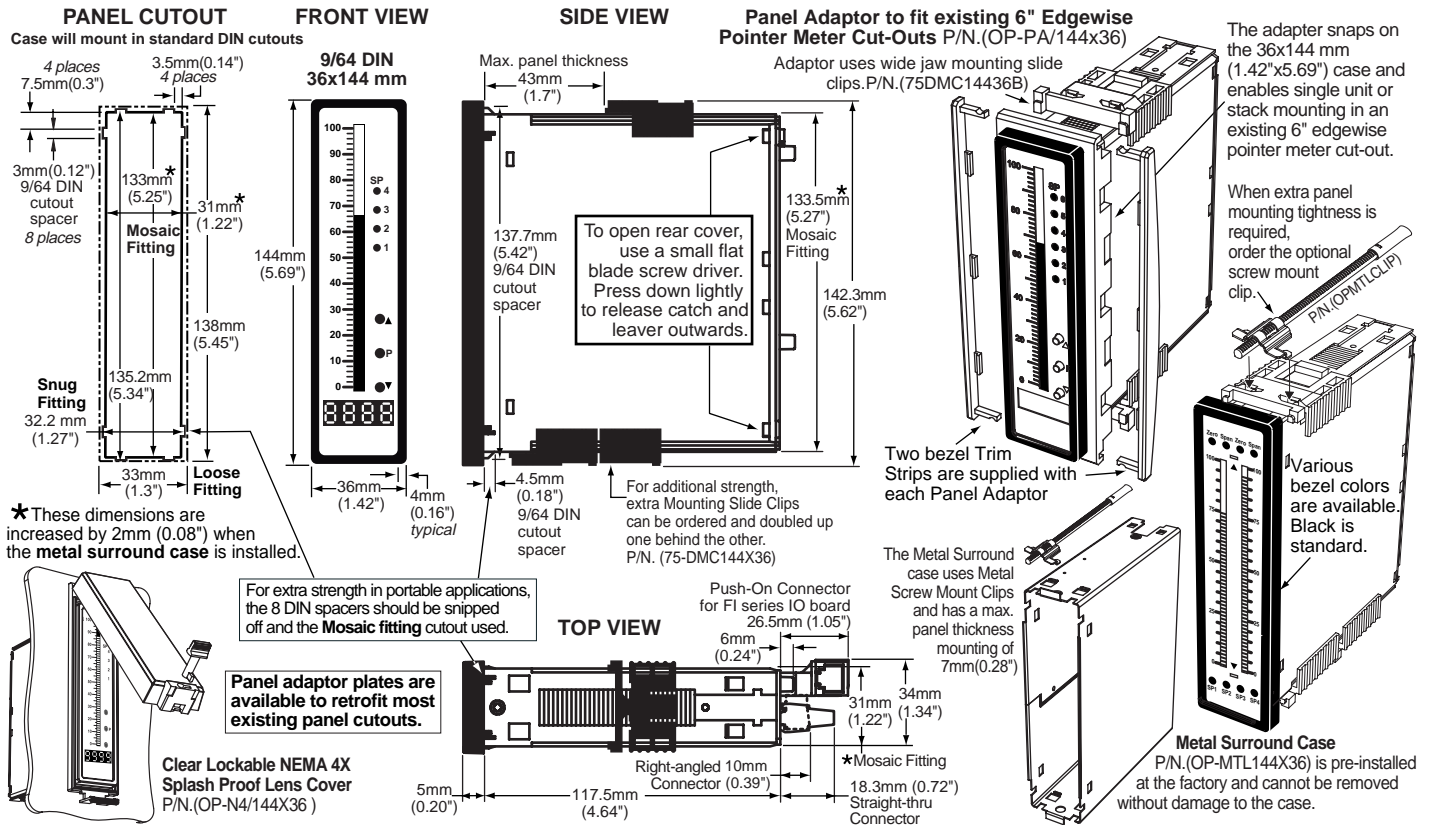

## Hinged Clear Lockable Polycarbonate NEMA 4X Splash Proof Cover

This rugged, impact resistant, clear lens cover is designed to be dust and water proof to NEMA 4 and IP65 standards. The lens cover consists of a base and cover with a cam hinge and key-lock locking device.


An O-ring, or neoprene gasket forms a seal between the base and the panel. When opened, a cam hinge prevents the cover from closing until pushed closed.

The cover has a tapered recess that, when closed, forms a capillary seal with a tapered ridge on the base. A capillary seal is created when capillary action causes a small amount of water to be drawn in between the two surfaces producing a water tight film around the sealing area.


For those applications, such as food processing, where fluid residues are unacceptable, apply a light coating of clear silicone grease, or other approved sealant to the mating groove to prevent any ingress of liquid and enable the cover to withstand steam cleaning.

Turning the key-lock tightens the cover to the base, ensuring seal integrity. A safety catch keeps the cover closed even when the key is turned to the open position and removed. The keyhole can also be used to attach a safety seal clip, preventing unauthorized opening.

**9/64 DIN**  
**36x144 mm (1.42"x5.69")**  
**P/N: OP-N4/144X36**

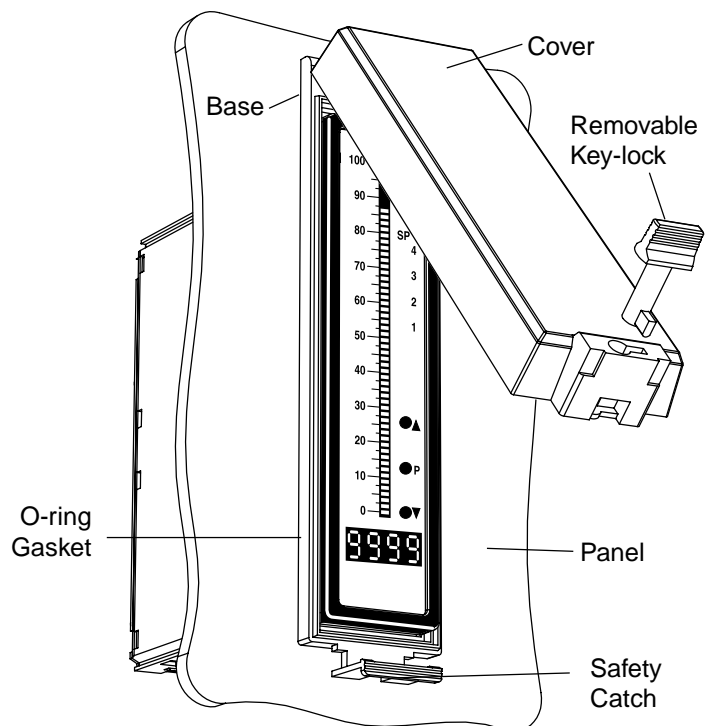

# Ordering Information

 

Add to the basic model number the order code suffix for each standard option required. The last suffix is to indicate how many different special options and or accessories that you may require to be included with this product.

Ordering Example: FL-B202Q-VRR-PS1-IA01-OIC-R11-OA2 plus CR-CHANGE and an OP-N4/144X36

## ► BASIC MODEL NUMBER

FL-B202Q . . . 144x36mm, Leopard, Dual 101 Segment Bargraph

## Standard Options for this Model Number

### Order Code Suffix

### Description

#### ► DISPLAY

HGG . . . Green / Green LED Bargraph, Horizontal  
 HGR . . . Green / Red LED Bargraph, Horizontal  
 HRG . . . Red / Green LED Bargraph, Horizontal  
 HRR . . . Red / Red LED Bargraph, Horizontal  
 VGG . . . Green / Green LED Bargraph, Vertical  
 VGR . . . Green / Red LED Bargraph, Vertical  
 VRG . . . Red / Green LED Bargraph, Vertical  
 VRR . . . Red / Red LED Bargraph, Vertical

#### ► POWER SUPPLY

PS1 . . . 85-265VAC/95-370VDC  
 PS2 . . . 15-48VAC/10-72VDC

#### ► INPUT MODULES (Partial List. See www.texmate.com)

Unless otherwise specified Texmate will ship all modules precalibrated with factory preselected ranges and/or scalings as shown in **BOLD** type.

IA01 . . . AC-Volts Scaled RMS, 200/**600V** AC  
 IA02 . . . AC-Volts Scaled RMS, 200mV/**2V**/20V AC  
 IA03 . . . AC-mA Scaled RMS, **2/20**/200mA AC  
 IA04 . . . AC-Amps Scaled RMS, **0-1 Amp AC (0-100.00)**  
 IA05 . . . AC-Amps Scaled RMS, **0-5 Amp AC (0-100.00)**  
 IA06 . . . AC-Volts True RMS, 200/**600V** AC  
 IA07 . . . AC-Volts True RMS, 200mV/**2V**/20V AC  
 IA08 . . . AC-mA True RMS, **2/20**/200mA AC  
 IA09 . . . AC-Amps True RMS, **0-1 Amp AC (0-100.00)**  
 IA10 . . . AC-Millivolt, Scaled RMS, **100mV** AC  
 IA11 . . . AC-Amps True RMS, **0-5 Amp AC (0-100.00)**  
 IA12 . . . AC-Millivolt, True RMS, **100mV** AC  
 ID01 . . . DC-Volts, **2/20**/200V/Custom w/24V DC Exc  
 ID02 . . . DC-Millivolt, 20/50/**100**/200mV DC w/24V DC Exc  
 ID03 . . . DC-Milliamper, **2/20**/200mA DC w/24V DC Exc  
 ID04 . . . DC-Amps, **5A** DC  
 ID05 . . . DC-Volts **2/20**/200/Custom V DC w/Offset and 24V Exc  
 ID07 . . . DC-Milliamper, **2/20**/200mA DC w/Offset and 24V Exc  
 ID09 . . . DC-Amps, **1A** DC  
 IDP4 . . . Dual Universal Process input **2V/10V/20V/200V/2mA/20mA/Custom**  
 IF02 . . . Line Frequency, 50-500VAC, 199.9Hz, or optional 400Hz  
 IGYZ\* . . . Universal Direct Pressure

\*View the IG- Ordering Code on page 15 to determine the value for Y & Z (IGAZ to IGKZ)

IP01 . . . Process Loop, **4-20mA(0-100.00)**  
 IP02 . . . Process Loop, **4-20mA(0-100.00)** w/24VDC Exc  
 IP03 . . . Process Input, **1-5V DC(0-100.00)** w/Offset, 24V Exc  
 IP07 . . . Universal Process **2V/5V/10V/20V/200V/2mA/20mA/Custom**  
 IPT1 . . . Prototype Board for Custom Design  
 IR02 . . . 3-Wire Potentiometer 1K $\Omega$  min (0-F.S.)  
 IR03 . . . Linear Potentiometer, 3-wire, 1K $\Omega$  min  
 IR05 . . . Resistance 2K $\Omega$   
 IS01 . . . Strain Gage 5/10VDC Exc., **20/2mV/V, 4/6-wire**  
 IS02 . . . Pressure 5/10VDC Exc., **20/2mV/V, 4/6-wire**  
 IS04 . . . Pressure Ext Exc., **20/2mV/V, 4/6-wire**  
 IS05 . . . Pressure/Load Cell 20/2mV/V, 5/10V Exc 4-wire  
 IS06 . . . Pressure/Load Cell Ext Exc., **20/2mV/V, 4-wire**  
 IS07 . . . Pressure 20/2mV/V with High Impedance and External Excitation  
 IT03 . . . RTD, 100 $\Omega$  Pt. **2/3/4-wire (-200 to 800°C)**  
 IT04 . . . RTD, 100 $\Omega$  Pt. **2/3/4-wire (-200 to 1470°F)**  
 IT05 . . . RTD, 100 $\Omega$  Pt. **2/3/4-wire (-190.0 to 199.0°F)**  
 IT06 . . . Thermocouple, J Type (**0-1400 °F**)  
 IT07 . . . Thermocouple, K Type (**0-1999°F**)  
 IT08 . . . Thermocouple, J Type (**0-760 °C**)

IT09 . . . Thermocouple, K Type (**0-1260°C**)

#### ► ANALOG OUTPUT

OIC . . . Isolated 16 Bit Current Output, 4-20mA  
 OIV . . . Isolated 16 Bit Voltage Output, 0-10VDC

#### ► RELAY OUTPUT

R11 . . . Single 10A Form C Relay  
 R12 . . . Dual 10A Form C Relays  
 R13 . . . Dual 10A Form C & One 5A Form A Relays  
 R14 . . . Dual 10A Form C & Dual 5A Form A Relays  
 R15 . . . Single 10A Form C & Dual 5A Form A Relays  
 R16 . . . Single 10A Form C & Single 5A Form A Relays

## Special Options and Accessories

### Part Number

### Description

► **SPECIAL OPTIONS (Specify Inputs or Outputs & Req. Reading)**  
 CR-CHANGE . . . Range change from the standard input as shown in **BOLD** type  
 CS-BAR . . . Custom Scaling within any Stnd. or Custom Selectable Range  
 COA-BAR . . . Custom Output - Special Scaling of Analog Output  
 CSR-SETUP . . . NRC to Set-up Custom Selectable Range  
 CSR-INSTL . . . Installation of Custom Selectable Range  
 CSS-SETUP . . . NRC to Set-up Custom Special Scaling  
 CSS-BR/INSTL . . . Installation of custom special scaling  
 COR-SETUP . . . NRC to Set-up Relays in non-standard locations  
 COR-INSTL . . . Installation of Relays in non-standard locations  
 CCL-SETUP . . . NRC to Set-up Custom Configuration - Functions, Codes  
 CCL-INSTL . . . Factory Installation - Custom Configuration

#### ► ACCESSORIES (Specify Serial # for Custom Artwork Installation)

75-DBZ144X36 . . . Black bezel for 144x36mm Case  
 75-DMC14436B . . . Wide Jaw Side Slide Brackets - wider than standard (2 pc)  
 75-DMC144X36 . . . Side Slide Brackets-stand. (2 pc) - extra set  
 93-PLUG2P-DP . . . Extra Screw Terminal Conn., 2 Pin Power Plug  
 93-PLUG2P-DR . . . Extra Screw Terminal Conn., 2 Pin Plug  
 93-PLUG3P-DR . . . Extra Screw Terminal Conn., 3 Pin Plug  
 93-PLUG4P-DR . . . Extra Screw Terminal Conn., 4 Pin Plug  
 93-PLUG5P-DR . . . Extra Screw Terminal Conn., 5 Pin Plug  
 DN.CAS144X36 . . . Complete 144x36mm Case with bezel  
 OP-MTLCLIP . . . Screw Mounting Clips (2 pc) - to screw tighten slide brackets  
 OP-N4/144X36 . . . 144x36mm clear lockable front cover-NEMA 4X, splash proof  
 OP-PA/144X36 . . . Panel Adapter for 144x36mm from 6 inch cutout  
 ART-LM-S/C . . . Custom Label, Meter - Artwork & set-up  
 ART-LM-S/C/D . . . Custom Label, Meter - Artwork & set-up + Co. Desc  
 ART-LM-001 . . . Produce & Install Custom Label per meter - 1 color  
 ART-LM-002 . . . Produce & Install Custom Label per meter - 2 color  
 ART-LM-003 . . . Produce & Install Custom Label per meter - 3 color  
 ART-LB-S/C . . . Custom Label, Box - Artwork & set-up  
 ART-LB-S/C/D . . . Custom Label, Box - Artwork & set-up + Co. Desc  
 ART-LB-001 . . . Produce & Install Custom Label per Box - 1 color  
 ART-LB-002 . . . Produce & Install Custom Label per Box - 2 color  
 ART-LB-003 . . . Produce & Install Custom Label per Box - 3 color  
 ART-LD-S/C . . . Custom Data Sheet - Artwork & set-up  
 ART-LD-S/C/D . . . Custom Data Sheet - Artwork & set-up + Co. Desc  
 ART-LD-001 . . . Print Data Sheet per meter - 1 color  
 ART-LD-002 . . . Print Data Sheet per meter - 2 color  
 ART-LD-003 . . . Print Data Sheet per meter - 3 color  
 ART-FB-S/L . . . Custom Faceplate - Artwork & setup Library  
 ART-FB-S/L/C . . . Custom Faceplate - Artwork & setup Library + Logo  
 ART-FB-S/N . . . Custom Faceplate - Artwork & setup Non-library  
 ART-FB-S/N/C . . . Custom Faceplate - Artwork & setup Non-library + Logo  
 ART-FB-001 . . . Produce & Install Custom Faceplate per meter - 1 color  
 ART-FB-002 . . . Produce & Install Custom Faceplate per meter - 2 color  
 ART-FB-003 . . . Produce & Install Custom Faceplate per meter - 3 color

Many other options and accessories are available. See full price list for more details.  
 Prices subject to change without notice.

## WARRANTY

Texmate warrants that its products are free from defects in material and workmanship under normal use and service for a period of one year from date of shipment. Texmate's obligations under this warranty are limited to replacement or repair, at its option, at its factory, of any of the products which shall, within the applicable period after shipment, be returned to Texmate's facility, transportation charges pre-paid, and which are, after examination, disclosed to the satisfaction of Texmate to be thus defective. The warranty shall not apply to any equipment which shall have been repaired or altered, except by Texmate, or which shall have been subjected to misuse, negligence, or accident. In no case shall Texmate's liability exceed the original purchase price. The aforementioned provisions do not extend the original warranty period of any product which has been either repaired or replaced by Texmate.

## USER'S RESPONSIBILITY

We are pleased to offer suggestions on the use of our various products either by way of printed matter or through direct contact with our sales/application engineering staff. However, since we have no control over the use of our products once they are shipped, **NO WARRANTY WHETHER OF MERCHANTABILITY, FITNESS FOR PURPOSE, OR OTHERWISE** is made beyond the repair, replacement, or refund of purchase price at the sole discretion of Texmate. Users shall determine the suitability of the product for the intended application before using, and the users assume all risk and liability whatsoever in connection therewith, regardless of any of our suggestions or statements as to application or construction. In no event shall Texmate's liability, in law or otherwise, be in excess of the purchase price of the product.

Texmate cannot assume responsibility for any circuitry described. No circuit patent or software licenses are implied. Texmate reserves the right to change circuitry, operating software, specifications, and prices without notice at any time.



1934 Kellogg Ave. Carlsbad, CA 92008

Tel: 1-760-598-9899 • USA 1-800-839-6283 • That's 1-800-TEXMATE

Fax: 1-760-598-9828 • Email: sales@texmate.com • Web: www.texmate.com

For product details visit [www.texmate.com](http://www.texmate.com)

Local Distributor Address