





Dust and Splash proof Membrane Face Plate

#### 4 Digit with 0.8" LEDs in a 1/8 DIN Case


# **EXMATE**

## **DX-40-ACV** with RMS option up to 600.0V AC Full Scale

Direct AC voltage measurement up to 600.0V AC with safe resistively isolated differential inputs, make this meter the OEM's choice for switchboard upgrades. Suitable to be used with PT's with Secondaries 100V/120V/240V and more.

## **General Features**

The DX-40-ACV is an cost-effective, high resolution, AC voltage measuring meter with two header selectable full scale ranges of 300VAC(avg.p/n:IA01))/600VAC(RMS p/n:IA06).The unique resistively isolated differential input of this meter allows safe measurement of phase to phase voltages. After selecting a new range, re-calibration is required. Display Hold and Display Test functions are also provided.

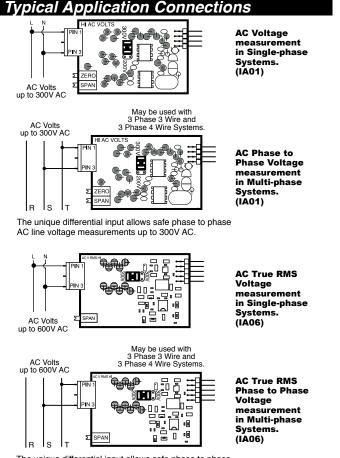

The unique differential input allows safe phase to phase AC true RMS line voltage measurements up to 600V AC.

#### Compatibility

The DX-Series have a matching DIN case style that is complementary to the Leopard and Tiger family of meters. DX-Meters are the OEM's choice for economical switchboard and process indication. For economy, each model is dedicated to a specific application and designed for guick and easy installation.



#### Specifications


Input Configuration:	Differential auto zeroing Volts average AC or true RMS AC Volts to DC
	converter. Inputs are resistively isolated to 1400V from internal ground of meter by 1.94M $\Omega$ ,so that phase to phase measurements up to 300V AC can be safely made.
Full Scale Ranges:	Two header selectable ranges of 200V AC and 300VAC(Avg. p/n:IA01) / 600VAC(RMS p/n:IA06) full scale
A/D Converter:	16 bit dual slope
Input Impedance:	4MΩ (minimum)
Accuracy:	±(0.05% of reading + 2 counts)
Temp. Coeff.:	100 ppm/°C (Typical)
Warm up time:	2 minutes
	3 conversions per second (Typical)
Display:	4 digit 0.8" Red LED display (std),
	0.8" Green is optional.Range 0 to 9999 counts.
	Header under face plate, •X•X•X•X
Positive Overrange:	
	Negative sign - and All 0000 flash.
	AC/DC Auto sensing wide range supply 85-265 VAC, 50-400Hz / 95-300 VDC @1.5W
	15-48 VAC, 50-400Hz / 10-72 VDC @4.0W
Operating Temp.:	
Storage Temp:	
Relative Humidity:	95% (non condensing)
	1/8 DIN, Bezel: 96x48 mm (3.78"x1.89")
	Depth behind bezel: 117 mm (4.61")
	Plus 11.8 mm (0.47") for Right-angled
	connector or plus 20 mm (0.79") for Straight-
	thru connector.
	8 oz., 11 oz when packed.
Certification:	UL Listed.

#### DX-Series, the OEMs choice for switchboard and process indication

DX-35-DCVDC volts ±2V/±20V/±200V Header Selectable Ranges, 3.5 digit	DX-35-TC-KF K Thermocouple with °F, optional °C, 3.5 digit
DX-35-DCADC mV ±50mV, ±100mV, ±200mV Header Selectable Ranges, 3.5 digit	DX-35-TC-JFJ Thermocouple with °F, optional °C, 3.5 digit
DX-35-ACVAC volts, Scaled RMS 199.9/300V AC (True RMS Opt. 600V AC).	DX-35-RTD-F100Ω platinum RTD, 3 or 4 wire, °F in 1° resolution, optional ℃,3.5 digit
Header Selectable Ranges, 3.5 digit	DX-40-ACV AC volts, Scaled RMS 300.0V full scale (True RMS 600V AC) , 4 digit
DX-35-ACAAC amps, Scales RMS (True RMS Opt.). (5 Amp Internal Shunt), 3.5digit	DX-45-ACA AC amps, Scaled RMS (True RMS Opt.). (5 Amp Internal shunt), 4.5 digit
DX-35-CL Process 4 to 20mA (100.0), easily user scalable, 3.5 digit w/Exc. opt	DX-45-DCVDC volts ±2V/±20V/±200V Header Selectable Ranges, 4.5 digit
DX-35-HZ AC Line Frequency 15.0Hz to 199.9Hz. Up to 300V AC input, 3.5 digit	DX-45-DCADC mV ±50mV/±100mV/±200mV Header Selectable Ranges, 4.5 digit
	DX-45-CL Process 4 to 20mA (100.00), easily user scalable, 4.5 digit w.Exc opt.

#### **Connector Pinouts**

This meter uses plug-in type screw terminal connectors for all connections.

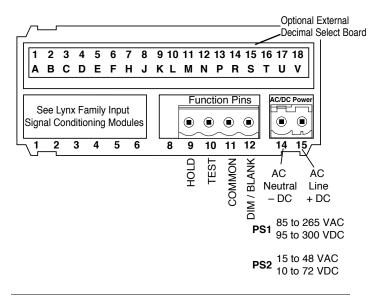

## **Pin Descriptions**

**Pin 1 - Signal Input High:** Signal high input for the meter. Full scale ranges of 200.0VAC or 300.0VAC(IA01)/600.0VAC(IA06) can be selected on the Range Select Header.

Pin3-Signal Input Low: Signal low input for the meter.

**Pin 9** - Hold: If this pin is left unconnected the meter will operate in a free running mode. When this pin is connected to the Common Pin 11, the meter display will be latched. A/D conversions will continue, but the display will not be updated until Pin 9 is disconnected from Pin 11.

**Pin 10** - Display Test: When this pin is connected to the Common Pin 11, all segments of the display light up and 1888 is displayed. This is used to detect any missing segments in the display.

**Pin 11** - Common: To Hold, Test or Dim the display, the respective pins have to be connected to this Common Pin.

**Pin 12** - Dim/Blank: When this pin is connected to the Common Pin 11 the display is blanked out. If it is connected through an external  $1K\Omega$  pot, the display may be dimmed.

**Pin 14 & 15** - AC/DC Power Input: These pins are the power pins of the meter and they only accept a special polarized screw terminal plug that can not be inserted into any other input socket. The standard meter has a auto sensing AC/DC power supply that operates from 85-265 VAC/95-300 VDC (PS1 Std). An optional isolated low voltage power supply that operates from 15-48 VAC/10-72 VDC (PS2) is also available.

#### **OPTIONAL EXTERNAL DECIMAL POINT SELECTION BOARD**


- Pins 6, F Decimal Common: Connect to these pins to activate decimals.
- Pins 7, H Decimal XXXX.: Connect to pin 6 or pin F to activate decimal XXXX.
- Pins 8, J Decimal XXX.X: Connect to pin 6 or pin F to activate decimal XXX.X.
- Pins 9, K Decimal XX.XX: Connect to pin 6 or pin F to activate decimal XX.XX.
- Pins 10, L Decimal X.XXX: Connect to pin 6 or pin F to activate decimal X.XXX.

## **Calibration Procedure**

- 1. Select the required full scale voltage range by re-positioning the jumper clip on the Range Select Header. A range of 200.0V AC or 300.0V/600.0V AC full scale may be selected.
- 2. Apply an input of 0 Volt AC to the meter by shorting the inputs. The meter will auto zero and display zero.
- If you need to offset zero, order the Optional Zero Offset Pot and adjust until the meter reads 0000.
- 4. Apply a known high input signal that is within the full scale voltage range selected.
- 5. Adjust the Span Pot until the meter displays the required reading for the signal being applied.
- 6. The DX-40-ACV is now calibrated and ready for use.

(Whenever a new range is selected, re-calibration is required to meet the specified accuracy).

#### Component Layout

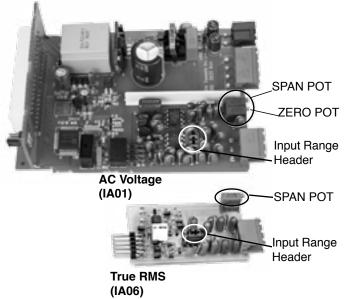

## Signal Conditioning Components

#### INPUT RANGE Header



Range values are marked on the PCB. Two positions are provided. After selecting a new range with the single jumper clip, re-calibration is required.



#### SPAN Potentiometer (Pot)

The 15 turn SPAN pot is always on the right side (as viewed from the front of the meter). Typical adjustment is 20% of the input signal range.



Turn Clockwise to

Increase Reading

ZERO Potentiometer (Pot)


The Optional ZERO pot when installed is always to the left of the SPAN pot (as viewed from the front of the meter). Typically it enables the displayed reading to be offset  $\pm 1000$  counts.

## **Opening Back Panel**



To open back panel, insert a flat screwdriver or similar instrument in both slots on the top of the case and pry open. The DX-Series meters slide out from the rear of the case as a complete assembly.

## **Decimal Point Selection**

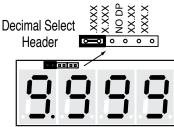

0.8" Display




Decimal selection is made by moving the jumper to the indicated position on the header for the decimal required on the front of the display board.

An optional output board is available that provides access to all decimal points via a rear PCB edge

Optional External Decimal Point connector. Selection Board

#### Connectors

This meter uses plug-in type screw terminal connectors for all input and output connections. The power supply connections (pins 14 and 15) have a unique plug and socket outline to prevent cross connection. The main board uses standard right-angled connectors.

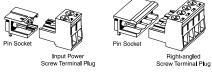



WARNING: AC and DC input signals and power supply voltages can be hazardous. Do Not connect live wires to screw terminal plugs, and do not insert, remove or handle screw terminal plugs with live wires connected.

## Installation Guidelines

1. Install and wire meter per local applicable codes/regulations, the particular application, and good installation practices.

2. Install meter in a location that does not exceed the maximum operating temperature and that provides good air circulation.

3. Separate input/output leads from power lines to protect the meter from external noise. Input/output leads should be routed as far away as possible from contactors, control relays, transformers and other noisy components. Shielding cables for input/output leads is recommended with shield connection to earth ground near the meter preferred.

4. A circuit breaker or disconnect switch is required to disconnect power to the meter. The breaker/switch should be in close proximity to the meter and marked as the disconnecting device for the meter or meter circuit. The circuit breaker or wall switch must be rated for the applied voltage (e.g., 120VAC or 240VAC) and current appropriate for the electrical application (e.g., 15A or 20A).

5. See *Case Dimensions section* for panel cutout information.

6. See Connector Pinouts section for wiring.

7. Use 28-12 AWG wiring, minimum 90°C (HH)
temperature rating. Strip wire approximately 0.3 in. (7-8 mm).
8. Recommended torque on all terminal plug screws is 4.5 lb-in (0.51 N-m).

#### Metal Surround Case Option

The meter's plastic case is made from fire retardant polycarbonate. A metal surround case can be ordered to enhance the meter's fire retardant capabilities and also provide shielding against electromagnetic interference (EMI). The metal case slides over the polycarbonate case and is held firmly in place by spring-type non-return clips. The Metal Surround Case must be factory installed on the polycarbonate case and once installed, it cannot be removed in the field.

With the metal case in place, the meter's standard ratchet-type mounting clips can not be used. Instead a pair of screw-type DIN standard mounting clips are provided, which clip into holes on the side of the metal case and tighten against the rear of the panel. A ground tab on the metal case enables the metal case to be easily connected to the panel ground.



#### Clear Lockable Water-proof Cover

The clear lockable cover is designed to be dust and water proof to NEMA-4X, IP65 standards. The assembly consists of a base and cover with a cam hinge and key-lock fastening mechanism. An O-ring, or neoprene gasket forms a seal between the base and the panel. The cam hinge prevents the cover from closing when opened until pushed closed. The cover has a tapered recess that, when closed, forms a seal with a tapered spigot on the base. A key-lock employs a cam locking device to force the spigot into the recess, ensuring seal integrity. A safety catch keeps the cover closed even when the key is removed, and the




## **Optional Face Plate Descriptors**



To customize the face plate, clear adhesive label containing various popular descriptors may be ordered. Choose the descriptor desired, peel off the adhesive backing and align the descriptor in the center right of the faceplate.

P.N.: 75-DESCRIPTR

## **DX** Case Dimensions and Panel Cutouts

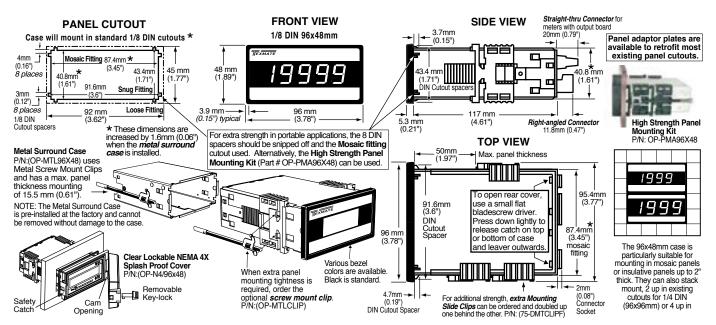

## Ordering Information

Standard Options	for this Model Number	
Part Number	Description	List
display and standard p DX-40-ACVAC Vo	<b>ER</b> Includes plug in type screw termi ower supply unless optional versic bits, Scaled RMS.200.0/ <b>300.0V AC</b> IA bits, True RMS.200.0/ <b>600.0V AC</b> IA06	ons are ordered. A01
► DISPLAY LRLarge Red LE LGLarge Green L	<b>D, 0.8 inch high</b> ED, 0.8 inch high	
	300VDC	

Special Options and Accessories			
Part Number	Description	List	
NODECIAL ODTIONS (Con	aify Innuts or Autnuts 9 Pag. Pooding	<b>`</b>	

#### SPECIAL OPTIONS (Specify Inputs or Outputs & Req. Reading)

ZR	. Range Change from Standard Range shown in <b>BOLD</b> type
ZS	. Custom display scaling within standard ranges
OP-DXEXTDP.	. External Dec. Pt. W/Conn. Option-Factory Installed

#### ► ACCESSORIES (Specify Serial # for Custom Artwork Installation)

75-DBBZ9648FExtra Black Bezel for 96x48mm Case
76-D35G-N4NEMA 4 Green LED Faceplate, Factory Installed.
76-D35LG-N4 NEMA 4 Large Green LED Faceplate, Factory Installed
76-D35LR-N4 NEMA 4 Large Red LED Faceplate, Factory Installed
76-D35R-N4 NEMA 4 Red LED Faceplate, Factory Installed.
CN-L18Dual Row 18 Pin Edge Connector, Solder Type
DN.CAS96X48B .Complete 96 X 48 mm Case with bezel
OP-MTLCILP Screw Mount Clips (2 pc) - to screw tighten slide brackets
OP-MTL96X48 Metal Surround Case, includes screw mounting clips
OP-N4X/96X4896x48mm clear lockable front cover-NEMA 4X, splash proof
OP-PSA/96X48. Panel to Case Seal Adapter with O-Ring and Foam Gasket.
75-DESCRIPTRClear adhesive descriptors label for face plate .

#### WARRANTY

WARHANTY Texmate warrants that its products are free from defects in material and workmanship under normal use and service for a period of one year from date of shipment. Texmate's obligations under this warranty are limited to replacement or repair, at its option, at its factory, of any of the products which shall, within the applicable period after shipment, be returned to Texmate's facility, transportation charges pre-paid, and which are, after examination, disclosed to the sat-isfaction of Texmate to be thus defective. The warranty shall not apply to any equipment which shall have been repaired or altered, except by Texmate, or which shall have been subjected to misuse, negligence, or accident. In no case shall Texmate's liability exceed the original pur-chase price. The aforementioned provisions do not extend the original warranty period of any product which has been either repaired or replaced by Texmate.

#### USER'S RESPONSIBILITY

We are pleased to offer suggestions on the use of our various products either by way of printed matter or through direct contact with our sales/application engineering staff. However, since we have no control over the use of our products once they are shipped, NO WARRANTY WHETHER OF MERCHANTABILITY, FITNESS FOR PURPOSE, OR OTHERWISE is made beyond the repair, replacement, or refund of purchase price at the sole discretion of Texmate. Users shall determine the suitability of the proDXct for the intended application before using, and the users assume all risk and liability whatsoever in connection therewith, regardless of any of our suggestions or statements as to application or construction. In no event shall Texmate's liability, in law or otherwise, be in excess of the purchase price of the product.

Texmate cannot assume responsibility for any circuitry described. No circuit patent or software licenses are implied. Texmate reserves the right to change circuitry, operating software, speci-fications, and prices without notice at any time.



Smart Measuring Smart Control 1934 Kellogg Ave., Carlsbad, CA 92008 Tel: 1-760-598-9899 • 1-800-TEXMATE Fax: 1-760-598-9828 · Email: orders@texmate.com

DX-40-ACV Technical Manual Copyright © 2020 Texmate Inc. All rights reserved. Published by: Texmate Inc. USA. Information in this Technical Manual is subject to change without notice due to correction or enhancement. The information described in this manual is proprietary to Texmate, Inc. and may not be copied, reproduced or transmitted, in whole or in part, in connection with the design, manufacture, or sale of apparatus, device or private label product without the express written consent of Texmate, Inc.