21-22 series

POWERSTAT Variable Transformers of the 21-22 Series are of open construction and are primarily designed for back-of-panel mounting. The rated output for the type 21 Series is 5 amperes for constant current loads and 7 amperes for constant impedance loads. For the 22 Series, the rated output is 2.25 amperes for constant current loads and 3.25 amperes for constant impedance loads. The 21 Series types operate from 120 volt lines and the 22 Series types from 240 volt lines. The tapping arrangement permits an output voltage range of zero to line voltage or zero to 17 percent above line voltage. As shown in Figure A, 21-22 Series POWERSTAT Variable Transformers can be operated at any frequency between 50 and 2000 hertz without reduction in allowable output current. Figure B shows the regulation curves for operating at full rated load. The curves show the voltage drop at any brush setting when full load is applied. Voltage drops for loads less than full load are proportional. Driving torque, d-c resistance per coil and maximum core and brush loss when operating under no load are given in the chart. All manually




TYPE 21

operated units have a 3 3/4 inch (95.3mm) dial graduated 0-100 and an angle of rotation of 320° from the zero to maximum output voltage. Adjustable shafts can be extended from either end of the units, permitting general utility mounting if desired. In addition to the conventional screw-type method of connection, terminal adapters supplied with the units can be quickly mounted on the terminals for use with push-on connectors or soldered connections.

Motor-driven units in the 21-22 Series are designated by a letter M prefix in the type number. When ordering, prefix the motor-driven type number with the desired motor speed in seconds. Example: 5M21-2

CONNECTIONS AND RATINGS


		INI	PUT	OUTPUT											
					CONS CURI LO	RENT	CONS IMPED LO	ANCE	KNOB			TERMI			
TVDE	CONNEC-	VOLTE	UEDT7	VOLTE	MAX.	MAX.	MAX.	MAX.	ROTA-		B ON BASE			ON RADIAT	
TYPE	TION	VOLTS	HERTZ	VOLTS	AMPS.	KVA	AMPS.	KVA	TION	INPUT	JUMPER*	OUTPUT	INPUT	JUMPER*	OUTPUT
	#1 Single			0-120	5	0.60	7	0.84	CW	1-4		3-4	1-4	_	1-3
21		120	50/60						CCW	1-4		1-3	1-4	_	3-4
M21§	Phase			0-140	5	0.70		_	CW	4-5	-	3-4	1-2	-	1-3
				3 140		0.70			CCW	1-2		1-3	4-5	_	3-4
	#1			0-240	2.25	0.54	3.25	0.78	CW	1-4		3-4	1-4	_	1-3
22	#1	240	50/60	0 210	2.20	0.01	0.20	0.70	CCW	1-4		1-3	1-4	_	3-4
M22§	Single Phase	240	30/60	0-280	2.25	0.63			CW	4-5		3-4	1-2	_	1-3
				0-200	2.20	0.63			CCW	1-2		1-3	4-5	_	3-4
											F				
	110			0-240	0-240 5	1.2	7	1.7	CW	1-1	4-4	3-3	4-4	1-1	3-3
	#2 1-Phase	240	50/60	0 2 10		1.2	B'	1/	CCW	4-4	1-1	3-3	1-1	4-4	3-3
	Series	240	30/00	0-280	5	1.4			CW	5-5	4-4	3-3	2-2	1-1	3-3
21-2									CCW	2-2	1-1	3-3	5-5	4-4	3-3
M21-2§	#2			0-120	20 5	1	7	1.5	CW	1-4-1	4-4	3-4-3	4-1-4	1-1	3-1-3
	3-Phase Open	120	50/60		140 5	1.2	_	-	CCW	4-1-4	1-1	3-1-3	1-4-1	4-4	3-4-3
	Delta			0-140					CW	5-4-5	4-4	3-4-3	2-1-2	1-1	3-1-3
									CCW	2-1-2	1-1	3-1-3	5-4-5	1-1	3-4-3
	#2			0-480	2.25	1.1	3.25	1.6	CCW	4-4	1-1	3-3	1-1	4-4	3-3
	1-Phase	480	50/60	0-560 2.					CW	5.5	4-4	3-3	2-2	1-1	3-3
22-2	Series				2.25	1.3		-	CCW	2-2	1-1	3-3	5-5	4-4	3-3
M22-2§	#2		50/60	0-240	2.25	0.94	3.25	1.4	CW	1-4-1	4-4	3-4-3	4-1-4	1-1	3-1-3
	#2 3-Phase	240						1.4	CCW	4-1-4	1-1	3-1-3	1-4-1	4-4	3-4-3
	Open	240		0-280 2.25	1.1			CW	5-4-5	4-4	3-4-3	2-1-2	1-1	3-1-3	
	Delta			2 200	2.20				CCW	2-1-2	1-1	3-1-3	5-4-5	4-4	3-4-3
			50/60	0-240	5	2.1	7	20	CW	1-1-1	4-4-4	3-3-3	4-4-4	1-1-1	3-3-3
21-3	#3	240	30/60	0-240	3	2.1	'	2.9	ccw	4-4-4	1-1-1	3-3-3	1-1-1	4-4-4	3-3-3
M21-3§	3-Phase Wye	240	60	0.200	80 5	24		-	CW	5-5-5	4-4-4	3-3-3	2-2-2	1-1-1	3-3-3
	wye			0-280		2.4			ccw	2-2-2	1-1-1	3-3-3	5-5-5	4-4-4	3-3-3
			50.000	0.400	0.05	1		5 - 5	CW	1-1-1	4-4-4	3-3-3	4-4-4	1-1-1	3-3-3
22-3	#3	480	50/60 60	0-480	2.25	1.9	3.25	2.7	ccw	4-4-4	1-1-1	3-3-3	1-1-1	4-4-4	3-3-3
M22-3§	3-Phase Wye				560 2.25 2.2				CW	5-5-5	4-4-4	3-3-3	2-2-2	1-1-1	3-3-3
- 08	wye			0-560		-	-	ccw	2-2-2	1-1-1	3-3-3	5-5-5	4-4-4	3-3-3	




^{*}Jumper provided in standard common position should be moved or removed as required.



CONNECTION 1



CONNECTION 2



CONNECTION 3

CONNECTIONS
SHOWN ARE FOR
CW KNOB
ROTATION,
KNOB ON BASE END
(CCW ROTATION,
KNOB ON RADIATOR END)

[§]Motor-driven types use connections for CW rotation, knob on radiator end.

[†]Fuse recommended, not supplied.



M	0	T	0	R-	D	R	IV	EN	T	P	ES
---	---	---	---	----	---	---	----	----	---	---	----

TYPE		ximate Torque KpCm	No-Load Loss at 60 Hertz† (Watts)	D-C Resistance per Coil*† (Ohms)		
21	15-25	1.1-1.8	3.0	4.4		
21-2	35-45	2.5-3.2	6.0	4.4		
21-3	70-80	5-5.8	9.0	4.4		
22	20-30	1.4-2.2	3.0	10.8		
22-2	45-60	3.2-4.3	6.0	10.8		
22-3	70-90	5-6.5	9.0	10.8		

†Data applies to M prefixed models also.

^{*}Measured from start to end of winding.

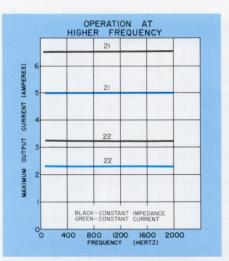


FIGURE A


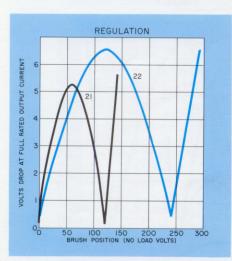



FIGURE B

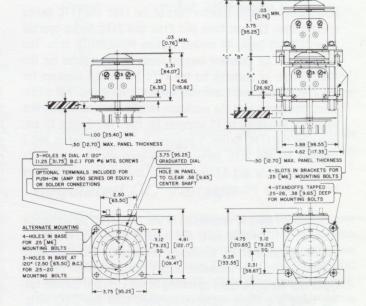


SINGLE MANUAL


GANGED MANUAL

TYPE	"A"	"B"	"C"	"D"	"E"
2-GANG	2.69	7,50	8.75	7.38	13.39
	[68.32]	[190.50]	[222.25]	[187.45]	[340.11]
3-GANG	6.12	10.94	12.19	10.81	16.83
	[155.45]	[277.87]	[309.63]	[274.57]	[427.48]

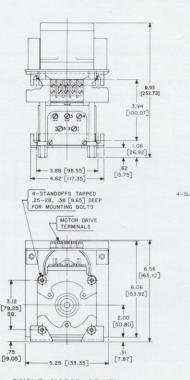

SINGLE MOTOR DRIVEN

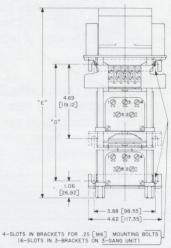

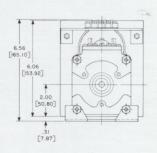

GANGED MOTOR DRIVEN